

University of Huddersfield Repository

Wright, Daniel

Introduction of a Semi Automatic Quality Control Process into an SME

Original Citation

Wright, Daniel (2011) Introduction of a Semi Automatic Quality Control Process into an SME. Masters thesis, University of Huddersfield.

This version is available at http://eprints.hud.ac.uk/id/eprint/17554/

The University Repository is a digital collection of the research output of the University, available on Open Access. Copyright and Moral Rights for the items on this site are retained by the individual author and/or other copyright owners. Users may access full items free of charge; copies of full text items generally can be reproduced, displayed or performed and given to third parties in any format or medium for personal research or study, educational or not-for-profit purposes without prior permission or charge, provided:

- The authors, title and full bibliographic details is credited in any copy;
- A hyperlink and/or URL is included for the original metadata page; and
- The content is not changed in any way.

For more information, including our policy and submission procedure, please contact the Repository Team at: E.mailbox@hud.ac.uk.

http://eprints.hud.ac.uk/

INTRODUCTION OF A SEMI AUTOMATIC QUALITY CONTROL PROCESS INTO AN SME

DANIEL WRIGHT

A Thesis submitted to the University of Huddersfield in partial

fulfillment of the requirements for the degree of Master of

Research

Knowledge Transfer Partnership between the University of Huddersfield and Craftsman Tool Ltd.

November 2011

I Abstract

The purpose of this thesis is to show considerations made when designing and implementing a semi automatic quality control process into an SME; Craftsman Tools Ltd. Small batches are produced at any one time, usually of quantities of around 5 to 10 parts. The drive for change arises because the tolerances required becoming ever tighter.

Investigation has been made in to other systems and processes in operation for comparisons. Most systems, however, are aimed at large batch, mass manufacture, and not at an SME producing small quantities, which this research will address. Machine Analysis has been conducted to evaluate and monitor the condition of the machine during the project and beyond. This information will be used to create a solid benchmark for machine performance.

A system was selected, implemented and tested on the machine tool for automating part manufacture and inspection providing closed loop feedback information for "right first time" part manufacture.

Results are discussed and conclusions made for the feasibility of the systems and the machine analysis.

II Acknowledgements

I would like to thank all those involved throughout the project and for their belief and support for making the project possible.

The academic team for their contribution and support, Professor Alan Myers, Dr Andrew Longstaff and Dr Simon Fletcher.

The company, Craftsman Tools, for the investment made in the project, Mr. Robert Johnson – Managing Director, Mr. Stephen Murgatroyd – Company Supervisor and Wilfred Morrow – Staff Technician.

I would also like to thank my family for their support during the project period.

This Partnership received financial support from the Knowledge Transfer Partnerships programme (KTP). KTP aims to help businesses to improve their competitiveness and productivity through the better use of knowledge, technology and skills that reside within the UK knowledge base. KTP is funded by the Technology Strategy Board along with other government funding organisations.

III Contents

I Abstract	2
III Contents	4
IV Table of Figures	7
V Table of tables	8
Chapter 1 – Introduction	9
1.1 Aims	10
1.2 Objectives	11
1.3 Chapter Outline	11
1.4 Summary	12
Chapter 2 – Literature Review	13
2.1 Introduction	13
2.2 Machine Tool Errors	13
2.3 Machine Tool Maintenance	16
2.4 SPC and Quality Control	17
2.5 Probing Systems	18
2.6 Systems in use	20
2.7 Software Systems	
2.8 BallBar	22
2.9 Summary	
Chapter 3 – Initial Processes and Systems	23
3.1 Introduction	24
3.2 Initial Processes and Systems	24
3.3 Summary	
Chapter $4 - Proposed Processes and Systems$	34
A 1 Introduction	34
4.7 Description of Processes and Systems	34
4.2 Description of Processes and Systems	39
A A Machine Analysis and condition	
4.5 Summary	
Chapter 5 – System Selection	ΔA
5.1 Introduction	
5.2 System Selection	 11
5.2 5 ystem Selection	
5.2.1 Subtriction of Equipment	
5.2.2 Selection of Equipment	- 0 /8
5.2.5 Turchase of Equipment	4 0 // 8
5.3 1 Probes	4 0 // 2
5.2.2 Softwara	- 0
5.3.2 Softwale	42
5.5.5 System Selection Scoring Matrix	
5.4 Costing Analysis	32
5.5 Handware and Saftware Salaction	
5.5 Flandware and Software Experience	
5.0 nardware and Software Functionality	
5.7 1 Demofite	
5.7.1 Benefits	
5. / .2 Drawbacks	59

5.7.3 Costs	60
5.7.4 Training	61
5.8 Summary	61
Chapter 6 – Implementation.	63
6.1 Introduction	63
6.2 Implementation	63
Identification of Key Processes	63
6.2.1 Priority Cell	63
6.2.2 Priority Machine	63
6.2.3 Probe	64
6.2.4 Software	64
6.3 Processes	70
6.3.1 Processes for Implementation	70
6 3 2 Testing	70
633 Investment Requirements	71
6 3 4 Implementation Plan	72
6 3 5 Process Pyramid Stages	78
6 3 5 1 Preventative	78
6.3.5.2 Design for manufacture	78
6.3.5.2 Design for manufacture	78
6.3.5.4 Machine canability	70
6.3.5.5 Probe qualification	79
6.2.5.6 Productive	79 00
6.2.5.7 Machine chaolt	00
6.3.5.7 Machine check	00
6.5.5.8 Tooling suite check	80
6.3.5.9 Component in fixture check	80
6.3.5.10 Correct part check	80
6.3.5.11 WPC set	81
6.3.5.12 1001 set	81
6.3.5.13 Active	82
6.3.5.14 Thermal track	82
6.3.5.15 Tool offsets	82
6.3.5.16 Broken tool check	82
6.3.5.17 Informative	83
6.3.5.18 Updates	83
6.3.5.19 Finished and roughing sizes	83
6.4 BallBar	85
6.4.1 Hardware	85
6.4.2 Software	85
6.4.3 Process – Test Method	85
6.5 Summary	92
Chapter 7 – Testing and Results	93
7.1 Introduction	93
7.2 Testing and Results	93
7.2.1 Development of Systems – M&H Systems	93
7.2.2 Development of Systems – Renishaw	114
7.2.3 Gauge R&R Data	115
7.3 Probing of the Part – Test Results	118
7.4 Batch Inspection Results	123
7.5 Inspection Reports	125

7.6 Production Data	126
7.7 BallBar testing and results	
7.8 Summary	133
Chapter 8 – Conclusions and Further Work	134
8.1 Introduction	134
8.2 Conclusions	134
8.3 Cost savings brought about from the system	136
8.3.1 Direct Savings	136
8.3.2 Indirect savings	136
8.3.3 Maintenance costs	137
8.4 Further Work	137
Chapter 9 – References	
Chapter 10 – Appendices	141
10.1 ISO Programs	141
10.2 BS EN ISO Standards	
10.3 BallBar Method	
10.4 BallBar Test Part Programs	154
10.5 Inspection Reports	157

IV Table of Figures

Figure 1: Process flow from customer input through to shipment of part to custome	er25
Figure 2: Current processes for manufacture on the factory shop floor	29
Figure 3: Benchmark flow chart	38
Figure 4: Parts made comparison	40
Figure 5: Example BallBar trend graph	43
Figure 6: Test part model in the Renishaw AE PRO Software	66
Figure 7: A feature being created on the model for inspection	66
Figure 8: The tool, which will be updated from the feature.	67
Figure 9: Logic statement being built within the software to control a specific upda	ite.
	67
Figure 10: Customised error messages can be displayed for the operator	68
Figure 11: Another feature measurement being created	68
Figure 12: Writing the measured value in to a variable number on the machine tool	l
controller	69
Figure 13: Manual G-code inserted	69
Figure 14: General implementation flow chart	72
Figure 15: Calibration procedures	73
Figure 16: Process flow chart	76
Figure 17: Process Pyramid	77
Figure 18: Tooling file	84
Figure 19: Renishaw BallBar 20 software Advanced mode home screen	86
Figure 20: BallBar test setup screen - machine creation or selection	86
Figure 21: BallBar test setup screen - plane selection	87
Figure 22: BallBar test results selection screen	87
Figure 23: BallBar test setup - machine addition screen	88
Figure 24: BallBar test setup - parameter screen	88
Figure 25: BallBar test setup - direction and limits screen	89
Figure 26: BallBar test setup - part program creation	89
Figure 27: BallBar test running on probing implementation machine	91
Figure 28: BallBar test running on probing implementation machine	91
Figure 29: Flow chart	96
Figure 30: Flow chart	99
Figure 31: Flow chart	102
Figure 32: Flow chart	106
Figure 33: Flow chart	109
Figure 34: Mazatrol program screen capture	113
Figure 35: Measurement comparisons graph	119
Figure 36: CMM Report	120
Figure 37: CMM Report	121
Figure 38: CMM Report	122
Figure 39: Component inspection report	123
Figure 40: Component inspection report	123
Figure 41: Component inspection report	124
Figure 42: Component inspection report	124
Figure 43: SPC Graph	125
Figure 44: Production data comparison graph	128
Figure 45: Smashed Probe following an accident on machine	129

Figure 46: Smashed Probe following an accident on machine	129
Figure 47: Ballbar test results	130
Figure 48: Ballbar test results	130
Figure 49: Ballbar test results	131
Figure 50: Ballbar test results	131
Figure 51: Ballbar test results	
Figure 52: Ballbar test results	132

V Table of tables

Table 1: Probing hardware scoring matrix	51
Table 2: Probing software scoring matrix	52
Table 3: 2009 Cash flow	54
Table 4: 2008 Cash flow	55
Table 5: Process responsibilities	75
Table 6: Initial Mazatrol trials	95
Table 7: Revised Maztrol trial	
Table 8: ISO only programming	101
Table 9: Mazatrol - ISO - Mazatrol	105
Table 10: ISO - Mazatrol - ISO	108
Table 11 - Gauge R&R test results	116
Table 12: 63.5mm bore comparison	118
Table 13: 63.75mm bore comparisons	118
Table 14: 63.75mm bore comparisons	118
Table 15: 63.75mm bore comparisons	118
Table 16: Production data	127

Chapter 1 – Introduction

Quality control is an area of engineering that is becoming ever more critical. Demands on suppliers are stretching the capacity of companies and are requiring more stringent testing of every part produced. The traceability of each part has become a given rather than an ideal and creates more paperwork for each part. The extra work created, however, must not impact upon the production lead times and therefore systems and processes must meet these capabilities, whilst trying to reduce costs and improve overall quality.

Craftsman Tools Ltd is a family owned SME based in Otley, Leeds employing around 55 people and has been operating for almost 60 years. The company operates in a worldwide market with the specialist products being in-house designed work holding equipment and tool holders for most major machine tool builders worldwide. The company also produces parts for many large companies in the oil and gas industry as sub-contractors where the global market is highly competitive for both cost and quality of the finished parts in a time conscious manner. Most items produced are "one offs" or small batches.

The content of the following thesis is the result of research and work undertaken as a Knowledge Transfer Partnership (KTP) programme 007057 between Craftsman Tools Ltd and the University of Huddersfield. The project provided a significant strategic impact for the company, helping to provide reductions in manufacturing costs and improved quality, which greatly enhance the company's reputation for high quality, precision manufactured parts.

The aim of the collaborative program was to address specific issues around process quality, such as machining accuracy, whilst also aiming to reduce significant manufacturing costs through automation of product testing, validation and certification. The lack of confidence within the company for the processes accuracy and reliability forced the undertaking of manual inspection, measurement and testing of components, which has major implications for cost of quality and overall manufacturing costs.

The company has previously attempted to automate the machining and validation of parts on a number of occasions, which all proved troublesome and ineffective, and were therefore never implemented. The scepticism provided by the past failed attempts failing added an extra barrier to be overcome as part of the project, therefore requiring good change management as well as providing a technologically suitable solution.

The manufacture of the parts is currently a complex process involving many people and pieces of machinery and equipment. Simplifying the processes and amount of equipment required will help to reduce the amount of human intervention for manufacture of parts and also for dimensional measurement.

The current manufacture of a designed part has the following procedures:

- Block of material placed in vice
- Program written in Mazatrol according to drawing sizes
- Work Piece Co-ordinate (WPC) set
- Program run to rough first off
- Part removed from machine and taken to manual inspection
- Work co-ordinates manually updated to suit
- Part re-machined to finish size
- Final manual inspection to check against tolerance and dimensioning
- Next parts run on full cycle if inspection passed
- Base is now completed
- Part moved to indexer for Capto bore cycle
- Hole rough bored
- Part taken to manual inspection for first off check
- Final boring of hole
- Part taken for final inspection and dimensions manually recorded

This process requires around four visits to the quality control department, which ultimately leads to delays in production. It is not always possible to get measurements immediately and queuing can occur lengthening the process further. A test case system has been identified using the Severn Cell within the company. There are a number of machines present including milling and turning. The testing will begin on one of four Mazak Nexus 510CII machines. The system will be rolled out factory wide when successful.

1.1 Aims

Aim 1 – To implement a semi automatic quality control process in an SME

Aim 2 - Evaluate against accuracy and cost benefits

1.2 Objectives

Objective 1 - Validation of the machines capability and continued monitoring

Objective 2 – Reduction of manufacturing costs within the company

Objective 3 - Automated measurement and reporting of parts

Objective 4 - Evaluation of the monitoring of the machines, accuracy and capability

Objective 5 – Evaluation of the cost savings made with the introduction of a semi automated system

Objective 6 – Evaluation of the benefits brought by the research

1.3 Chapter Outline

Chapter 2 – Literature review

Looking at past work and reviewing current systems or those that are being developed.

Chapter 3 – Initial processes and systems

Review of the company's current processes and systems, with identification of areas for development.

Chapter 4 – Proposed processes and systems

Proposal of processes and / or systems that will improve the company's working

practices. This will have been compared to a benchmark set out in chapter 3.

Chapter 5 – System selection

A system will be selected using the proposals of chapter 4. Different solutions will be presented and trials for suitability where possible.

Chapter 6 – Implementation

The systems and processes outlined in chapter 4, and the equipment selected in

chapter 5 will be implemented, with a full description of the activities taking place.

Chapter 7 – Testing and results

Following on from the implementation in chapter 6, the results of the implementation will be discussed.

Chapter 8 – Conclusion and further work

After implementation and testing, a review of the achievements will be made against the original aims and objectives and stating any further work that could be undertaken.

1.4 Summary

The aim of the research is to implement a semi automatic quality control process and systems into an SME whilst also evaluate against the accuracies and cost benefits. In the following chapter a literature review is presented and shows what has been done previously that could impact upon the project and the likely implications as a result of the implementation of any systems.

Chapter 2 – Literature Review

2.1 Introduction

The aims and objectives of the research are to implement a semi automatic quality control process in to an SME and to evaluate against accuracy and cost benefits. To achieve this it is necessary to review literature regarding present systems and any reported future developments that are planned. The areas for research will be machine tool errors, probing systems, software systems, machine tool maintenance and present systems in use.

2.2 Machine Tool Errors

Machine tool accuracy is affected by the following types of errors [1]:

- Geometric errors
- Non-rigid errors
- Thermal errors
- Wear

Geometric errors are inherent within the machine tool as it is made up of many mechanical assemblies, each of which having inaccuracies due to design and manufacture constraints.

The geometric errors of a machine tool are made up of the following errors and amounts, giving a total of 21 per machine for a 3-axis machine [1][2]:

- Positioning 3 per machine
- Straightness 6 per machine
- Angular 9 per machine
- Squareness 3 per machine

Error compensation is an effective way of reducing the nature of errors present in the machine. This is done through measurement of the 21 standard geometric errors during a "downtime" period on the machine. A system interprets the results and then corrects the errors in real time. Re-verification of the machine is then made. A reduction of 97% in the rigid errors is quoted by Poxton et al. [3].

Okafor and Ertekin [4] also provide vast amounts of information on the geometric errors within a three-axis machine tool. The errors are mathematically calculated to form an error model, which is volumetric. From the matrices formed in these equations for the model, error compensation components were derived and used to create a new model.

As with many other papers in the field of machine tool errors, Ramesh et al. [5] and Barman and Sen [6] describe error sources and methods for error elimination through many different methods including use of measurement tools, such as laser interferometers.

Thermal errors appear within the machines structure during the heating and cooling whilst in operation. The heat can come from both internal and external sources. Internal sources will include:

- Heat from the cutting operation
- Motors for spindles and axes
- Motors for swarf conveyors
- Pumps for coolant feed
- Friction within moving mechanical mechanisms

External sources will include:

- Draughts from doors, roller shutters and loading bays
- Heating equipment
- Sunlight (warm and hot days)

Thermal errors provide complex issues within the machine tool and give rise to change in geometric errors as previously described.

Most machine tool manufacturers will provide a specific warm up and cool down procedure to ensure that an optimum temperature is reached before cutting takes place to reduce the errors that could be transposed to the work piece. As materials vary, coefficients of expansion this can prove difficult to compensate for.

There has been a great level of research undertaken in the field of thermal errors within machine tools, and for compensation. The causes of thermal errors and methods for reduction within the machine tool structure are described by Postlethwaite et al. [7]. The paper concludes that even though there has been a large amount of time spent in researching this area, there still remains a significant problem with work piece errors caused through thermal distortions. The errors caused due to thermal distortion would require its own project within the company and will be noted when implementation of systems takes place for future work.

Non-rigid errors occur from loads placed on the machines structure such as the weight of the work piece and any fixturing, loads transferred whilst cutting the metal and weights of tools in the spindle. In many tool data files on the machine tool controller there is designation for heavy tools, which can be assigned.

Discussion is made by Wang [8] for the use of volumetric analysis of the machine tool becoming more common and to give a better understanding of the machines accuracies, as previous linear measurements do not provide enough information. The measurement of all 21 errors are required to understand the machines capabilities as machine tool manufacturers improve quality of machines through time. The Renishaw QC20-W BallBar system allows for some volumetric analysis [2]. The extent to which this is capable is determined by the volume that can be covered by the BallBar for length and restriction to three planes. The measured and monitored volume should match that of the active area used within the machine for most jobs. There are a large number of ISO standards, which relate to the calibration of machine tools and CMM's. These are listed in the appendix.

Although all of these standards play an important part in the machine tools, there are a few which stand out as necessary for review during the project including BS ISO 230 -4: 2005 - Test code for machine tools - circular tests for numerically controlled machine tools [46], which will be linked to the BallBar tests. The ISO standard sets out the principals for measurement of contouring circles to be measured on the machine tool being tested. It is very similar to the way the BallBar software guides you through set up of tests, which is very useful as it makes auditing far more simple under the maintenance programs. A useful guide similar to the help file of the BallBar 20 software can be found as the annex to the standard showing the likely errors to be found and where they are likely to originate. The software can provide the results to this particular standard for easy reference. The BS ISO 230 – 10 : Draft - Test code for machine tools - determination of measuring performance of probing systems of numerically controlled machine tools [52] is also quite important as it could play a future part in any probing systems that are employed on the machine tool.

Wang [8] discusses calibration in the 3D volume of the machine tool and highlights the way in to which this fits in with the BS ISO 230 standards. Definitions are

provided for positioning errors and 3D volumetric errors. The 3D volumetric positioning error is defined as the RMS (Root Mean Square) of the maximum errors of each axis. This is now considered inadequate due to the largest errors being straightness, squareness and angular errors in modern machines. The volumetric error is defined as the maximum of the RMS of the total errors in each axis direction. The volumetric error for angular errors is defined as the maximum of the RMS of the deviations in three angular directions.

2.3 Machine Tool Maintenance

Machine tools are a complex structure of many mechanical assemblies, which degrade over time and require maintenance to ensure that accuracies and capability are maintained over its lifetime. Willoughby et al. [9] discusses how in many cases machines will be calibrated to an ISO standard and be certified but produce parts that are incorrect due to a lack of proper maintenance. Machines are then used with updated offsets to ensure production continues without addressing the specific breakdown.

Munzinger et al. [10] looks at the maintenance activities that take place and how machine availability can be improved through use of use of algorithms for parts and assemblies within the machine tool that are maintenance friendly and also the associated parts of that failure model. Taking a machine tool apart to its bare structure would not be maintenance friendly for an operator. It is categorised for levels of knowledge and training, difficulty, maintenance, costs and other activities. All of which are formulated and work out which are the most and least friendly maintenance activities, and which will require follow up work. This can be a useful approach if there are enough skilled staff within the production team capable of the tasks presented, however, in most circumstances it is more feasible to call in a service engineer due to their knowledge and level of training. The downtime for both methods could be monitored.

Within an American Machinist article [11] a small amount of text focuses upon the need for maintenance of machines if they are being used for inspection as well as measurement. A discussion is made for the regular calibration of the machines in a similar way to the CMM, and that a BallBar test would be ideally run around every three to six months. The accuracy of the information that tests of quarterly or half

yearly testing could be questioned. As it is a simple test, it should be run frequently and also as a reactive measure when something happens to cause change.

Planned maintenance scheduling and calibration methods are discussed by Wang and Thomas [12]. The authors describe the way in which the planned maintenance can be scheduled through knowledge gained from regular a benchmark for when the machine tool should be calibrated and serviced. With this knowledge the maintenance can be scheduled to cause least disruption to production. Many methods for calibration are mentioned within the article for both linear and rotary axes including grid plate encoders and laser interferometers with their method for use described.

For multi axis and mill turn machines there are systems available for calibration of the rotary axis by companies such as Renishaw. The system offered is called Axiset [13] and gives users the ability to check the pivot point of a rotary axis against its centre. In a similar way to the BallBar system, a history file can be created for the machine to monitor any changes over time. This is not a current issue within Craftsman as the priority implementation machines are 3 axis. It is useful for future equipment requirements to know systems are available to maintain the calibration of the machine. Companies such as Heidenhain and Fidia amongst other produce versions of this test equipment.

Also for multi axis machines is a volumetric distortion assessment method for five axis machines using un-calibrated master ball artefacts. Erkan et al. [14] uses measured values for the probing of the artefacts against an expected position to work out the overall volumetric distortion within the machine tool. The work however proved to show large variations between machine tool and CMM results, meaning the author required further work to determine the errors present within the machine tool to explain the large unexplained errors.

2.4 SPC and Quality Control

Quality control is becoming an issue for many companies with demands on suppliers for finer tolerances to be achieved. This extra strain is passed through the entirety of manufacture and inspection. It is therefore starting to become critical to know accurate levels of scrap and use root cause analysis to find the reason for scrapping the part in the first instance. The white paper by Renishaw IM110 [15] details the need to address the root causes of process failures and eliminate as many of the manual processes as possible. These generally go hand in hand with each other. The use of a pyramid based system, such as the Productive Process Pyramid provides a structured, systematic approach to ensuring machining consistency. The paper discusses the need for multiple machines and work of the same type for in-process inspection to be a viable option; otherwise there will be a vast level of time consumption. The paper suggests that the machine should not become a replacement for a CMM however as each machine has its specific purpose with the effects of thermal error being noted.

Saunders [16] also discusses the Productive Process Pyramid, which was the prior design to the one shown in the IM110 white paper [15]. Over time it has become more refined and user friendly, however still benchmarks against previous processes to continually improve.

Wu and Jiao [17] look at the use of charts in SPC and how they can implement a system that looks at interval between suspect samples and uses control limits for determination of non conformance. A study is made into the length of time taken to calculate the values for the chart with a simple inspection of an attribute and ring gauge. If more complicated measurement systems are used the time vastly increases. For the measurements of critical features of the companies manufactured components, a simple system would be ideal for taking the measured values and calculating its deviation.

2.5 Probing Systems

Probing systems are becoming more common on machine tools, and can be used for a variety of purposes such as part location and dimensional metrology. The systems are more common within large organisations than an SME however where large batches are produced and output is critical. The method by which the probe functions has been described by Weckenmann et al. [18].

Use of machine tools as measurement instruments has been long debated, and the validity of the dimensional measurement on the same machine the part is cut on questioned due to the same errors being subjected to measurement as those during cutting. The use of the in-process inspection can however detect errors that were not picked up during standard maintenance and servicing. The use of compensation systems and techniques such as the Laser Interferometer and gold standard parts allow

for rectification of manufacturing errors and means that the use of in-process inspection is becoming more acceptable according to Davis et al [19]. The author also describes the lack of systems for manufacture of parts that use in-process inspection to create a closed loop system for cutting and measurement. All such processes and systems can be related back to the idea of the Productivity Pyramid and how all levels are used as informative data, which can be used to continually improve from the foundations up.

Arguments for and against the use of the machine tools is made by Bates [11] as cutting time is taken away from the machine to measure parts. It is argued, however, that if parts are left at CMM with faults, there will be longer periods of downtime. Suggestion is made that a sample inspection of a batch could be made instead of inspecting every part on the machine. The company previously sub-contracted the parts requiring CMM checks. This adds extra cost and lead-time to any job that is going through manufacture.

Kim and Chung [20] show how errors generated due to discrepancies between the machine tool and contact positions are affected by the geometric errors within the machine tool, probing error or measurement and also any error within the mechanical assembly probe unit itself. This leads to error compensation systems being developed and implemented into a system for measuring parts at an effective feed rate so as to not affect the rate of production of parts on the machine tool. This however is present in most software provided with touch trigger probes by the manufacturer in the form of ISO G-code programs in the current market, and proves how quickly developments are being made on a technological basis.

Choi et al [21] discuss how conventional measurement on a CMM can lead to bottlenecks of production and providing need for measurement on the machine tool. Error models are created for the machine tool to compare against the CMM with an artefact plate comprising of multiple cubes. The models are used to generate algorithms for error compensation, and fed into a closed loop system for probing and cutting with reduced machining errors.

Modern Machine Shop [22] discusses how many manufacturers do not release the full potential of on machine probing. They have stated that if machines are maintained correctly and tools such as the BallBar and calibrated artefacts are used that offline inspection could be done away with. The prevalence of thermal errors is brought to

19

attention and how it can be accommodated for using the artefact methods in a similar way that Renishaw manufacture their own parts [23].

A case study company in Quality magazine [24] display benefits gained from the incorporation of probing systems within the company including the time saved through probing, additional capacity created and the levels of scrap parts. The levels of scrap in the case study fell from up to 50% to virtually zero with the use of probing systems. A third unmanned shift can run due to the probing system, which increases productivity. Offset errors caused 20% of parts to be scrapped, which has been corrected automatically with software for offset updates. Within the project there will be a similar benchmarking made for these timesavings to determine the overall benefits brought about from the new technologies.

Tseng et al. [25] discuss the relationship between in process inspection and inspection on the CMM following machining. Suggestion is made for capability studies to be carried out on the machine tool due to the inherent machine tool structure errors influencing the manufacture of the parts.

Choi et al. [26] discuss the use of Probing systems as a method of error detection within the machine tool. This method uses an artefact cube based system for measurement of results found from created models. It uses a compensation system based on measured cutting values to update a positional value. This method is in practice within software systems commercially available, such as the Renishaw AE Pro software.

2.6 Systems in use

Koc and Bozdag [27] investigate the use of advanced manufacturing techniques within a sample of SMEs. The SMEs were asked about current systems in place such as CAD and CAM and any automated inspection. Results of their survey show that just 43% of the companies used some form of automated inspection. Renishaw's RAMTIC (Renishaw's Automated Milling, Turning and Inspection Centre) system [28] uses carousels to automate processes. The carousels contain tools, work pieces and calibrated artefacts for measurement comparison. Such systems are well suited for use in mass production environments where time and money can be invested heavily, however, do not suit smaller SME's. The principals used for manufacture, such as their pyramid processes can however be adopted and developed to suit different applications.

Mazak offer full factory systems called FMS (Flexible Manufacturing Systems), which are linked in to the Mazatrol CNC controllers [29]. It is essentially a palletised system (Palletech) that can be placed factory wide. The work pieces are called to the machines through CNC commands made at the machine as part of automated systems. This method again is suited to larger organisations and is generally used with larger parts. The system can be seen in use within their own factory for manufacture of their machines.

Xu and Newman [30] discuss the advances being made in CNC programming through use of STEP-NC. The aim of the new programming is to make use of new intelligent workstations and incorporates CAD and CAM to create programs for the machine tool controller. With this simple architecture, there could be possibility for linking in of many systems, which could include in-process inspection.

2.7 Software Systems

Bates [11] shows use of software developed for machine tool use in inspection. The design is based around a CMM style design and communicates through a PC-Dmis NC system. In the example shown, Lockheed Martin in Orlando, America, uses the measurement software. The on machine inspection systems are used to skip or eliminate previously required quality steps and eliminates bottlenecks at the CMM. Part programs and probing programs are stored on a standalone server and called when required directly to the controller. The inspection of parts is now limited to a first off to check for processes being within specification, and then taking samples from a batch instead of measurement of all parts.

The uncertainty within software changes dependent upon the algorithms used for calculation. Raffaldi and Shakarji [31] suggests how efforts are being made to standardise the testing frameworks for machines. The uncertainties are presented in a chart for all typical contributors to uncertainty. Similar tests could be used or implemented on the machine tool if used as a measuring machine.

2.8 BallBar

Renishaw's BallBar system is commonly known throughout industry and is accepted as a quick health check of a machine. There are systems available from other manufacturers such as Heidenhain and API, but are not so commonly used in the UK. The QC20-W BallBar system literature [2] for the product states that it can be used as a quick 10-minute check of a machine tool. The BallBar software, BallBar 20, offers flexibility for result output and can be displayed in many standard formats to associate with ISO, JIS and ASME. Renishaw also offer their own output format, which breaks down the results to show 15 contributory errors within the machine tool. The positioning accuracy is recorded in the software to provide information on circularity and deviation.

The software is also used to build up profiles of the machine tools it is used to test and graphically records all of the changes over time. There is an ability to generate part programs within the software, which are post processed to suit the many different types of machine tool controller allowing full factory flexibility.

For different levels of use within the factory, different modes are selectable within the software front end [32].

A system using 3 BallBars has been developed by Jywe et al. [33] for 3 dimensional calibration of machine tools. The solution is offered as a quicker and cheaper replacement for laser calibration by using triangulation methods. This would however require a substantial amount of time and knowledge to apply in a factory environment. The use of laser interferometers would provide greater practicality and are known for the highest levels of accuracy available.

Kwon and Burdekin [34] demonstrate the errors that are shown through use of a BallBar system such as backlash, stick slip, servo mismatch and positioning errors. These are also described within the help files of the Renishaw BallBar 20 software [32]. The research presented was for the development of a different link system for the BallBar, which essentially changed the balls and cups around with different amounts of kinematic motion translation points and was tested against a standard BallBar system.

2.9 Summary

Following the review of literature, decisions can be made to the extent in which previous research can be applied to the project. Much of the past work has been suited to large companies producing batches of parts at a time with no variation in type.

Chapter 3 – Initial Processes and Systems

3.1 Introduction

This chapter will describe the current processes and systems in place within the company. A flow chart will be created and used as a benchmark on which to build the new systems.

3.2 Initial Processes and Systems

To understand the current processes, a benchmark flow chart was created and used as a basis for the additional processes.

As an appendix to this thesis, the processes as set out to satisfy the ISO 9001:2008 Quality manual are included. This discusses the flow of jobs through the Severn Cell within the company. The Severn Cell is the tool holding area of the company, which primarily manufactures Capto tool holders and also standard Mazak tool holders. New developments are currently being investigated and manufactured as part of research and development in the cell also. If there are drastic changes through the addition of extra systems and processes, this document will require rectification to suit and pass any future audits.

Benchmarking of any future processes and systems must start with how the current system works. This will be further discussed during chapter three.



Figure 1: Process flow from customer input through to shipment of part to customer

The flow charts show a basic routing from input through to output. The stages are described below:

Customers can be the end user or a distributor. Whichever category they fall in to, they will require a solution to a current problem. The company has key customers and as such are provided with preferential rates and lead times. The goal for achieving these lead times can easily be delayed if parts are scrapped or there is machine downtime.

A **query or quote** comes from the customer to enquire about a solution for their problem. A price and lead-time will be provided for their consideration. This will reflect the current production capabilities; material costs and exchange rates for export items.

Customers place an **order** for the goods or service that were previously quoted and a contract is entered in to for this to be fulfilled. If the original date is unachievable, a new date will be negotiated and agreed upon. This happens in instances where a quote will have been sent off and the customer comes back a few weeks later. At some point in the products life cycle, it will have had to be **designed**. This is a time consuming exercise and can involve extensive research in to the machine tool it will fit.

If the product is being specially designed, drawings will need to be sent out to the customer for manufacturing drawing approval before a final general assembly and detailed manufacturing drawings can be produced.

Conversion of 3D model to relevant format to use in alternative software is completed where required. The 3D CAD models may require converting to formats other than the AutoDesk Inventor .IPT format that they are created in.

Every job requires some **planning**. The companies system provides a job traveler document, which details all processes required for manufacture with barcodes for operators to clock on and off jobs allowing costing to be made. If the part has been manufactured previously, the information can be copied across for the routing of the material from saw to inspection and packing. Where a product is manufactured for the first time, all information has to be entered for how the part is to be manufactured and the stages required to do so. The traveler sheets have each operation bar-coded for tracking of jobs in the computer system.

All parts are **manufactured** in house, which includes the following:

The machine operators are encouraged to write their own Mazatrol machining programs for the parts. The staff inspector can check these where necessary, for operators such as apprentices and trainees. The Mazatrol conversational programming format is used on the Mazak Nexus Machines for simplified programming of part programs with graphics to illustrate the part that is being created.

The parts are firstly rough finished and then taken to **inspection** for checks to be made for position of bores and slots or tenons. These are all manufactured so that adjustments can be made, such as a bore would be started with a test hole. After parts have been produced at the roughing stage, machine datum's are updated to allow the final cuts to take place and be in the correct position and to size. The first finished machined part will be checked at inspection prior to all other parts being finish machined.

Program files can be transferred between machines. Currently this is done with Floppy disks and USB sticks, dependent upon the controller.

Most parts are inspected manually with use of Trimos height gauge or other manual measuring equipment such as bore micrometers.

The CMM is generally used for measurement of other parts produced in the factory. It is kept for measuring of complex parts or measurement that is not easily made. The CMM was purchased following completion of the project meaning that any CMM required for parts prior to this were sub contracted out, again creating additional cost. Most inspection is made manually, and will use a Trimos height gauge with test bars and specially made fixture cubes.

The **Capto** unit is fitted following manufacture and tested using a Capto test bar for its alignment and run-out. All values are recorded and assigned against an individual serial number. All information is kept in a database in case of query.

Parts are **packed** according to customer and include labeling for particular customers or Craftsman branding where appropriate.

Parts are **despatched** following adequate packing and invoices are generated. Customers receive the parts at the end of the long process flow and pay invoices. If there are any issues then the customer makes the cell manager aware for rectification. **Customers** will also place new orders where the whole process will begin again. From the above flow chart of processes, the aims and objectives will use the following areas; manufacture through to Capto fitting, with the rest being outside the scope of the project currently.

To effectively improve the current processes and systems it is necessary to review current practices and investigate means for improvement.



Figure 2: Current processes for manufacture on the factory shop floor

The shop floor receives drawings from the office as part of job bag, with traveler documentation detailing the machining operations to take place in the manufacture of the part.

The staff inspector decides what size material is required for the part and sends the order to saw for the bar to be cut. In some cases castings are used where available, and dramatically help to cut down on the time used for material removal compared with solid bar. Some instances require large flame cut pieces of material, which are ordered to suit.

The machine operators receive manufacturing drawings from the job traveler packets, which are stored with the relevant material, and begin to create the part programs within the Mazatrol conversational programming language on the machine tool controller.

Where necessary the operators will get the staff inspector to check through the part program to ensure that it is correct, and simple errors have not been made, such as a decimal point in the wrong place.

For manufacture the material will initially be loaded into a vice on the machine table where it will have the top face machined as well as creating a profile whilst traveling in the Z Axis.

Once the part program reaches the cutting depth that it has been programmed for (usually clearance of vice and cutter length when using large face mills) it is turned over and machined in a similar manner to give a profiled part.

Features are added to the block as the next operations and some extra stock removal for profiles where required.

Holes will be drilled to allow for the part to be attached to its fixture, which resembles the machine the part is being manufactured to suit. Where required, tenons and slots or diamond locators are added also.

The fixturing is usually mounted to an indexer, which enables the part to be cut from 5 of the 6 faces.

The first operation in the indexing fixture would be to add pilot holes. It is when these pilot holes are in place that the part can be removed from the machine for first off inspection. The centre lines are checked to ensure the position of the main bores is within tolerance for position. Any adjustments necessary are made at this stage of the machining program for offsets that may be required to bring the part within specification.

The part will be cut just smaller than its dimensioned size with the updated offsets and then removed as part of the first off checking again and monitored to make sure the position has not drastically changed, and that it now falls within its drawn values. Where the part is found to be ok, and no further adjustment required, the part will be finish cut and then once more inspected as a fool proof.

For all remaining parts of the batch, the program will be run with updated offsets on the trust of operator knowledge of how much wear takes places against time for cutting tool wear.

Once manufactured, all parts will go to assembly and be set, with the measured values recorded in an inspection record sheet against a serial number.

The whole process will vary for time taken per part due to sizes and features. The average for time taken can be spread over a period however and used to evaluate the amount of parts produced.

Time taken for measurement of the parts however is more of a constant and can be evaluated against any other systems that are implemented. An average time for inspection of a part would be around ten minutes.

Where manual inspection is required the following processes would occur:

The part is mounted to a ground flat fixture, which has been manufactured to replicate the machine tool the part has been manufactured to fit.

Measurement is required for the centre height of the main bore and also against the centre line of the part. In most instances, parts will have some kind of tenon or slot, which dictates where the centre line of the part should be.

The parts are manually measured with use of a Trimos height gauge. This is calibrated for its touching values against its calibration block.

Each part is measured individually and against the drawn dimensions and tolerances. Most parts require a tolerance of no more the 20 microns.

The Capto unit itself is measured for its accuracy and run out values using a Capto ended test bar. Measurements are taken at the base, middle and end of the bar and all recorded. The Capto unit must be able to provide the end user with the repeatability and accuracy the Capto sells itself upon. All recorded values are stored in a database so that parts can be checked against in the event of any issues following despatch to customers.

Maintenance of the Trimos is carried out at the intervals of calibration described in the Quality Manual. The inspection table is also calibrated at regular intervals to maintain the level of accuracy required.

To zero the Trimos, a calibration block is used which come with the equipment. It uses ground flat faces for the probe to touch on to in the Z Axis in both directions. There are currently no preventative measures or processes in place for Ballbar testing within the company. The company relies upon the operators changing values within programs to adjust datum's and offsets, which mean that the true accuracy of the machine is unknown and errors are only accounted for during the machining operations. The machines are serviced yearly with a full service and set up and also half yearly with an interim service.

With operators changing offsets and datum's in the programs to suit each time the machine maintenance was reduced during difficult economic periods as it was not seen as added value, and less parts were being produced by each machine. This however should not be an excuse for no maintenance at all, and plans could be made for more general maintenance to be brought within the company and a Planned Preventative Maintenance (PPM) schedule created for each machine.

For the machine tool to accurately produce and measure parts it will require the understanding and knowledge of the errors that are present within a machine tool and the effects they can have, and their implications.

The maintenance, whether predictive, planned or reactive will reduce costs from rework or scrapping of parts. This is generally due to out of tolerance rather than mad incorrectly. With proper maintenance in place, tolerances can be monitored and the overall accuracy should improve over time.

This will ultimately mean that the scrap and re-work is almost eliminated in a controlled environment and fit within the target tolerance bands of the parts produced. Most of the standard Mazak tool holders and Capto tool holders are produced to a tolerance of 20 microns.

If the machine is accurate and monitored then the parts produced on it can be roughed and finished as well as measured in the knowledge it will be correct.

It is impossible to ever eradicate all errors within a machine tool, as it is a mechanical structure. Compensation can be made for these and regular calibration will allow for

32

a known value of error. A full calibration can however mean the machine is taken out of production for a long period of time. A simple check on the machines current state at often intervals can be used to indicate when a full calibration or service is required for the machine.

The quick checks can be used as part of a preventative maintenance plan and will monitor any deterioration in the accuracy of the machine, and also for any sudden changes that may occur. These could come from machine crashes, including tools or probes hitting the work piece, a fault inside the machine; such as bearing failure or an external factor such as material being moved to the machine on a crane swinging round too quickly and hitting the machines structure.

3.3 Summary

The chapter has shown the initial practices within the company for manufacture of parts and how machines are currently maintained. A great deal of trust is placed upon the skills and knowledge of operators for programming and running the machines for the batches of components with the "right first time" approach in mind.

Time spent on manual inspection will be discussed in the following chapters and how much time the stage takes in a best-case scenario for no queuing time, and removal and replacement in the machine without delays.

The lack of predictive maintenance will cause problems for tight lead times of components.

In chapters four and five there will be discussion of new systems and their associated costs and the benefits they will bring to the company both financially and through functionality.

Chapter 4 – Proposed Processes and Systems

4.1 Introduction

This chapter will introduce systems and processes that can be incorporated in to the company's present procedures.

Following on from the benchmarking exercise in the previous chapter, the highlighted area for improvement will be discussed and presented as a flow chart of the additional processes required.

The chapter will also discuss the current costs for machining parts, and how this would be affected if there was a system in place already, as a parts made comparison. Two very different years are portrayed to give a good example of a very good year's production and one that shows the effects of the global economic difficulties. Discussion is made for the machine condition monitoring systems and their costs.

4.2 Description of Processes and Systems

In the new proposed system the following processes will happen:

The parts will be machined and measured during the same process meaning the parts will no longer require removal from the machine for manual inspection, which as a by-product also removes any further induced errors that could occur re-attaching the part to a fixture to machine a second or third time. It is almost impossible to get the part to be positioned in exactly the same place more than once.

Tool wear will be accounted for during the machining cycles and therefore eliminates operator intervention.

The process is aimed at being semi automated with operator's only loading parts into the machine for manufacture where a program has already been created for manufacture of that particular part. A program will be written where necessary, which will be suitable for the new process. The operator will "press the green button" to start the cycle and remove completed parts. The only time there would be any other operator intervention during the cycle is if there was an issue.

It is proposed that the manufacture of further parts could be undertaken during the night as a third unmanned shift. For this to happen raw material would need to be placed into the machine and the cycle started before the operators finish their shift on

the night. The morning shift would then remove the completed parts on the start of their shift.

For full automation, robotic loading would be required to place raw material into the machine and remove completed components. This is outside the scope of this work. A revised flow chart of processes is listed below. This incorporates the extra systems required from the original benchmark and are highlighted in the italic writing:

- Customer
- Query / Quote
- Order
- Design (If necessary)
 - Manufacturing drawing approval
 - Conversion of 3D model to relevant format to use in alternative software
- Job planning (Traveler)
- Manufacture
 - Create Mazatrol programs
 - Roughing
 - Finishing
 - Align axes for machine datum software packages for probing and measurement all use different relative datum's. These are commonly taken from the CAD model and will not match where the datum is within the machine tool. This therefore means manipulation of the model is required in the software for it to match the machine.
 - *Create measurement program* software for creating a measurement program is required. Many operate in a similar manner to that of CMM software. The machine datum and software CAD datum require alignment, as previously mentioned. This allows for the ISO program that is generated to work correctly from the machine's Work Piece Co-ordinate system, for measurement of the part.
- File transfer mentioned in benchmarking but now includes transfer of ISO measurement programs.
- *BallBar test* (if required) Could be linked to the SPC data for running a test where rogue results become present in the graphical data
- Machining the machining processes are now made up of additional processes to include on machine measurement of parts during the cutting of the metal.
- *Probing checks* probing of the parts will happen during the machining cycle and finally once the part has been finished. Probing will provide closed loop feedback to the machine tool controller for part and feature size and position. This is likely to happen between different processes such as roughing, semi finishing and finishing.
 - Inspection report the probes measurement of the part will produce an inspection report, which can be passed on to the customer with the part and also within the inspection department.
 - Scrap the probing will also be able to give indication of a part that is potentially scrapped. A message telling the user to manually check for issues will be displayed. An example of this could be a tool breakage.
 - *Re-work* The probe will determine the size of the feature it is measuring compared to a nominal value with tolerances. Logical decisions can be used to determine whether updates can be made for size and / or position within the machine tool controller. Tool offsets or WPC's could be updated to allow for correct sizes to be cut.
- *Continue* once the part has reached the probed features nominal size and tolerance band, the next machining operations can then be completed.
- Sample inspection from batch Once the processes are fully proven and trusted, it will be feasible to trust the results produced on the machine.
 Random samples will be selected from each batch however for a check by the Inspector for quality assurance against the measured results.
 - o CMM
 - o Manual
- *Report comparison* the inspection reports from both the probing and CMM or manual inspection can be compared to ensure there are no significant errors or differences between the two methods.

- Add data to SPC the statistical analysis of the results from measurement can be used to monitor the processes and how they vary over time. It will also provide information for parts that could potentially require a manual check for verification.
 - Out of limit parts out of limit can be easily identified. The type of error will also be shown, and may provide evidence of a particular fault.
 - Check tooling tool wear can be monitored for the amount that it is updated by after each component is produced. This will be important if running overnight, as sister tooling will not be available due to magazine capacity in the tool changer.
 - *Review processes* the data provided can help with reviewing the processes and implementing new ideas. For example, this could be the way holes or bores are machined, such as using circular interpolation or a boring bar.
 - Within limits parts produced within limits will show that all processes have been controlled and monitored effectively. This can provide a figure for number of parts produced wrong against the number of parts produced overall.
 - *Continue manufacture* if processes are proving successful and parts are being manufactured successfully then manufacture can be continued and monitored until a change occurs. This then must be investigated.
- Capto fitting
- Packing
- Despatch
- Customer

To follow the above description, the additional components have been created in a flow chart and would fit directly in to the benchmark flow chart:



Figure 3: Benchmark flow chart

4.3 System Time Comparison

Using probing cycles created by M&H or Renishaw software takes one minute. Manual inspection of components takes up to ten minutes, which involves transporting the work piece from machine, measurement of the work piece, recording the dimensions and then return to machine to be re-attached to the fixture. This would save nine minutes per work piece.

On a batch of ten parts, five may be manually inspected so the total time saved would be eighty minutes. This involves two measurements on each part, the base and the Capto. This process could be much longer if the quality control department is unavailable or busy. This is therefore a best-case scenario.

An assumption for the time saved is used below in the examples, which show the machine being fully utilised except for idle periods where components are at inspection or being loaded. Parts other than Capto tool holders are also produced within the cell. In the assumptions, the money saved is calculated from machine hourly costs, worked out from the hours that could have been saved with systems in place.

Using 2008 figures taken from JobBoss system for all Capto units produced in Severn Cell within the year:

Actual:

3,932 hours were spent on machining Capto units.805 units were made over the above hours.5 hours per part as an average of parts produced in the time spent machining.

Assumed:

Therefore using the above assumption for timesavings, if new systems were already in place, then the savings on what was produced are shown below:

242 hours could have been saved over the production time.

 $\pounds 10,264$ represents money saved from this probing in production.

49 extra parts could therefore have been made in the time saved.

Using 2009 figures in the same way as above (Jan to Nov figures used):

Actual:

2,188 hours were spent on machining Capto units.

434 units were made over the above hours.

5 hours per part as an average of parts produced in the time spent machining.

Assumed:

Therefore using the above assumption for timesavings, if new systems were already in

place, then the savings on what was produced are shown below:

130 hours could have been saved over the production time.

£5,536 represents money saved from this probing in production.

26 extra parts could therefore have been made in the time saved.



Figure 4: Parts made comparison

The graph shows the number of parts produced in the corresponding years and next to it the number of parts that could have been produced in the same amount of time if the system was in place.

Per Part Assumption:

The saving per part is shown as a rough guide below:

Average time machining per part is roughly 5hours.

0.3 hours saved on machining time producing each part with on machine inspection.

£13 represents the money saved per part on machining.

Full Utilisation Assumption:

If parts were machined based on 16 hours per day machining over 5 days constantly then the assumption would be that:

14,400 hours could be utilised.

2,880 Capto units could be made at an average of 5 hours each.

864 hours could be saved with probing systems employed on the above figure.

£36,720 represents the money that would be saved as a result of this.

173 extra parts produced capability from the time saved using the probing system.

The full utilisation assumption is based on the cell producing only Capto tool holders and that the demand for products would be able to match the available capacity.

4.4 Machine Analysis and condition

As there was no previous system for machine condition monitoring at the company there is a vast scope for opportunity.

There are many different machine tool health checks that can be made. These include:

BallBar – a simple and quick test to run. It uses a Linear Variable Displacement Transducer (LVDT) to measure deviations in a programmed circular (or part) path. These measurements are recorded in diagnostic software from the BallBar manufacturer.

Gold standard component – uses an artefact that has been created on the machine tool and verified for size on a CMM. It can be probed on the machine tool to check for sizes. Any inaccuracies would give rise for a calibration requirement. Parts produced can be compared to the artefact using logic statements.

Laser Interferometer – highly accurate for measurement, however takes a considerable amount of time to carry out tests with. It uses light of known wavelengths for comparison, which measures displacement, straightness or angle.

The BallBar system provides coherent readings and can be linked into the probing results of parts. This is very important and is discussed further in chapter 5. The BallBar should be introduced on a regular scheduled basis factory wide. Where applicable, the simple test can also be run if an accident has happened on a machine or if there are erroneous results being produced in the manufactured parts. A Planned Preventative Maintenance schedule would be useful across the factory and would sit between the full yearly service and half yearly services of the machines. The condition monitoring of the machines is essential as a foundation of all processes. If the machine is not capable of producing parts accurately in the first instance, the machine will only be able measure to that capacity also. This could be very detrimental to the parts produced as probing would say they are correct even though they are in error.

The BallBar test takes around 30 minutes to complete from setting up, to running the tests and evaluating the results in all three planes.

With no current diagnostic or health check system in place it is very difficult to put a definitive monetary value against the costs of the downtime of machines. However, if it was put in to context that every hour the machine is down, the company is not producing, which equates to between $\pounds 40 - \pounds 50$ per hour. On top of this there is the lost revenue from finished parts and productivity overall suffers and leads to extended or late lead times of parts.

Machine inaccuracies also account for a proportion of the levels of scrap produced. The machines are potentially running with inaccuracies, which could ultimately lead to machine failure. If this is monitored correctly, the prevention of failure will be more cost effective than reactive maintenance and give shorter planned downtime periods.

An example graph of the output of a machines history is shown below and illustrates how the machine deviates over time and also how it requires attention when it gets to a critical point.



Figure 5: Example BallBar trend graph

4.5 Summary

The benchmark of chapter three's current processes has been used to create a new flow chart of the processes and systems required to achieve the aims and objectives. The costs of having a system in place have been highlighted and will be discussed further in chapter five when a system selection is made.

Chapter 5 – System Selection

5.1 Introduction

This chapter will focus on the solutions available on the market currently and draw upon cost benefit analysis for the systems.

The work undertaken in previous chapters will be influential on the choices made for the systems and the functionality they will provide.

The systems for investigation are of probing, software and machine condition monitoring.

5.2 System Selection

A number of considerations must be made when looking at the systems required for implementation of new processes and systems. This can be thought of in terms of what is required, why it is required and how will it be funded. This is outlined below:

5.2.1 Justification for Purchase

The justification for the purchase can be defined in areas such as:

- The equipment costs:
- Costs of probe and software. This should consider costs for implementing on a single machine as well as a full machining cell or factory overall.
- Costs of training. Training costs can extend much further than just sending people away for courses. Everyone learns at different abilities and it therefore may be necessary to utilise extra resource to support this. The level of training required for the use of the equipment will very much depend on the member of staff using the equipment.
- Costs of support. Problems can and will occur with anything technologically innovative. The level of support provided by the manufacturer should be considered, as this will ultimately affect the manufacture of parts.
- Existing equipment:
- Could equipment be utilised in any way if it exists?
- What equipment is currently available to use and test?

- Value to be gained:
- Extra productivity from machines both during the standard shifts and as a third overnight unmanned shift.
- Extra sales and revenue from improved sense of quality and delivery time.
- Current situation:
- Equipment already in place and being used during manufacture. This can include automatic measurement and also manual measurement.
- Levels of scrap parts being produced with the current equipment and processes.
- Cost of machining currently, which is based on the two shifts with an assumption of spindles turning constantly.
- Associated costs:
- Spares and accessories must be easily accessible and relatively inexpensive. The styli for probes are easily damaged in machine tools due to the delicate nature their use is designed for. The styli are manufactured to deform before damage occurs to the main probe body, which would result in an expensive and costly crash.
- After sales services are important as software is regularly updated and removes bugs found in programs. The service provided as part of after sales can sometimes include the upgrades as part of a package. It is particularly useful to be able to contact someone where technical difficulties are faced. Where this happens it is more appropriate to speak to an engineer rather than a call centre reading from a script, and has no idea of what you are asking or require.
- Warranties of software and hardware purchased must extend beyond taking them out of the box to use. It is expensive equipment and should be covered for the use it is specified for.
- Repairs and damaged items. It is inevitable that time to time, mistakes happen and there will be accidents. If and when this happens it is important that when equipment is damaged, the machine will have a limited down time while repairs take place.
- Machine downtimes for implementation will affect the production schedules, and as such need to be kept to a minimum to avoid disruption. This will not

only impact upon the set up of equipment initially but for the testing and proving.

- Extra and new fixtures will be required to utilise the new processes and equipment to its full potential. The manufacture or modification of these items will also have an impact on the production of parts initially. Where possible this can be completed by an apprentice on a simple milling machine to minimise the disruption.
- Availability could have detrimental effect on length of project both for standard equipment and spares and accessories. Service engineers will be required for implementation and could be limited to diarised slots.
- Fitness for purpose of the equipment will allow determination of whether it does everything required or integrates into part of a complete system such as hardware and software and the process involved.
- Effects on costing can be worked out for how extra time the machines are working affects the cost of parts and overheads.

Machining costs are worked out using the following:

- Direct costs that include machine costs, labour costs and the consumables used.
- Indirect costs, which include lighting and heating

5.2.2 Selection of Equipment

The requirements of the equipment for its selection are outlined below. The capabilities must be fulfilled for purchase of the equipment:

- Ability to probe parts. Most probes will do this but to what degree and accuracy is dependent upon brand and money spent. Those with more complex internals will generally be of better quality and accuracy however will be offset by the extra cost.
- Must meet accuracies required, which in most instances is around 10 microns.
- Software MUST produce reports at the end of process. This is stipulated as one of the most important parts of the selection criterion. The Inspection reports require the ability to be edited and formatted to suit the manufactured parts and customers. The reports should be produced in a suitable software package such as Microsoft office or in PDF format.

- Ability to re-machine work during the machining process. CAD models in with relevant tolerances could be used to measure against whilst machining to produce accurate, in tolerance parts in one process.
- Time required for setup:
- The time taken for initial setup of equipment for use during the machining process, including programming.
- How simple is the equipment and processes to use?
- What is required for the use of the equipment and processes?
- Who is required for the use of the hardware and processes?
- Time required for installation:
- How long is the machine out of action for whilst equipment and software is being installed?
- Who needs to be involved with the installation and setup?
- What is involved during the installation and setup?
- Calibration processes:
- How often is calibration performed?
- What equipment is required for calibration?
- Costs, which should include all associated costs mentioned above.
- Service levels:
- Level of and quality of service provided by manufacturer.
- What is included as standard?
- Upgrades:
- If software changes, what costs are involved including training and software cost?
- Adding extra user licences for software if and when necessary.
- Availability of spares such as styli for probes, and assurance they can be obtained quickly.
- Amount of users of software and equipment:
- Limited to one person?
- Multiple users at the same time?
- Multiple users at different times?
- Who is responsible?
- What can be used?

- When can it be used?

5.2.3 Purchase of Equipment

When the purchase of the equipment has been agreed upon, the following should be considered:

- What will be included in the deal? Can any extras such as spare styli and extra warranty be thrown in?
- Operator training:
- Before, during or after the installation of the processes and equipment?
- Who needs to be trained and at what level?
- Who will provide training?
- What will be required at the installation in terms of people, time, machines, tools and equipment
- Terms of payment and conditions

To investigate the possibilities available to use, contact was made with various sales reps and demonstrations made where possible at machine tool exhibitions or local venues, such as the University of Huddersfield.

The details of the companies investigated for hardware and software are recorded below:

5.3 Companies Investigated for Probes and software

5.3.1 Probes

Many different companies were investigated during the period of the project including, but not limited to Marposs, Renishaw, M & H, Blum Novotest, Heidenhain and Delcam. Some of the positives and negatives of the systems are detailed below: Company A investigated whilst at the EMO Milano Exhibition in September 2009 raised doubt for the ability to receive good customer service. The staff on the stand did not speak much English, and therefore the lack of communication made it difficult to get answers to any questions, and were presented with a generic general information brochure. With such a technical project it was felt that the correct level of support would be required, and whilst there would be sales advisors in the UK, anything further would have to go through head office with the possibility of the problem mentioned.

Company B investigated is a very large company, and have been involved with probes for a long period of time, and are generally accepted as one of the market leaders. Whilst investigating however, there seemed a lack of interest from the sales reps and follow up in the beginning of the project. This was possibly due to the economic climate that prevailed, and staff being over-stretched to cover all markets whilst redundancies were made. The probes are generally good quality and reliable. Company C is part of a large metrology group, and therefore has a very large backing behind them. The quality of the probes and usability is very good. The probes are cheaper in comparison to most of the competition and appeared to have a better level of service than many of the others. The UK sales representative provided a probe for trial use.

Company D were found to be very expensive for probes and through negative previous experiences and dealings meant they were not a priority for choice. One particular manufacturer could not offer a solution for use with the Mazak Mazatrol controllers when investigated. They could however be considered for other applications.

Using the above, there would be two options for the probe itself; the company could retain its original probes, which are Renishaw, and are a mixture of old and new model probes. The machines for the projects implementation were originally sold with a Renishaw touch trigger probe for part setting. Using the current equipment would not cost anything, but could affect the choice of software available and its functionality.

If the M&H probes were utilised then there would be initial purchase costs. The probes can be configured so that they work with the Renishaw receivers, which are already installed in the machine tools. This helps to keep the initial costs lower.

5.3.2 Software

As mentioned above for the probing, the staff of company A did not speak much English and could not understand what was specified when asked. The same concerns were raised, as software can be difficult to use and require time with applications support staff.

Software from company B had been used previously within the company. This performed some of the required functions, but not all. The software had a major drawback in that it cannot be manipulated to produce inspection reports in the format required. After a visit to the manufacturer's stand at the EMO exhibition show it was made clear that additional new software is available, which is based around the reporting from inspection. However this cannot perform functions of the software used previously within the company, so two software packages would be required. As the software was very new, it appeared complicated and difficult to use in the first instance, and even the sales representatives were struggling to find options. This was likely due to the launch of the software at the exhibition and lack of familiarity. Another manufacturer produces the new reporting software that was demonstrated. Company C provided a full demonstration of their software at the EMO exhibition. The first demonstration was shown by someone unfamiliar with the operation of the software, which proved its ease of use. The software can be used to perform both probing and also reporting as one package. The software generates G-code for calibration of the probe as part of the probing cycle allowing for greater accuracy. Company E is well known and deal with metrology reporting and CADCAM based applications mainly. The software on display was similar if not identical to that on another manufacturers stand, but with their own branding.

Similarly to the probes, there are two viable options for the software that could be used. This would be Renishaw software or software by M & H. The software is where the company will have to invest heavily to make the project successful and work in the manner required.

The service provided by the companies will also influence decisions in the purchase. Overall both systems have the functionality to work to the set specifications. The other implications would be that of a financial nature. The need for a business case was presented as a financial justification in a cost versus benefit analysis. This

can be found below, and utilises figures from chapter four.

5.3.3 System Selection Scoring Matrix

A costing analysis has already been included in the chapter as 5.4. To add further emphasis to this, a scoring matrix is presented below to show the technical and commercial characteristics of each system. Each characteristic is graded between 0 and 3 with a system total at the bottom, with 0 being least and 3 being the highest rating.

Justification	Weighting Multiplier	System A	System B	System C	System D
Equipment		N/A	2	0	0
Already					
Owned					
Meet	10	N/A	30	30	0
Required					
Accuracy					
Availability	8	N/A	24	24	0
of Spares					
Standard of	10	N/A	30	30	10
Service					
Future		N/A	2	2	1
Upgrading					
Installation	5	N/A	10	10	0
Ease					
Training	8	N/A	24	16	0
Equipment	5	N/A	15	5	0
Cost					
Calibration	10	N/A	30	20	0
of Equipment					
Probe	10	N/A	30	20	0
Functionality					
– Including					
Adaptive					
Machining					
Support					
Total		N/A	197	157	11

Probing hardware:

 Table 1: Probing hardware scoring matrix

Probing software:

Justification	Weighting Multiplier	System A	System B	System C	System E
Software	Wittiplier	N/A	2	0	0
Already		14/14	2	Ŭ	Ŭ
Owned					
Future		N/A	2	2	1
Upgrading					_
Standard of	10	N/A	30	30	20
Service					
Installation	5	N/A	10	10	5
Ease					
Training	8	N/A	24	16	16
Equipment	5	N/A	15	5	5
Cost					
Software	10	N/A	30	20	10
Functionality					
– Including					
Adaptive					
Machining					
Support					
Report	8	N/A	16	24	16
Creation					
Macro	10	N/A	30	20	0
Creation					
License		N/A	2	2	1
Limits					
Total		N/A	161	129	74

Table 2: Probing software scoring matrix

5.4 Costing Analysis

Equipment was sourced and tested to check for suitability from M & H.

The benefits of the system could be seen straight away using the equipment for time that could be saved. This was used in the cost benefit analysis with figures from the computer system used for working out the costs.

These costs are shown below which include the Capto units made in 2008 and January to November 2009. Times and costs were taken from the JobBoss system and then put into a table where calculations could take place to work out what savings could have been made over this period.

5.4.1 System Costs

The system costs for both the M & H systems and Renishaw systems are fairly similar. Equipment already installed on the machines was ignored for the purpose of providing a reasonable costing exercise and decision of the two systems would then come down to functionality.

The total price will include software cost, Inventor filter cost and probe cost. Total system price is approximately £9,000.

Payback period:

The payback period for the equipment can therefore be calculated as such below using the figures from the 2008 and 2009 parts manufactured: If we took option of all three for purchase at £9,000 plus three further probes at full price £2,140 (discount would have to be negotiated) which would equip all four Nexus Machines then:

Using 2008 figures (good year):

 $\pounds 10,263.75$ (money that would have been saved if probing in place) / 12months = $\pounds 855$ per month This gives a time for payback on equipment of 18 months

Using 2009 figures (bad year):

£5,533.5 (money that would have been saved if probing in place) / 12months = £461 per month This gives a time for payback on equipment of 33 months

The cost savings would be based on the machining time saved. With operations moving forward there would be the opportunity for increased levels of fixtures, which would raise the amount of capacity for the machines production. The parts produced on the machine and verified on machine would save labour costs of inspection. With production costs reduced the units will become more profitable to make and sell, which will also add benefit to the costs saved and the period of time for payback on the equipment.

Discounted Cash Flow:

Using the figures a discounted cash flow can be created. The calculation shown below is for the 2009 figures:

	Discount Rate	8.00%					
		0	1	2	3	4	5
		Year 0	Yr1	Yr2	Yr3	Yr4	Yr5
	Outflows						
	Equipment	-15140					
	Purchase						
	Inflows						
Monthl							
У							
461	Machine Costs	5532	5532	5532	5532	5532	5532
	recovered						
	Maintenance		-1514	-1514	-1514	-1514	-1514
	Cash Flow	-9608	4018	4018	4018	4018	4018
	Discounted	-9608	3720	3445	3190	2953	2735
	Cash Flow						
	Cum NPV	6435					

Table 3: 2009 Cash flow

Similarly the values for the 2008 figures:

Discount Rate	8.00%					
	0	1	2	3	4	5

		Year 0	Yr1	Yr2	Yr3	Yr4	Yr5
	Outflows						
	Equipment	-15140					
	Purchase						
	Inflows						
Monthl							
У							
855	Machine Costs	10260	10260	10260	10260	10260	10260
	recovered						
	Maintenance		-1514	-1514	-1514	-1514	-1514
	Cash Flow	-4880	8746	8746	8746	8746	8746
	Discounted	-4880	8098	7498	6943	6429	5952
	Cash Flow						
	Cum NPV	30040					

Table 4: 2008 Cash flow

The discount rate was set at eight percent and also a cost for maintenance added which could include software upgrades and other spares, which may be required.

This is set as 10% of the value of the equipment purchased.

The figures show the value of the equipment when purchased and then its value over the five-year period with depreciation.

As previously mentioned, the University hosted testing being undertaken by Renishaw. This was to investigate radio wave probes on the 5 axis Geiss machine, and also testing of their newest version of Productivity Plus AE pro. This version is specifically aimed at the lights out manufacturing market. The contact was a senior applications expert.

The new version of the AE Pro software is designed for creating probing cycles for lights out style machining. The program can be used as process control of features rather than for reporting. This would therefore mean this software could be used in conjunction with the M&H software, which will provide the inspection report at the end of the manufacture.

The program provides the ability to be able to chose a particular probe, or create one in the custom mode. This would be for stylus length and also diameter of the ball. Measure features are created in the program in a similar way to the 3Dimensional Form Inspect (3DFI) software. This is pretty standard amongst most packages these days.

Macros can be inserted into the program as well as logic statements, which allow for the machine to re work a part according to updates of tools and work piece offsets. The program can be added to Gibbs CAM software as an add-in, which allows the probing to become part of the generated cutting program. This could be something additional to investigate for the future.

5.5 Hardware and Software Selection

Following on from trials run on the machines within the Severn Cell the following equipment was decided upon:

Hardware – Renishaw Touch Trigger Probe. In the first machine, this was an OMP 60 model. As this was already installed in the machine there was no cost implication. The probe was only previously used for part datum setting through the Mazatrol Conversational Programming language.

A Renishaw TS27R Tool setting Probe was purchased to accompany the Part Probe for further automation of the processes. The tool probe measures both length and diameter of tools present in the spindle when commanded to do so. Values are transferred into the machine tool controller's tool data file.

Software – Renishaws Active Editor (AE) Pro was purchased by the company many years ago but was not implemented. The software in the current state was unsuitable for the purpose required of it. Many meetings were held with Renishaw during the

period of the project and agreement made to upgrade the software free of charge for the company's help in testing of new developments within the application. When the software was originally purchased this was around £6000. To work alongside the AE Pro software there is also report creation software, which is called CNC Reporter. This has the functionality to create inspection reports for each part produced. As an additional function, data from these reports can be used to create Statistical Process Control (SPC) graphs, which monitor how well the process is performing.

Costs for the other software and hardware are shown above and are quite comparable.

5.6 Hardware and Software Functionality

Essentially the touch trigger probes are the same, and both function using infrared signals from the probe to a receiver eye in the machine tool. The M&H probe can be programmed to send signals to match the Renishaw receiver, or any other brand, which makes it ideal for a replacement probe if an incident, occurs within the factory allowing the Probe to be used on most machines.

The tool-setting probe is a replacement for the standard Mazak equipment, which is only capable of length measurement of the tools. The Renishaw TS27R has functionality for measurement of diameter also.

It is the software where the main differences can be experienced. The M&H software is very similar to a package that would be found on a CMM. Feature points are easily selected and then a report generated post measurement to show the values measured. The software however has no functionality to apply automatic offset updates within the part program. The Renishaw software packages also behave in a similar manner to those of a CMM and allow for part programs to be created with automation included. This allows for work piece co-ordinate updates and tool dimension updates to create a manufactured in one process component. The downside to the program however is a lack of flexibility in reporting and complexity of the program.

5.7 Machine Maintenance

There are a number of ways in which the condition of the machines can be monitored. There are sophisticated tools available from manufacturers such as Renishaw, Agilent and Heidenhain, however simple ideas can also be effective, such as using a calibrated gold standard part.

The Heidenhain grid plate is an expensive kit to purchase and would not really be suited to 'everyday' shop floor usage. There is a great chance that it would be damaged accidentally.

Renishaw offer a Laser Interferometer kit as well as the BallBar kit. The Laser is used where full calibration is required and requires the machine to be out of use for around two days on average meaning it would only be used on a half yearly or yearly basis.

For general use, the BallBar kit provides the best overall solution. It is simple and quick to run, with shop floor staff having the ability to use the equipment if they suspect something is not right.

Highlighted below are the benefits and costs that would be implicated with such a system:

5.7.1 Benefits

The machines are monitored on a regular basis and allows for servicing to be implemented around this.

Graphical history charts for each machine can be created within the software, and could be used for monitoring of degradation or any results that do not fit the trend. The BallBar kit can be used on all machines with correct adaptor kit, which allows for factory wide usage.

Tests can be cut down in length of time taken when the operator is used to the use of equipment and generally tests take around 20 minutes per machine to complete. The equipment is kept in a hard case so can be stored easily and the risk for damage is kept minimal. It can be stored with other measurement and calibration equipment at one of the inspection stations, which allows access when required.

The kit can help to diagnose faults for maintenance of machines and provide a quick answer to the user, such as following an accident on machine to assess what damage has occurred, if any.

The kit provides ease of use as the computer can be placed anywhere with Bluetooth connection range and therefore there are no wires to get tangled or caught whilst operating.

5.7.2 Drawbacks

Whilst a test is being run the machines are out of operation. This may only be for 20 - 30 minutes at a time but is still lost productivity and money.

The results can be difficult to interpret for what is good and what is bad. It requires someone who can interpret the charts correctly to see where errors lie in the machine. The initial costs of equipment for purchase can be quite high and also depend upon the amount of equipment and adaptors required.

Calibration of the equipment needs to be kept up to date and will require responsibility for ownership of this.

The BallBar is an expensive piece of equipment if it is accidentally broken when running the program. This would most likely happen if changes were made to a proven test program. Running without the BallBar itself installed is always a good precaution when proving the program. This correct set up for operation will provide the most accurate results from the test.

The software has different modes from the front end, which include operator mode and advanced mode. This allows for setup and determination of tests, whereas an operator can only run the test.

Bluetooth connection has a limited range of 10m, which means a laptop is preferable for use, rather than desktop computer and sometimes is unreliable and does not hold connection compared with its wired alternative older model.

The software would ideally need to be kept to one computer so that the results and history files are kept up to date and in one central position.

Issues over responsibility of equipment and testing of the machines could be presented, such as use is only permitted by staff inspectors or certain operators and not everyone.

There is the possibility of chasing microns constantly and therefore increasing costs through service and maintenance of machines that is un-necessary for the type of machine.

Procedures would be required for 'standardising' the test as much as possible, such as on the Mazak milling machines, the heights in Z axis and also table position would need to be kept constant and within the usual working areas.

Not all accidents on the machines are reported so errors may only be picked up when testing routinely. This would raise questions for the frequency that testing of the machines would take place.

5.7.3 Costs

Kits are around £10k, which includes all available adaptors, full user training and certificates for calibration.

The BallBar is now wireless and therefore is very versatile for use, with no cabling dragging or tugging between the machine tool and computer.

Machine downtime for each test that is run takes around half an hour, so would be feasible to estimate that this would equate to roughly $\pounds 20 - \pounds 25$.

Human effort is required for each test that is run, and again this is approximately half an hour per machine. Responsibility for the testing would need to be assigned to someone as it would not be feasible training everyone in its use to begin with. A slow rollout program would be more effective.

A lack of maintenance costs money, as well as keeping the machines up and running. As parts wear, the errors created in the machines are ever increasing and therefore more likely to fail, which would cause greater expense of repairs.

Machine downtime can last for long periods, depending on the issue and therefore be better managed through preventative rather than reactive maintenance to reduce important lead times.

Costs provided by Renishaw

BallBar and calibrator Kit Bluetooth dongle Two days training for up to four people 360 degree Lathe adaptor kit VTL adaptor Total price £8850

For implementation of the BallBar system within the Severn Cell the following could be assumed:

Cost of the BallBar kit to suit milling applications $\pounds7850$

Four priority machines would be tested on a rolling basis with each machine tested fortnightly.

To reduce the impacts on production, this could be done on a Saturday morning or Friday afternoon when there are generally no shifts. The cost of each machines downtime would be around $\pounds 20 - \pounds 25$ for each half an hour it is being tested. This would mean that over a year it would cost between $\pounds 520 - \pounds 650$ per machine.

For the four machines this would work out to $\pm 2080 - 2600$ per year. If each machine had downtime of approximately two weeks per year through servicing and breakdowns this would cost the company between $\pm 5760 - \pm 7200$ Per machine. For all four machines, the total cost would be $\pm 23,040 - \pm 28,800$ Therefore based upon this assumption, if breakdowns and maintenance was reduced by fifty percent the cost of the BallBar equipment would have been paid for in 7 – 9 months roughly.

5.7.4 Training

The training provided is for two days and can include up to four colleagues. The training would be provided to suitable members of staff, such as the staff technicians, works manager and a member of management.

One day is spent learning the milling tests and the other is spent learning the lathe. Both days are mainly practical and include time for learning how to interpret and analyse the results provided by the equipment.

The course can be held at the company's premises or alternatively at Renishaw premises. The latter of the two could be useful in the sense it does not mean long periods of machine down time over those days, however, utilising the equipment on our own machines allows for greater knowledge to be gained and set ups stored within the machine. In effect analysis of the companies own machines under expert supervision would happen.

Further study, or pre training use would be useful for familiarity with the equipment and gaining more from the courses.

5.8 Summary

The chapter has drawn conclusions on the systems and processes that will be required within the company. Cost versus benefit analysis was performed and shown in graphical format as well as monetary values.

The systems chosen were the Renishaw BallBar for machine condition monitoring and after testing, the Renishaw probe and Active Editor Pro Software. Details of testing of the M & H system will also be presented in chapter six as there was substantial work completed with this system initially.

Details of the system implementations, testing and results will be detailed in the following chapters.

Chapter 6 – Implementation

6.1 Introduction

Chapter six describes the implementation of the hardware, systems and processes within the company.

A priority cell and machines are outlined for use and what will be required for successful implementation.

6.2 Implementation

Identification of Key Processes

6.2.1 Priority Cell

The cell chosen for initial implementation and testing will be Severn Cell, which is primarily made up of milling machines. This was chosen for the knowledge of the parts produced due to them being designed and produced in house. The levels of scrap and re-work account for approximately a quarter of the total for the factory overall. This was considered beneficial for process study.

The majority of work carried out in the Severn Cell will be small batches of around five to ten parts, but this can vary with large batches and one off specials also. In all instances there will be a massive time saving from inspection on machine for the first off part as discussed in chapter 5. This time is made up of removing the component from the fixture in the machine, taking the part to be inspected, re setting the component in the machine fixture and updating the program.

6.2.2 Priority Machine

For initial implementation, trials and testing will be carried out on one of the four Mazak Nexus 510 C II machines in the Severn Cell, which are vertical milling machines.

Two of the machines have Fusion 640M controllers, and two have Mazatrol Matrix controllers. The Matrix is the newest version of the two Controllers and is more refined than the 640M. It has subtle differences that could make a huge difference when programming and therefore it was decided that it would be most sensible to use the eldest of the four machines so that the likelihood of it functioning across all the machines is greater. If the newest controller had been selected first, there could be potential issues with backwards compatibility for programs on the controllers. Following on from the four VCN's the processes will be implemented onto the horizontal Mazak FH6000 machine. This has a Fusion 640M controller similar to the vertical machines.

6.2.3 Probe

The probes are already installed in the machine tools, and came as an additional purchase option at the time the machines were selected and purchased. The probes are a mixture of MP10 and OMP60. Both probes are infrared signal based, as there is no requirement for radio transmission due to the machines only being 3 Axis. The Strain Gauge probes were considered as an upgrade when investigating hardware and software, however, it was deemed that the equipment was sufficient for current purpose.

An M&H probe was also purchased during the duration of the project due to its flexibility and capability for use if accidents occurred with other probes, and at the time was deemed to be a better option as it worked with the M&H software calibrations and accuracies.

6.2.4 Software

The software package in use is Renishaw's Active Editor PRO. The company had a previous version of this installed on a standalone PC on the factory floor. Issues with this caused it to be discounted in the early stages of the project and did not have the relevant functions required.

A copy of M&H software 3D Form Inspect was purchased as this fulfilled most of the project requirements at the time. This was used and tested extensively until a new version of the Renishaw software was released, which had full functionality that was required for the project to come to fruition.

The software was released on a free upgrade due to the collaboration between the company and Renishaw in testing of Post Processors and for the Productivity Process Pyramid in its current state.

As an attachment to the Renishaw software, an add-on called CNC Reporter is used for inspection report generation and process monitoring through SPC functionality. Figures 6 - 13 show screen shots taken from the Renishaw AE Pro software where a part as been imported for a program to be created for measurement. The program was transferred to the machine tool controller and subsequently used. Figure 6 shows the extensive 'tree' of commands and logic on the left hand side of the screen with the part shown on the right with the Work Co-ordinate System (WCS). Figure 7 illustrates a feature being created on the model for inspection. In this instance it is for a plane and is then used to update the length of a tool. Figure 8 shows the tool that will be updated as a result of the feature measurement and the parameters that can be addressed for the tool. Figure 9 shows a logic statement being built within the software to control a specific update. In the figure shown here, it is for an angular check of the rotary axis using a measured plane. The logic statement provides an update for the rotary axis to ensure that the part is cut square. Figure 10 shows how a customised message can be displayed to the operator if the update exceeds the limits of the logic that has been created. Figure 11 demonstrates another measurement feature being created. This is for measurement of a bore and will be used for creation of updates such as the tool diameter. Figure 12 shows another feature available in the software, which will write the measured value in to a variable number on the machine tool controller. This is particularly useful when monitoring the process happening. Figure 13 shows the use of manual G-code entries being inserted in to the program to call a program to re-machine following a logic statement finding the part has been cut too small. The logic statement is also used to provide feedback for the operators as error messages. If the part is manufactured to tolerance it will continue to the next part program.



Figure 6: Test part model in the Renishaw AE PRO Software

Productivity: Active F	ditor Pro - OKM7149B-0	1.01	vample probing						
File Edit View Insert	Tools Post Process Help		compre prooring						
D			OL H @ 1	🗖 🗖 🕘 📻 🚓 🛛			A		
🗖 🗖 . 🔤 🖬 🐻	C & U ->	1	/				■		
🔹 💊 😍 🙍 · '	V 🔗 🤷 🗴 🏹	2	🗵 🖃 🦾 😂 🕼	7 ¥ 🔗 🚇 📄 🏅	ic +	•2 🛓 • 🛃 🔅	💽 🗄 🗄 🗒 🕼 Metric 💌		
B 📄 Inspection Cycle: CHEC	CK_TOP_FACE		^	Design 🖉 Visualization					
Measured Plane: P	fane_Z0_TOP_FACE			• contra • neogeoen		-			
- 😿 Machine Update: Upda	ke_TOOL2_LENGTH								
B E It Plane_20_TOP_FAD	E AngleErrorinAAxis GE 0.1								
B E Then	DOGG LODGE COMPONENT								
	PUSS_LUUSE_LUMPUNENT								
El El Code Block:	POSS LODGE COMPONENT:								
E F It Plane Z0 TOP FAC	E.PointonPlane Z GE .05								
D E Then		Ľ	Measured Plane: Plane,	_ZO_TOP_FACE					
- +0 G-Code Block:	REMACHINE_TOP_FACE_20	E	Feature Definition				_		
Elselt Plane_Z0_T	OP_FACE.PointonPlane.Z.LE -	4	Measurement Type	3 Points			▲ ↑		
+0 G-Code Block:	TOP_FACE_USIZE		Point 1 (P1)	-164.1103 41.7792 0			T I		
Inspection Cycle: MEAS	5_50MM_BORE		Point 2 (P2)	-111.8685 5.3024 0			↓ ſ		
Measured Lincle: L	TODIA DIA		Point 3 (P3)	-163.3179 -42.7368 0					
No Machine Update: Upda	de1		Probing Direction	Negative Z					
Machine Update: Upda	te2		Use stock allowance	No					
- No Machine Update: Upda	ite3	E	Toolpath (Advanced)				PI [•] •P3		
- No Machine Update: Upda	de4		Toolpath Type	Linear			Dat		
E L: Circle_50MM_BORE	Diameter LE 50.0		Use Retract Height	Yes			P2		
B E Then			Retract Height (h)	10		_			
- +[0] G-Code Block:	REMACHINE_50MM_BORE	E	Macro Mode Settings (A.						
Feature Definition			Output points	Yes		Ύκ Τ	Y V		
Measurement Type	3 Points		Calculate Actuals	Yes					
Point 1 (P1)	-164.1103 41.7792 0	E	Tolerance (Advanced)			Help information			
Point 2 (P2)	-111.8685 5.3024 0	н.	Angle Error in A Tolerance	<< Default >>		Choose how you want	to define the plane.		
Point 3 (P3)	-163.3179 -42.7368 0	۰.	Angle Error in B Tolerance	<< Default >>		In the 2 Bointy method	a plane is defined by three points, the system		
Probing Direction	Negative Z		Anda Error in C Tolaranca	0.02		measures the points an	d calculates the plane in which they all lie.		
Use stock allowance	No		Hige chorin c roerance	-0.02		The probing direction w	ill be normal to the place defined by the three points.		
Toolpath (Advanced)						the proof g areaset.			
Toolpath Type	Linear								
Use Retract Height	Yes	I.							
Retract Height (h)	10	Ē	Save as defaults				OK Cancel		((
Macro Mode Settings								_	
Uutput points	Yes								
Calculate Actuals	Yes					/ _		<u> </u>	
E Tolerance (Advanced)	(CD-dA-)								
Angle Error in A Tolerance	<< Defauk >>								
Angle Error in B Tolerance	<< Default>>								
Angle Error in C Tolerance	0.02								
0//			,						
							Projection = Orthograp	nic CS 1 · "G59"	NUM
🛃 start 🔰 😂 🥭	🧿 🗷 📨 🔚 🔋 T 🕯	a 8	📙 📓 Microsoft Excel - I	Mac 🛛 🔀 Microsoft Excel - Che	🕘		Productivity+ Active		10:49
P		- 1	🔓 🔛 Document L - Mice						Monday
		-							

Figure 7: A feature being created on the model for inspection.

Productivity+ Ac	tive Editor Pro - OKM7149B-01	example probing				🛛
File Edit View In	sert Tools Post Process Help					
🗋 🖻 • 🛃 🛛	👔 🕎 🐰 🔛 👘 🔊	• 🔍 • 📱 🍘 🏌 🔝 🖾	ا 🛠 🛟 🤤 🔍	😪 🛞 🛞 🚱 🕼	\$	
• % 🗘 [7 • 😵 🔗 🦽 🔺 😋	🗵 🝙 🛸 😂 🖉 🖆	🖉 📄 🖒 😳 ·	•21. 🕅 🗋	🔸 🗄 🗄 🗄 🗐 🔠 Menic 💌	
🕀 📄 Inspection Cycle	CHECK_TOP_FACE	🔼 🔿 Design	- Visualisation			
Measured P	lane: Plane_Z0_T0P_FACE					
No Machine Update	EUpdate_TOOL2_LENGTH					
B E It Plane_20_10	IP_FACE AngleEmotinAAxis GE 0.1					
+@ G-Code	Block: POSS LOOSE COMPONENT					
B 📴 Elselt Plane	20_TOP_FACE AngleEmorinAAsis LE	.1				
•@ G-Code	Block: POSS_LOOSE_COMPONENTa					
B E It Plane_20_T0	IP_FACE.PointonPlane.Z GE .05	Machine Update: Update TOOL2	LENGTH			
E Then				-		
Electrone	BIOCK: HEMALHINE_TUP_FALE_ZU 70 TOP_EACE PointonPlane 71E - 0	🖯 General				
- + B G Code	Block: TOP_FACE FORMAPHARE2 LE 1	Update Type Tool Length	×			
E Inspection Cycle	MEAS 50MM BORE	Tool Offset ID 2 Index/Edge Muscher 0				
- C Measured C	incle: Circle_50MM_BORE	Easture Place 70 TOP EA	F			
No Machine Update	: Update_TOOL4_DIA	Toyl Offset Benister Genmetry				
No Machine Update	e: Update1	Null Band Value (B) 0				
No Machine Update	r: Update2	Percentage Feedback 80			E A	
No Machine Update	x Update3				5	
No Machine Update	POPE Disease I E 50.0				2	
B F Then	DOME DIGINISI DE SOLO					
+@ G-Code	Block: REMACHINE_50MM_BORE				2	
General					8	
Update Type	ToolLength				<u>د ب</u>	
Tool Offset ID	2					
Index/Edge Number	0			Preip Prormation	a undefined	
Feature	Plane_Z0_TOP_FACE			Select what needs to be	r graaded.	
Tool Offset Register	Geometry			Tool Length allows you t can be explicitly set, or	to adjust the value used in the tool length offset. It calculated from a feature by using the difference in a	
Null Band Value (B)	0			measurement between	its nominal and actual positions.	
Percentage Feedbac	k 80					
		Save as defaults				
					UK Cancel	
				/ \\		
					Designation - Ophonese	He CS 1, "CSO" ALM
di otart		N N Marcarlt Fund - Marc	Annual Field the	ware a state of	Projector - Crondrad	K 10:50
atant L		En Protostic Excel - Mac			Producinity Pacifie	EN 🔍 🖉 Monday
1	3 📲 🎟 🔝 🗞 🚿 🧿 题 🌫	🛃 Document I - Microsof				14/02/2011

Figure 8: The tool, which will be updated from the feature.



Figure 9: Logic statement being built within the software to control a specific update.



Figure 10: Customised error messages can be displayed for the operator

Productivity+ Active E	ditor Pro - OKM71498-0	1 exam	ple probing						- C X
File Edit View Insert	Tools Post Process Help								
🗋 🖻 • 🛃 💽 🖞	17 X 🖻 🖺 🗳	- 6	🗉 🗄 🍋 🏋	÷	1 🔍 🖙 💠 🛞 🛞	8886	9		
• 🗞 🗘 💽 •	V 🔗 🤷 × 🏹) 🗵	1 🝙 🍰 🞒 🙍	7 🏆 (🖉 🕼 📄 🖒 🗐 ·	🖢 🦺 • 📓 🗋	🔹 🗄 🗄 🗐 🗐 Menic 💌		
Inspection Cycle: CHEC	X_TOP_FACE		<u>^</u>	🥏 Desig	n 📲 Visualisation				
Measured Plane: Pl	lane_20_TOP_FACE								
No Machine Update: Upda	Re_TOUL2_LENGTH								
Er Er Innane_20_10F_FA0	E Anglechon Avails GE 0.1								
- + B G-Code Block	POSS LODSE COMPONENT								
E b Etelt Plane 20 T	OP FACE AngleEmoinAAsis LE	-1							
- +0 G-Code Block:	POSS LOOSE COMPONENT		8						
B F II: Plane_20_TOP_FAC	E.PointonPlane Z GE .05	B In	spection Cycle: MEAS	50MM_E	BORE		X		
-+R G.Code Block	REMACHINE TOP FACE 20		tandoff/0vertravel			1		1	
Elselt Plane Z0 T	OP FACE PointonPlane Z LE -		andoff Distance (a)	10					
- +0 G-Code Block:	TOP FACE USIZE		vertravel Distance (b)	10		1			
B Inspection Cycle: MEAS	50MM_BORE	ΘM	lachine Settings					k in the second s	
🗌 💟 Measured Circle: Ci	icle_50MM_BORE	P	obe Name	Nexus	2	1		2	
No Machine Update: Upda	te_TOOL4_DIA	S	afety Plane Height (d)	50		11			
🚽 🐞 Machine Update: Upda	le1	0	urrent CS	CS 1 - 1	"G59"	11			
No Machine Update: Upda	te2	ΞD	efault Tolerances						
No Machine Update: Upda	le3	D D	efault Linear Tolerance	0.025		- O	ା ା ମ		
No Machine Update: Upda	164			-0.025			-		
E E ICUICIE_SUMM_BURE.	EF E II: Circle_50MM_BURE.Diameter LE 50.0		efault Angular Tolerance	1					
Er Er Then	DEMACHINE RIMM DODE			-1			ab		
Tel dicode block.	http://www.inte_somm_bone		;	X 0.01					
Standoff/Overtravel				-0.01			1 1 1		
Standolf Distance (a)	10	D	efault Positional Tolerance	Y .0.01	1				
Uvertravel Distance (b)	10			0.01		Help information			
Machine Settings	News 2		1	Z -0.01		The Standoff Distance,	a, is the distance between the nominal surface (S),		
Salatu Plane Heicht (d)	50	D	efault True Position Toleranc	e 🕸 0.0	12	and the position at whic	the measurement begins and ends. This value is not		
Current ES	CS 1 - "659"	1			_	coource scarring more	o,		
Default Tolerances									
	0.025								
Default Linear Tolerance	-0.025								
Default Annulus Televines	1	1							
Derauk Angular Tolerance	-1	Sa	re as defaults				City Count		- (
	× 0.01						CALCE CALCE		
	-0.01								
Default Positional Toler	Y 0.07		1						
	-0.01		[
	Z .0.01								
Default True Position Toler	- 0.01 								
a share more assort totel									
0//									
							Projection - Orthographic	CS 1 · "G59"	NUM
🐉 start 🔰 😂 😂	0 X 7 T T T	e PU	🕴 📕 Microsoft Excel - M		Microsoft Excel - Che	Microsoft Outlook We	Productivity+ Active	1	1 0:53
			-					DI 🔇	Monday
E 46		• 🖉	Document1 - Micro						

Figure 11: Another feature measurement being created.



Figure 12: Writing the measured value in to a variable number on the machine tool controller.



Figure 13: Manual G-code inserted

6.3 Processes

6.3.1 Processes for Implementation

Before any new systems can be placed on the machine, it is essential that the foundations are looked at in detail. The steps taken to ensure control of processes are very important and will determine how capable the machines are of repeating and being accurate.

The level of process control in place was measured in collaboration during a visit to a Renishaw facility, and a process pyramid created to follow a similar procedure to theirs.

One of the processes is a Ballbar test. This would be carried out at set intervals and give and provide a record of the machines capability.

6.3.2 Testing

Testing will begin with assessment of the machines and use the process pyramid to ensure there is a stable manufacturing capability to work from. One of the key processes to study is to ensure the machines are accurate and repeatable, so will require tests using the BallBar to assess the current situation.

Testing will include methods for programming of the machines and how the probing routines will work.

The testing procedure for the machine can now be simplified and broken down to the following steps for the next chosen machines:

- Check probe installed on machine
- Create calibration routine in software
- Run calibration of probe
- Create probing program in software
- Create programs in Mazatrol to cut part
- Run cutting program with probing
- Check inspection report against manual inspection

6.3.3 Investment Requirements

Below is a listing of what will be required to equip all four Mazak Nexus 510 C II machines to be able to run on a 'lights out' manufacturing basis:

- Spindle probe already present on machines so no cost applicable.
- Software previously purchased for FH 6000 machine with post processor specific to this. Upgrade of software negotiated for test purposes, and help to correct the post processor to work on the four Nexus machines. This will allow use of AE Pro on all machines.
- One package is required which will create probing routines and logic to be used in manufacture, and then a second add in for reporting of dimensions and SPC.
- Hardware wiring required to connect the machines to the computer for real time data collection if necessary and possible. Transfer of data and programs can be done using floppy disk or other media currently. This is not essential equipment but would be preferential to have for the future.
- Tool setting device not yet purchased but this includes all hardware and software required and any installation and training necessary for its use. It is not essential but will help to improve accuracy and will aid productivity.
- To maintain the machines and ensure their health a BallBar kit will also need to be purchased. The kit including training and adaptors is around £7850. The training includes necessary theoretical and practical teaching in both milling and turning operations. The health checks of the machines can be related to the periods of time between services and through monitoring of SPC data. If there are deviations to the defined standard baseline, a simple BallBar test could help to track a problem.

With software upgrades everything required for the purposes of the project is available. The addition of a tool setter will ensure greater accuracy and process stability. It will allow for full measurement of tools and could help provide more information on the usage of tooling and inserts with wear. The information can be fed back into the tooling file for more accurate information and performance from the machines.
6.3.4 Implementation Plan



Figure 14: General implementation flow chart



Figure 15: Calibration procedures

Above are two flow charts created to show the implementation processes for running the machine 'lights out'. One is the general overview, whilst the other describes the calibration process for the installation of the probing on to the machine. Steps to implement:

Install probe into machines. Check stylus run-out whilst in spindle using clock. This should be as small as possible to ensure a higher accuracy when probing. Any incidents such as crashes or bangs should call for the probe to be re calibrated in this manner.

Calibrate probe in both Mazatrol and ISO. This is done by setting a ring gauge on the machine table. The spindle should be loaded with a clock and adjustment made in the axes to find the true centre position. The Z-axis value can be set using the MMS

touch feature within the controller. This can be set at micron resolution and is accurate enough for pre calibration. The centre point values and Z height value should be recorded and also preferably stored within one of the G54 etc. The Mazak calibration is most easily done first and just requires the centre coordinates and a Z measure height to be entered. The Z height is measured first and touches on to the top of the ring gauge. The calibration function is next and measures four points within the gauge to give calibration values. Once the Mazak calibration is complete the Renishaw software can be used to create a calibration routine for the ISO side. The program generated uses twelve measure points on the inside of the ring gauge as well as the Z height measurement. This provides a vector measurement to give greater accuracy. The downside to this however is that more variable numbers are used both for calculation and also storing of calibration values.

It is important that the probes are recalibrated on a regular basis to ensure that accuracy is maintained and that measurement is consistent. If there is an accident on the machine then the probe should be calibrated again.

The probes should be used when possible and appropriate on jobs that pass through the machines. This may be more difficult in a situation where the part is a one off and no CAD model is present. Creating such a part could be more timely and ineffective for cost than standard measurement using height gauge or CMM if present at the time. If CAD models are required for tool holders then these can be designed from the drawings and then stored on the server as normal. The models could then also be used on the website.

The CAD model is imported into the relevant software, the M&H or Renishaw software. Once in the software, the model can be manipulated to suit the application it is to be used for, and allows for the part to match the datum set within the machine tool cutting program. This is usually set to the highest point in the Z-axis. If there is rotation in the indexer, the Z height datum needs to be adjusted accordingly. This can also be changed to suit within the measurement programs.

The programs then need to be created with measure points. When using the Renishaw software, machine updates can also be included and then when ready a machine program can be created. The program and its sub programs can then be transferred to the NC controller for running.

The programs created should have the ability to output the files the print folder on the machine controller. This information can automatically be passed across to the CNC reporter software and generated. This is all still to be queried however Below is a chart of all the processes and the responsibilities for each that happen from input (customer) through to the output (customer):

Process Sub Process Responsibility Customer Cell Manager Query / Quote Cell Manager Order Cell Manager Design IF Necessary Designer Manufacture Approval Customer / Designer Job Planning (Traveler) Cell Manager Manufacture Approval Customer / Designer Job Planning (Traveler) Cell Manager Manufacture Cell Manager Operator / Staff Technician Staff Technician Responsible Machine Staff Technician Machine Staff Technici			
Customer Cell Manager Query / Quote Cell Manager Order Cell Manager Design IF Necessary Designer Manufacture Approval Customer / Designer Job Planning (Traveler) Cell Manager Manufacture Cell Manager Manufacture Cell Manager Manufacture Cell Manager Create Mazatrol Programs Operator / Staff Technician Manufacture Cell Manager Manufacture Cell Manager Create Mazatrol Programs Operator / Staff Technician Align Axes for Machine Datum Staff Technician / Operator File Transfer Operator / Staff Technician Machining Operator / Staff Technician Probing Checks Operator / Staff Technician Inspector / Staff Technician Scrap Inspector / Staff Technician Inspector / Staff Technician Continue Inspector / Staff Technician Sample Inspection from Batch Inspector / Staff Technician Add Data to SPC Out of Limit Inspector / Staff Technician Add Data to SPC Out of Limit Inspector / Staff Technician Revice Pyramid Processes Staff Technician / Operator Gut of Limit Inspector / Staff Technician	Process	Sub Process	Responsibility
Customer Cell Manager Query / Quote Cell Manager Order Design IF Necessary Designer Manufacture Approval Customer / Designer Job Planning (Traveler) Cell Manager Manufacture Cell Manager Manufacture Cell Manager Manufacture Cell Manager Manufacture Cell Manager Create Mazatrol Programs Operator / Staff Technician Create Mazatrol Programs Operator / Staff Technician Manufacture Create Mazatrol Programs Operator / Staff Technician Align Axes for Machine Datum Staff Technician / Operator File Transfer Goperator / Staff Technician Operator / Staff Technician Operator / Staff Technician Machining Operator / Staff Technician Operator / Staff Technician Probing Checks Operator / Staff Technician Inspector / Staff Technician Re-Machine Inspector / Staff Technician Sample Inspection from Batch Inspector / Staff Technician Manual Inspector / Staff Technician Report Comparison Inspector / Staff Technician Add Data to SPC Inspec			
Query / Quote Cell Manager Order Cell Manager Design IF Necessary Designer Convert 3D Model to IGES Format Designer Iob Planning (Traveler) Cell Manager Manufacture Approval Customer / Designer Iob Planning (Traveler) Cell Manager Manufacture Cell Manager Create Mazatrol Programs Operator / Staff Technician Poprator / Staff Technician Finishing Operator / Staff Technician Operator / Staff Technician File Transfer Create AE PRO Program Staff Technician / Operator File Transfer Operator / Staff Technician Poprator / Staff Technician Machining Operator / Staff Technician Inspector / Staff Technician Probing Checks Inspector / Staff Technician Inspector / Staff Technician Re-Machine Inspector / Staff Technician Inspector / Staff Technician Scrap Inspector / Staff Technician Inspector / Staff Technician Sample Inspection from Batch Inspector / Staff Technician Inspector / Staff Technician Manual Inspector / Staff Technician<	Customer		Cell Manager
Order Cell Manager Design IF Necessary Manufacture Approval Customer / Designer Ide State Convert 3D Model to IGES Format Designer Job Planning (Traveler) Cell Manager Cell Manager Manufacture Cell Manager Cell Manager Manufacture Cell Manager Cell Manager Manufacture Create Mazatrol Programs Operator / Staff Technician Prinishing Operator / Staff Technician Operator / Staff Technician Align Axes for Machine Datum Staff Technician / Operator File Transfer Operator / Staff Technician Operator / Staff Technician Machining Probing Checks Operator / Staff Technician Inspection Report Inspector / Staff Technician Re-Machine Inspector / Staff Technician Sample Inspection from Batch Inspector / Staff Technician Manual Inspector / Staff Technician Report Comparison CMM Inspector / Staff Technician Add Data to SPC Inspector / Staff Technician Questor / Staff Technician Ball Bar Test Staff Technician	Query / Quote		Cell Manager
Design IF Necessary Manufacture Approval Customer / Designer Ido Planning (Traveler) Convert 3D Model to IGES Format Designer Ido Planning (Traveler) Cell Manager Cell Manager Manufacture Cell Manager Cell Manager Manufacture Create Mazatrol Programs Operator / Staff Technician Ido Planning Operator / Staff Technician Operator / Staff Technician Ido Planning Operator / Staff Technician Operator / Staff Technician Ido Planning Operator / Staff Technician Operator / Staff Technician Ido Planning Operator / Staff Technician Operator / Staff Technician Machining Operator / Staff Technician Operator / Staff Technician Probing Checks Inspection Report Inspector / Staff Technician Re-Machine Inspector / Staff Technician Inspector / Staff Technician Sample Inspection from Batch Inspector / Staff Technician Inspector / Staff Technician Manual Inspector / Staff Technician Inspector / Staff Technician Report Comparison Inspector / Staff Technician Inspector / Staff Technician	Order		Cell Manager
Image: convert 3D Model to IGES FormatCustomer / DesignerJob Planning (Traveler)Cell ManagerManufactureCell ManagerCerate Mazatrol ProgramsOperator / Staff TechnicianRoughingOperator / Staff TechnicianImage: Create Mazatrol ProgramsOperator / Staff TechnicianCreate Mazatrol ProgramsOperator / Staff TechnicianImage: Create Mazatrol ProgramStaff Technician / OperatorImage: Create AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspector ReportInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianManualInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianAdd Data to SPCInspect recor / Staff TechnicianManualCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff TechnicianAdd Data to SPCReview Pyramid ProcessesStaff Technician / OperatorReview Pyramid ProcessesStaff TechnicianCaptor FittingCheck ToolingOperator / Staff TechnicianCaptor FittingCheck ToolingOperator / Staff TechnicianContinueContinue ManufactureOperator / Staff TechnicianContinueCheck ToolingOperator / Staff TechnicianContinu	Design IF Necessary		Designer
Convert 3D Model to IGES FormatDesignerJob Planning (Traveler)Cell ManagerManufactureCell ManagerCreate Mazatrol ProgramsOperator / Staff TechnicianRoughingOperator / Staff TechnicianFinishingOperator / Staff TechnicianAlign Axes for Machine DatumStaff Technician / OperatorFile TransferCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspector ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianContinueInspector / Staff TechnicianContinueCMMInspector / Staff TechnicianAngula LangerInspector / Staff TechnicianContinueInspector / Staff TechnicianManualInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianAdd Data to SPCOut of LimitInspector / Staff TechnicianReview Pyramid ProcessesStaff TechnicianReview Pyramid ProcessesStaff Technician / OperatorCapto FittingCheck ToolingOperator / Staff TechnicianDespatchCheck ToolingOperator / Staff TechnicianCapto FittingFitterDespatchCapto FittingFitterCell Manager		Manufacture Approval	Customer / Designer
Job Planning (Traveler)Cell ManagerManufactureCeate Mazatrol ProgramsOperator / Staff TechnicianRoughingOperator / Staff TechnicianFinishingOperator / Staff TechnicianAlign Axes for Machine DatumStaff Technician / OperatorCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianOperator / Staff TechnicianOperator / Staff TechnicianMachiningOperator / Staff TechnicianOperator / Staff TechnicianOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianNapsector / Staff TechnicianContinueInspection ReportInspector / Staff TechnicianContinueRe-MachineInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianManualInspector / Staff TechnicianManualInspector / Staff TechnicianAdd Data to SPCOut of LimitInspector / Staff TechnicianAdd Data to SPCOut of LimitInspector / Staff TechnicianCaptor FittingPreseStaff TechnicianCaptor FittingCheck ToolingOperator / Staff TechnicianCaptor FittingFitterOperator / Staff TechnicianDespacthCutor filmitInspector / Staff TechnicianContinueOut of LimitInspector / Staff TechnicianContor FittingFitterOperator / Staff TechnicianDespacthCheck ToolingOperator / Staff TechnicianCapto FittingFitterOperator / Staff TechnicianCapto Fit		Convert 3D Model to IGES Format	Designer
ManufactureCell ManagerImage:Create Mazatrol ProgramsOperator / Staff TechnicianRoughingOperator / Staff TechnicianFinishingOperator / Staff TechnicianAlign Axes for Machine DatumStaff Technician / OperatorFile TransferCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksInspection ReportInspector / Staff TechnicianInspection ReportInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianScrapInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianManualInspector / Staff TechnicianManualInspector / Staff TechnicianContinueCMMInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianAdd Data to SPCCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorCapto FittingContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingFitterDespatchCell Manager	Job Planning (Traveler)		Cell Manager
Create Mazatrol ProgramsOperator / Staff TechnicianRoughingOperator / Staff TechnicianFinishingOperator / Staff TechnicianAlign Axes for Machine DatumStaff Technician / OperatorFile TransferCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspector / Staff TechnicianScrapInspector / Staff TechnicianScrapRe-MachineInspector / Staff TechnicianContinueRe-MachineInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianManualInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianBall Bar TestStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingCreak WanuafacturePoperator / Staff TechnicianStaff TechnicianFitterPackingFitterCapto FittingFitter	Manufacture		Cell Manager
RoughingOperator / Staff TechnicianFinishingOperator / Staff TechnicianAlign Axes for Machine DatumStaff Technician / OperatorCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspection ReportInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianContinueRe-MachineSample Inspection from BatchInspector / Staff TechnicianReport ComparisonCMMManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff TechnicianCapto FittingContinueStaff TechnicianStaff TechnicianCheck ToolingOperator / Staff TechnicianCapto FittingContinue ManufactureOperator / Staff TechnicianCapto Fi		Create Mazatrol Programs	Operator / Staff Technician
FinishingOperator / Staff TechnicianAlign Axes for Machine DatumStaff Technician / OperatorCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspector ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianContinueScrapRe-MachineInspector / Staff TechnicianSample Inspector from BatchInspector / Staff TechnicianReport ComparisonCMMManualInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff TechnicianStaff TechnicianInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianCapto FittingContinue ManufactureOperator / Staff TechnicianCapto FittingGontanue ManufactureOperator / Staff TechnicianPackingContinue ManufactureOperator / Staff TechnicianCapto FittingGuntanue ManufactureOperator / Staff TechnicianPackingContinue ManufactureOperator / Staff Te		Roughing	Operator / Staff Technician
Align Axes for Machine DatumStaff Technician / OperatorCreate AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspection ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianContinueScrapInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianReport ComparisonCMMInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorCapto FittingContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingInspector / Staff Technician		Finishing	Operator / Staff Technician
Create AE PRO ProgramStaff Technician / OperatorFile TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspection ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianContinueRe-MachineSample Inspection from BatchInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonCMMAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianBall Bar TestStaff Technician / Operator / Staff TechnicianContinueContinueCheck ToolingOperator / Staff TechnicianCheck ToolingOperator / Staff TechnicianCheck ToolingOperator / Staff TechnicianContinueContinueBall Bar TestStaff Technician / OperatorCapto FittingContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingInspector / Staff TechnicianCustomerCell Manager		Align Axes for Machine Datum	Staff Technician / Operator
File TransferOperator / Staff TechnicianMachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspection ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianContinueRe-MachineSample Inspection from BatchInspector / Staff TechnicianSeport ComparisonCMMManualInspector / Staff TechnicianReport ComparisonCut of LimitOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff Technician / OperatorKeview Pyramid ProcessesStaff Technician / OperatorCapto FittingContinue ManufacturePackingInspector / Staff TechnicianCapto FittingFitterPackingContinue ManufactureCustomerCell Manager		Create AE PRO Program	Staff Technician / Operator
MachiningOperator / Staff TechnicianProbing ChecksOperator / Staff TechnicianInspection ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianComparisonCMMInspector / Staff TechnicianReport ComparisonCMMInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufactureOperator / Staff TechnicianFitterPackingInspector / Staff TechnicianCapto FittingFitterPackingContinue ManufactureOperator / Staff TechnicianCustomerCell Manager	File Transfer		Operator / Staff Technician
Probing ChecksOperator / Staff TechnicianInspection ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianCMMInspector / Staff TechnicianReport ComparisonManualAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorCapto FittingContinue ManufactureOperator / Staff TechnicianFitterPackingFitterDespatchContinue ManufactureCell Manager	Machining		Operator / Staff Technician
Inspection ReportInspector / Staff TechnicianScrapInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianCMMInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff Technician / OperatorReview Pyramid ProcessesStaff TechnicianCapto FittingFitterPackingInspector / Staff TechnicianCustomerCell Manager	Probing Checks		Operator / Staff Technician
ScrapInspector / Staff TechnicianRe-MachineInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianCMMInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufacturePackingFitterPackingFitterCustomerCell Manager		Inspection Report	Inspector / Staff Technician
Re-MachineInspector / Staff TechnicianContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianCMMInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianReview Pyramid ProcessesStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorCapto FittingContinue ManufactureOperator / Staff TechnicianPackingFitterFitterDespatchCell Manager		Scrap	Inspector / Staff Technician
ContinueInspector / Staff TechnicianSample Inspection from BatchInspector / Staff TechnicianCMMInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianBall Bar TestStaff Technician / OperatorBall Bar TestStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufactureOperator / Staff TechnicianFitterFitterDespatchCell Manager		Re-Machine	Inspector / Staff Technician
Sample Inspection from BatchInspector / Staff TechnicianCMMInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufacturePackingFitterDespatchCustomerCustomerCell Manager	Continue		Inspector / Staff Technician
CMMInspector / Staff TechnicianManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufacturePackingFitterDespatchFitterCustomerCell Manager	Sample Inspection from Batch		Inspector / Staff Technician
ManualInspector / Staff TechnicianReport ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufacturePackingFitterDespatchInspector / Staff TechnicianCustomerCell Manager		СММ	Inspector / Staff Technician
Report ComparisonInspector / Staff TechnicianAdd Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianCapto FittingContinue ManufacturePackingFitterDespatchInspector / Staff TechnicianCustomerCell Manager		Manual	Inspector / Staff Technician
Add Data to SPCInspector / Staff TechnicianOut of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianContinue ManufactureOperator / Staff TechnicianPackingContinue ManufactureDespatchFitterCustomerCell Manager	Report Comparison		Inspector / Staff Technician
Out of LimitInspector / Staff TechnicianCheck ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianContinue ManufactureOperator / Staff TechnicianCapto FittingContinue ManufacturePackingFitterDespatchFitterCustomerCell Manager	Add Data to SPC		Inspector / Staff Technician
Check ToolingOperator / Staff TechnicianBall Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingFitterDespatchFitterCustomerCell Manager		Out of Limit	Inspector / Staff Technician
Ball Bar TestStaff Technician / OperatorReview Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingFitterDespatchFitterCustomerCell Manager		Check Tooling	Operator / Staff Technician
Review Pyramid ProcessesStaff Technician / OperatorWithin LimitInspector / Staff TechnicianContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingFitterDespatchFitterCustomerCell Manager		Ball Bar Test	Staff Technician / Operator
Within LimitInspector / Staff TechnicianContinue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingFitterDespatchFitterCustomerCell Manager		Review Pyramid Processes	Staff Technician / Operator
Continue ManufactureOperator / Staff TechnicianCapto FittingFitterPackingFitterDespatchFitterCustomerCell Manager		Within Limit	Inspector / Staff Technician
Capto FittingFitterPackingFitterDespatchFitterCustomerCell Manager		Continue Manufacture	Operator / Staff Technician
Packing Fitter Despatch Fitter Customer Cell Manager	Capto Fitting		Fitter
Despatch Fitter Customer Cell Manager	Packing		Fitter
Customer Cell Manager	Despatch		Fitter
	Customer		Cell Manager

Table 5: Process responsibilities



Figure 16: Process flow chart



Figure 17: Process Pyramid

6.3.5 Process Pyramid Stages

6.3.5.1 Preventative

Regular Maintenance

The preventative stage of the pyramid is probably the most fundamental and helps the understanding of the machine and processes that occur on it. Being preventative will ensure that the likelihood for error occurring is considerably reduced. Where things do go wrong, this is likely to be due to unforeseen circumstances.

Regular maintenance of the machine is the key to achieving successful manufacture of the components. Without systems and processes in place to control what is happening during the machining processes, there could be endless occurrences of errors and scrap parts. This aids production not only with probing in place but also on a day-to-day standard basis.

6.3.5.2 Design for manufacture

When parts are designed they will be checked for suitability for manufacture, and the processes and machines that will be required. All drawings are passed for approval after detail drawings are complete. Each set up will have a specific fixture already to aid this production, or where required, a new fixture manufactured. A design based KTP project will also influence a great deal of this work, which is running concurrently and will introduce a standardising system to allow all components to work from a standard features database.

6.3.5.3 Feed rates and spindle speeds

Feed and speed rates are being monitored currently and are populated within an excel spreadsheet, which details everything the operators need to know. It is anticipated that this can be further enhanced with the use of SPC, as the wear rates can be monitored with tool updates compared to sizes of features. The length of time for the cutting processes can be measured and will provide us with solid information. The tools available are all listed within one sheet of the file, and then the commonly used ones are separated and put into permanent pockets in the tool carousel. Doing so leaves spare pockets for which job specific tools can be entered. There is a vast

amount of knowledge amongst the shop floor technicians for the tooling used, what works best and keeping tool life optimal. When required the reps from tooling companies such as Sandvik and Guhring are very useful and will provide help and information on cutting, and optimisation.

6.3.5.4 Machine capability

Machine capability has been monitored where possible using ball bar testing equipment. A graphical history is built up within the software for this and allows for limits to be set before requirement for an engineer is called to service the machine. The capability can also be monitored through use of SPC when the probing is fully running and any features that are abnormal and out of limits should provide reasoning for investigation.

It is also important to know what the machine is capable of according to the manufacturers specifications. There would be little or no point trying to chase microns on a machine that could not get anywhere near this for example.

6.3.5.5 Probe qualification

To qualify the probe it must be calibrated on the machine against a ring gauge of known size. For the test purposes this was a 70mm ring, which, when calibrated measures 69.999mm.

A program can be created using Renishaw AE Pro software, which gives a calibration routine and will check for probe length and also work out offsets in the ruby ball and where the central position is. It calibrates by using vectors to get a best fit for the position and size. These calibration values are stored in the machine variables and can be viewed if necessary to ensure they have not been altered.

It is wise to calibrate the probe twice to ensure that the greatest accuracy is achieved and is recommended by the applications engineers who designed the software and work with it daily.

The probe is qualified in both Mazatrol and in ISO – this ensures that the probe is measuring the same within both variables in the controller.

6.3.5.6 Predictive

Protect from manual errors

The predictive step of the pyramid is the knowledge of the processes and where things could go wrong. By ensuring these are checked each time the machine is run, there should be very little chance of a manual error occurring.

6.3.5.7 Machine check

Checking that the machine is correctly functioning before any operation is carried out is essential.

The machines should be checked daily to ensure that there are no outstanding issues that require resolution before operation occurs. This would include checking levels of coolant and oil etc.

The machine job boards are noted with information of servicing dates. If these are incorrect or missing, they should be checked against the schedule.

6.3.5.8 Tooling suite check

The tooling required for each job should be checked before it is started. If it is a special or non-standard part, extra or new tooling may be required. This stage can be done when planning a job or during design, as well as double-checks being made before production.

All tooling should be listed in the tooling file and states everything the operators would need to know as shown in **Figure 18**. This can be used for cross-referencing against the tool data file on the machine controller.

6.3.5.9 Component in fixture check

Simple manual error such as not putting a component in the fixture – either the vice or indexer could cause the machine to crash if the green button was pressed. This also links to the correct part check as described next.

6.3.5.10 Correct part check

Ensuring that the correct part is placed into the fixture – many parts can be laid out on the floor next to the machine ready to be started. It could be the case that an incorrect

piece of material is picked accidentally, and then machined. This will also include checking that the programs within the machine are correct for the part to be produced and that it matches the drawing for the part to be machined.

Within the Renishaw AE Pro Software a simple program can be created to check that a part or piece of material is in its correct position and to the sizes it should be. If there is an incorrect sized piece of material, the machine can be forced to display an error, informing the operator to check the material. Critical features of a semi finished part could be used for location identification and setting of work piece coordinates.

If any of these states were incorrect it is possible to make the machine alarm and alert the operator to the error that has occurred.

6.3.5.11 WPC set

The Work Piece Co-ordinate (WPC) is set from the centre of the indexer and incorporates a set height fixture of a known length. This is the same for any part that is produced in this particular way. This ensures that there is consistency between all the components that are produced and all operators are taught to work out datum's for the jobs in this manner.

The choice to make next is whether or not to continue with the existing Mazatrol WPC or whether to change to G59 for example to ensure updates are happening each and every time. The Mazatrol system now has the capability for updates; however it is essential that these work EVERY time.

As mentioned above for correct part check, programs can be written which will locate the part and create the datum to be associated with this.

6.3.5.12 Tool set

Currently only tool length is set within the machine tool controller using the Mazak plunger system. The addition of a Renishaw tool setting device will ensure that the correct length and diameter of tools is set before use on a job.

The speeds and feed rates of the tools involved will also form part of this process level, ensuring that the base level has been properly adhered to.

6.3.5.13 Active

Indication of Process

The active level of the pyramid gives an indication of the processes occurring whilst machining the components. It links very closely to the top level which is informative.

6.3.5.14 Thermal track

The thermal track of the machine is controlled to an extent by the machine tool controller, which monitors temperature and compensates for fluctuation and deviation in the expansion of the machine tool. If there is too much variation or the machine cannot compensate it will alarm out and stop use. If this happens 10 times then the machine will lock out and need to be re-set by an engineer.

One machine suffered from this issue where it was alarming due to temperature differences occurring. One end of the machine is close to the fire door and the other is close to the overhead heater. The machine was therefore getting mixed signals due to considerable difference in temperature compensation being required for two different ends of the machine table.

6.3.5.15 Tool offsets

The tool offsets will be calculated within the cutting program itself through intelligent machining. After a part is cut, probing will take place and measure against a nominal value. This will go through logic statements and update the tool by the percentage of feedback required to achieve the correct sized cut.

The tools can be measured before cutting for size and also during cutting for extra checks if required. With accurate information before cutting takes place there will be fewer requirements for the cutting tool to be updated for re-cuts to take place during the machining process.

6.3.5.16 Broken tool check

Tools can be checked for breakage when measured, and also in cycle if there is a discrepancy showing in size. If there were enough pockets within the tool carousel, sister tooling could be used and called out.

The tools can be checked for breakage with the tool-setting device, as it should operate within a set of parameters for sizes of the tool it is measuring.

Results of probing data could also provide indication of broken tooling and cause the machine to stop and be checked.

6.3.5.17 Informative

Critical features only – Process Specific

The informative or top level of the pyramid is used to help feed back information into the other layers of the pyramid from the base upwards. The top level relies on the critical features being used to identify the processes requiring specific data.

6.3.5.18 Updates

The updates are feature based and come from within the probing program and are therefore only used for critical features.

The measurements of the dimensions against nominal sizes are passed through a series of logic statements, and output an update value. This can be either a tool dimension update or one for the work co-ordinate system to adjust an offset or even both if required.

Updates will only happen correctly if the processes before this occurs have been followed. If the machine tool is not able to repeat, the processes will not be able to compensate for this.

6.3.5.19 Finished and roughing sizes

This is the amount of material left on the component at each stage of manufacture and will be decided upon through trialling the programs on the machine and gaining confidence in its capabilities.

The Renishaw program has the capability to account for stock left on the part to adjust datum's, for positioning and work piece shifts.

The quality of the finish achieved and the sizes to tolerance will be determined through the amount of stock left before a final cut. The less material to be removed the better, as there is less force involved and ultimately meaning the cut takes place where it should.

	A B	С	D	E	F	G	Н	1	J	K	L	Μ	N	0	Р	Q	R	S	Т
1		Pockets Fixed tools stay on Machine					User Pod	kets Operator Co	ntrols fi	om Job	to Job		-						
2	Tool No!	Tool Description	Roughing or Finishing Tool	Nominal Size	Tool ID Letter	Actual Size	Tool Length	Tool Length out of Tool Holder ± 1mm	Depth of Cut/Peck	Speed S/Min	Meters MMin	Tool Life in Min	Width of Cut mm	Tool Supplier	Supplier Part Noi	Tool Martial	Insert Part No!	Tip Grade	Tip Draw No!
3	1	80mm Face Mill 90 Deg 6 Tipped	Roughing	80	Α	80	99.886	81	2.5	247	1.02	60	56	Sandvik	R290-080Q27-12M-6	Coated CBD	R290-12T308M-KM	1020	M6
4	2	80mm Face Mill 90 Deg 6 Tipped	Finish	80	F	80	99.9	81	0.3	275	1.02	120	56	Sandvik	R290-080Q27-12M-6	Coated CBD	R290-12T308M-KM	1020	M6
5	3	54mm Face Mill 90 Deg 4 Tipped	Roughing	54	0	53.8	129.88	110	2.5	156	1.2	120	37.8	Sandvik	R390-054C5-18M060	Insert	R390-180612M-KM	1020	M30/M40
6	4	6mm End Mill	Roughing	6	0	6	104.31	25	2.5	54	0.075	1000	1.8	Sandvik	R216.32-06030-AC10P	Carbide	N/A	1630	Blue Draws
7	5	12mm End Mill	Roughing	12	Α	12	115.88	50	3.5	60	0.165	700	8.4	Sandvik	R216.32-12030-AC22P	Carbide	N/A	1630	Blue Draws
8	6	25mm End-Mill 3 Tipped	Roughing	25	Α	24.94	128.97	89	2	280	0.36	120	17	Sandvik	R390-025A25-11M	Insert	R390-11T308M-KM	1020	M10
9	7	Centre Drill 12mm x 90°	Roughing	12	0	12	144.14	78	12	30	0.1	1000	12	Format	11401200	HSS-E	N/A	HSS Co5	DSP3
10	<mark>%</mark> 8	6.8mm Drill	Drilling	6.8	0	6.8	151.19	85	3.4	63	0.149	700	N/A	Sandvik	R840-0680-70-A1A	Carbide	N/A	1220	Blue Draws
11	<u>5</u> 9	8.2mm Drill	Drilling	8.2	L	8.2	198.65	132	2	36	0.221	0	N/A	Guhring	619	HSS	N/A	Nitrided Lands	Blue Draws
12	8 10	14mm Drill	Drilling	14	L	14	241.1	171	3	26	0.279	700	N/A	Guhring	667	HSS	N/A	TiN Coated	Blue Draws
13	-	10mm Chamfer	Chamfering	10	0	10	144.02	74	5	180	0.22	300	N/A	Sandvik	R215.84-01500-AC43G	Carbide	N/A	1620	Blue Draws
14	<u>2</u> 12	26.7 Chamfer	Chamfering	26.7	0	26.7	113.5	79	N/A	300	0.4	1000	N/A	Sandvik	R215.64-12A20-4512	Insert	SPMT 12 04 08-WL	4040	Blue Draws
15	ш 13	M8 Tap	Tapping	8	0	8	152.39	65	N/A	12	1.25	500	N/A	Guhring	C M 8 ISO2/6H DIN 371	HSS-E	N/A	N/A	Blue Draws
16	14	1/8" BSPT Tap (PT 1E 9.728)	Tapping	9.728	0	9.728	117.03	30	N/A	12	0.907	300	N/A	Warwick	0	HSS	N/A	N/A	Blue Draws
17	15	i 10mm End Mill	Finish	10	Α	9.96	115.75	46	0	60	0.351	700	1	Sandvik	R215.36-10050-AC22L	Carbide	N/A	1620	Blue Draws
18	16	M6 Tap	Tapping	6	0	6	0	55	N/A	12	1	500	N/A	Guhring	C M 6 ISO2/6H DIN 371	HSS-E	N/A	N/A	Blue Draws
19	17	5mm Drill	Drilling	5	0	5	150.04	65	3	63	0.103	700	N/A	Sandvik	R840-0500-70-A1A	Carbide	N/A	1220	Blue Draws
20	18	40mm x 6mm Wood Rough End Mill	Rough	40	W	40	0	0	24	184	0.358	1000	0	Sandvik	R331.35-040A16CM060	Insert	N331.1A-04 35 05M-KM	1020	Blue Draws
21	19	11.5mm Drill	Drilling	11.5	0	11.5	0	115	3	63	0.198	700	N/A	Sandvik	R840-1150-70-A1A	Carbide	N/A	1220	Blue Draws
22	20	18mm Drill	Drilling	18	0	18	231.25	155	2	36	0.324	700	N/A	Guhring	657	HSCO	N/A	TiN	Blue Draws
23	21	80mm Face Mill 45 Deg 8 Tipped	Roughing	80	G	80	84.94	67	3.5	188	1.92	60	56	Sandvik	R245-080Q27-12H	Carbide	R245-12 T3 M-KM	1020	M3
24		#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
25	ete	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
26	č	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
27	Å	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
28	E .	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
29	S I	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
30		#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
31		#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A	#N/A
32	- 30	Probe	Datum's	5	А	5	271.99	114	0	0	0	0	N/A	Renishaw	0	0	0	0	0

Figure 18: Tooling file

6.4 BallBar

6.4.1 Hardware

The hardware required for running the test is listed as below: Renishaw QC10 or QC20-W BallBar Zerodur calibrator Computer (with Bluetooth dongle if using wireless BallBar) Various adaptors to suit machines being tested

6.4.2 Software

The software used for testing the machines is Renishaw BallBar 20. Advanced mode allows for set-up of machines and tests, viewing of machine results and the machine history.

Operator mode allows for running of tests, viewing of machine results and the machine history.

Quick check mode allows for running of tests and viewing of machine results.

6.4.3 Process – Test Method

The test would be carried out weekly in an ideal situation, moving to a fortnightly check to perform a reasonable analysis of the machines condition during the initial phases of the project. The analysis records need to be printed, and stored for continual monitoring and as part of process analysis. The records are stored within the software and can show any degradation over a period of time. This error can be picked up and used for maintenance purposes, either corrective or preventative. The following is required to set up a test to run:



Figure 19: Renishaw BallBar 20 software Advanced mode home screen



Figure 20: BallBar test setup screen - machine creation or selection

Renishaw Ballbar 20 Advanced	Section Section	
🚮 Set-up and run a ballbar test		۳/۱ 🥹 -
Nexus 3		
XY 360deg 100mm Calibrated		SPECIFY TEST
		The screen shows the ballbar tests that are available for the selected machine
Select a test C:\Users\Public\Docun	All specs 👻	
File	Date	Double click on the test you require, or highlight it, and click
XY 360deg 100mm Calibrated	2010-Jul-21	
XY 360deg 100mm Calibrated F1000	2010-Jul-21	TIPS
XY 360deg 100mm Calibrated F2000	2010-Jul-21	To had Editer Balak a had one the following holders:
XY 360deg 100mm Calibrated F5000	2010-Jul-21	To Add, Edit or Delete a test, use the following buttons:
XY 360deg 150mm Calibrated	2010-Jul-21	
XY 360deg 150mm Calibrated F1000	2010-Jul-21	Add new fact
XY 360deg 150mm Calibrated F2000	2010-Jul-21	
XY 360deg 150mm Calibrated F5000	2010-Jul-21	Edit existing test
XY 360deg 250mm Calibrated	2010-Jul-21	
XY 360deg 250mm Calibrated F1000	2010-Jul-21	Delete existing test
XY 360deg 250mm Calibrated F2000	2010-Jul-21	boroto oncomignoot
XY 360deg 250mm Calibrated F5000	2010-Jul-21	If the test you want to run is not shown, either change the filter or select a test from
YZ 220deg 100mm Calibrated	2010-Jul-21	the folder of another machine.
YZ 220deg 100mm Calibrated F1000	2010-Jul-21	4
YZ 220deg 100mm Calibrated F2000	2010-Jul-21	If you selected the wrong machine, click 🖓 and select another.
YZ 220deg 150mm Calibrated	2010- Jul- 21	
YZ 220deg 150mm Calibrated F1000	2010-Jul-21	
YZ 220deg 150mm Calibrated F2000	2010-Jul-21	
YZ 220deg 250mm Calibrated	2010-Jul-21	
YZ 220deg 250mm Calibrated F1000	2010-Jul-21	
YZ 220deg 250mm Calibrated F2000	2010-Jul-21	
ZX 220deg 100mm Calibrated	2010-Jul-21	
ZX 220deg 100mm Calibrated F1000	2010-Jul-21	
ZX 220deg 100mm Calibrated F2000	2010-Jul-21	
ZX 220deg 150mm Calibrated	2010-Jul-21	
ZX 220deg 150mm Calibrated F1000	2010-Jul-21	
ZX 220deg 150mm Calibrated F2000	2010-Jul-21	
ZX 220deg 250mm Calibrated	2010-Jul-21	
ZX 220deg 250mm Calibrated F1000	2010-Jul-21	
ZX 220deg 250mm Calibrated F2000	2010-Jul-21	
		22:27
		25/10/2011

Figure 21: BallBar test setup screen - plane selection

Review results		1/1
exus 3		X
Y 360deg 150mm Calibrated 20101102-104200		SELECT REPORT
elect a report C:\Users\Public\Docun	All reports	The screen shows the ballbar test reports that exist for the selected machine.
le	Date	
XY 360deg 150mm Calibrated 20101102-104200	2010-Nov-02	Double click on the report you require, or highlight it, and then click W.
XY 360deg 150mm Calibrated 20110223-154406	2011-Feb-23	TIPS
XY 360deg 150mm Calibrated F1000 20101102-104917	2010-Nov-02	1
XY 360deg 150mm Calibrated F1000 20110223-154932	2011-Feb-23	Reports can be sorted by date or name, by clicking on the File or Date buttons.
XY 360deg 150mm Calibrated F2000 20101102-105302	2010-Nov-02	
XY 360deg 150mm Calibrated F2000 20110223-155249	2011-Feb-23	If the report you want is not shown, either change the filter, or select a report from folder of postbor machine.
YZ 220deg 150mm Calibrated 20101102-111059	2010-Nov-02	Torder of another machine.
YZ 220deg 150mm Calibrated 20110223-160652	2011-Eeb-23	To view results from an earlier version of Ballbar software, change the filter to sele
YZ 220deg 150mm Calibrated F1000 20101102-111325	2010-Nov-02	RTB files, and change the folder path if required.
YZ 220deg 150mm Calibrated F1000 20110223-161052	2011-Eeb-23	
YZ 220deg 150mm Calibrated F2000 20101102-111522	2010-Nov-02	If you selected the wrong machine, click 🖓 and select another.
YZ 220deg 150mm Calibrated F2000 20110223-161342	2011-Feb-23	
ZX 220deg 150mm Calibrated 20101102-110057	2010-Nov-02	
ZX 220deg 150mm Calibrated 20110223-161804	2011-Feb-23	
ZX 220deg 150mm Calibrated F1000 20101102-110353	2010-Nov-02	
ZX 220deg 150mm Calibrated E1000 20110223-162027	2011-Eeb-23	
7X 220deg 150mm Calibrated E2000 20101102-110537	2010-Nov-02	
7X 220deg 150mm Calibrated E2000 20110223-162217	2011-Eeb-23	
•		
	(8

Figure 22: BallBar test results selection screen

Renishaw Ballbar 20 Advanced	
🕈 Set-up and run a ballbar test	۳. 🕺 🖓
Nexus 3 Severn Cell	SPECIFY MACHINE
Select a machine	The screen shows the machines that are available for testing and review.
Select a machine	The screen arows me machines that are available for testing and review. Acuale click on the machine you want, or highlight it, and click . TPS To Add. Edd or Delete a machine, use the following buttons: Add new machine Add new machine Add new machine Conce machine (create copy of machine details) Add new machine Conce machine (create copy of machine details) Conce machine (create copy of machine de
	• 🙀 🕯 📶 🍫 22:33

Figure 23: BallBar test setup - machine addition screen

Renishaw Ballbar 20 Advanced				
🚮 Set-up and run a ballbar test				۳ 🖉 ۲
	¢ţz			TEST SETUP – 1 Select a machine type. Select a test plane. Enter a feedrate. If ballow length calibration is required, tick the calibrator box. If you want to include machine thermal expansion compensation, enter a machine expansion coefficient (see fips below). Select a test radius.
TEST PLANE FEE	edRATE 1000.0 mm/min	CALIBRATOR		Enter other details (optiona). Click III to continue. TIPS The machine type and test plane are used to define the default test arc on the next page. The ballbar length needs to be calibrated only if you want to measure radial deviation or positional tolerance, or include absolute "scale error" values in the Retrishaw analysis. If you test the calibrater option. It is important that the radius in your machine part program acutately matches the test fradus selection this setup option of you are entering your part program in inches, and your controller only supports 4 decimal places. They our sould enter arc suchon ballbar and radius that eachy matches the
OTHER DETAILS Test position NC Program ID Spindle number 1			4 4	I data ar jed part plogan, vierinaliven, ice ment clinis, oon winer seecing me balaar arteriades and in jov part program. If you calibrate the balabra length, you can also include machine thermal expansion compensation. If you do not vant to include the, and are a value of 0 pom/des 0; 10 or pom/des 0; 11, 19 voi do not collide the, and are a value of 0 pom/des 0; 00 or pom/des 0; 10 - 12 gom/des 0; 65 - 65 pom/des 1) is definited value with the value behaven 10 - 12 gom/des 0; 65 - 65 pom/des 1) is definited value with the refer to the <u>Temperature compensation</u> section in the on-line help for more details.
🚳 🚞 🥔 🔄 🐇 🖪 🎽	1 🖉 🛷			▲ 🏷 û 📶 🏍 22:33 25/10/2011

Figure 24: BallBar test setup - parameter screen

Renichaw Ballbar 20 Advanced	
A Set-up and run a ballbar test	
View	TEST SETUP - 2 The VEW window shows the current test setup. The axis labels show the direction of motion of the tool relative to the work holder. The areas show the tool pain. To simulate the lest, click To simulate the lest, click If the test setup is not correct, use the AXES, ARCS and RUNS controls to adjust it. If you rest of commer the axes, click the Rename box and enter the new axis names (capital) amazed, e.g. V. To create or find a suitable pat program using the Pat Program Generator, click Otherwise, click Otherwise, click
Axes Adjust 👀 💲 Rename 🛛	TIPS V To define a custom test arc, click V and enter the angles you require.
Arcs Cepture 800 880 180 220 Overshoot 80 45 5 2 Rotate	Please note that the 220 degree partial arc test can only be performed using the OC20-W 2
Runs Run 1 G03 G02 G03 G02 G02 G03 G02 G03 G02 G03 G03<	
🚳 🚞 🖉 🐼 🖪 🖉 🗮 🖉	▲ 🍢 🗊 add 🌆 22:38 ▲ 🍢 🗊 add 🕼 25/10/2011

Figure 25: BallBar test setup - direction and limits screen

XY 360deg 150mm - Renishaw Ballbar 20 Advanced			- • × % @ •
Summary Jest Machine Test name XY 360deg 150mm Machine Id Test Instrument QC10 or QC20-W ballbar Pane under test XY Radus 1000.00mm/min Feedrate 1000.00mm/min Operator Daniel Pre-test comment	Pert program generator - Test Controller MazadorfC (Fasan 640 XY 360deg 150mm + Y Thed Ans Z Test Radus 150 000mm Fedatas 150 000mm Fedatas 150 000mm Run Diection CCV(CV HC Program D	Part Program PART PROGRAM GENERATOR The econtrol of field specifies the currently selected controller file. To select another file, click To select another file, click To select another file, click The set semptate details are shown on the left. These served by the generator to create the part program. Click Do simulate ballbar movement. Previously saved part programs can be viewed by clicking Click Dependent a part program. The software (of required by the controller) have been entered. Previously saved part programs. The software (of required by the controller) have been entered. The software (of required by the controller) have been entered. The software (of required by the controller) have been entered.	TEST SUMMARY Check the Test summary shown. Ensure you are using the correct instrument as shown on this soreen. Ple the balbar and extension bars to match the test radius shown. Image: the machine and part porgram for the test. Image: the machine and part porgram (or the test. Image: the machine and part porgram (or the test. Image: the machine and part porgram (or the test. Image: the machine and part porgram using the Part Program Generator, click Image: the click image: the test. Image: the test. Image: the test. Image: the test. Image: test.
🚳 🚞 🥔 🐼 🖶 🎽			▲ 🎉 îi .all 🕼 22:47 25/10/2011

Figure 26: BallBar test setup - part program creation

Advanced mode must be selected from the software to allow set up of tests **Figure 19**. A machine needs to be created if not already present **Figure 20**. This will build a file that can store the history of all tests on the machine and keep records of the machines

condition. Where a number of machines are similar, the machines can be cloned and re-named.

After a machine has been selected a test will need to be set up if there are none available already **Figure 21**.

The type of machine is selected from a graphical list, such as horizontal or vertical milling machine **Figure 23**. The test plane is next selected and will require repetition of this process for all three planes if required. A feed rate for the test can be entered, and again, a number of different feed rates may wish to be selected for representation of the differing machining processes **Figure 24**. The BallBar length is selected next from a drop down list. It is recommended for a length to be selected that best suits the working volume of the machine being tested. Other details can also be entered for a test position and program numbers used.

The following screen in the program is for determination of the run **Figure 25**. The direction of the axes can be set and determination of the direction of travel of the BallBar made. The amount of travel the BallBar makes can be decided with options for full circular travel and the amount of overshoot to get an effective reading. If a part program is required, this can be generated within the software. A controller type must be selected and program number entered so that a program can be processed in to G-code format **Figure 26**.

To run the test, the equipment must be set up in the machine ready with the BallBar placed on the calibrator switched on. The machine for testing and test plane is selected and the screen is displayed for beginning a test on the machine showing communication between BallBar and computer.

The results and machine history can be selected from the front end of the software. In a similar manner to the test set-up, the history files for the machine are laid out in the same manner **Figure 22**.

The method for which the BallBar is installed in the machine is described in the appendix for both wired and wireless BallBar systems. The part programs for the measurement will also be included as part of the appendix.



Figure 27: BallBar test running on probing implementation machine



Figure 28: BallBar test running on probing implementation machine

6.5 Summary

The implementation of hardware, software and processes is described within the chapter and includes illustration where possible. In the next chapter, the results of the implementation and testing will be discussed.

Chapter 7 – Testing and Results

7.1 Introduction

This chapter follows on from the implementation of the processes and systems to test against the original aims and objectives of the project.

7.2 Testing and Results

7.2.1 Development of Systems – M&H Systems

Testing initially began on the machines using the M&H software and probe. The installation of the probe within the machine tool is a straightforward approach and is calibrated using a clocked ring gauge. ISO programs are loaded in to the machine tool for the various functions required for the probe to function, such as inch or metric checks, bore checks and line or plane checks.

These were installed in the machine tool as programs 9100 to 9128. The 3DFI software also required programs to reside within the controller, which were 5002, 9850 and 9851. A program 5000 was created through the 3DFI software, which is specific to the part requiring measurement.

The results of the implementation are presented below in tabular form. Explanations of the issues are described and used to move forward with new approaches. At each stage significant amounts of time were spent at the machine writing and modifying programs to run and test.

The program flow between Mazatrol and ISO proved very difficult to understand and issues with nesting of programs meant that different approaches had to be made at each stage.

In the fifth table below, the program flow is finally reached for successful achievement of a program, run from start to finish. Although success was achieved, the practicalities and difficulties associated would be quite counter productive. The ISO programs are attached to the thesis as an appendix and have been simplified as much as possible. At this point of testing, the Renishaw system became available for use and the results of such will follow after the description of the M&H equipment.

Operation	System Hardware / software	Working	Issue
Set up	Mazatrol routines + M&H Probe + Mazatrol Program	Yes with no problems	Only for datum setting
Machine	Mazatrol Program	Yes	Programs currently created in Mazatrol Conversational language for ease of use
Check	Mazatrol Program + M&H Probe + 3DFI Software + M&H Probing Macros	No	Final inspection program was being used – Issue came when trying to get updates from this for Mazatrol. Need to find how / where dimensions recorded are stored – how to extrapolate to go back and re-machine using these
Re-Machine	Mazatrol Program	No – Due to component not being checked	Programs currently created in Mazatrol Conversational language for ease of use – would be same as initial machining but against updated offsets.
Final Inspection	M&H Probe + 3DFI Software + M&H Probing Macros	Yes (as separate entity)	Prints out reports with no issues – Not capable of use for going back to re-machine. Called at end of program as G65 P5002 in Mazatrol.

Table 6: Initial Mazatrol trials



The flow chart above is representative of the table above. Further explanation of such is listed below in its sequential order:

Mazatrol Program

This program is used as the base for all programming and cutting of the material. It is used to call both Mazatrol and ISO Sub Programs. The setup of the program datum's is done from within the Mazatrol cutting program using the Mazatrol routines for step measurement and part height using the M&H Probe, which are basic and only used for finding a Z surface height and X and Y step values. This gives the height of the part in its fixture, and the dimensions of the material in the XY plane.

Mazatrol Cutting Program

A Mazatrol cutting program was used in this trial that was already saved within the controller. It was copied and renamed so that any changes made would not be left in for an operator to make an error with upon next use. All cutting programs are made through the Mazatrol conversational programming language, so would therefore be beneficial for us to use as re writing everything could take time.

Mazatrol Program

The Mazatrol program calls the final inspection program as a sub program to go in and measure the part. This is done successfully however there is no way of extrapolating the measured results for use to update the Mazatrol program. Without the ability to use these measured values, no logic can be performed to update the WPC.

Mazatrol Cutting Program

The re-cutting of material cannot take place as updates have not been made within the Mazatrol program for any offsets.

Operation	System Hardware / software	Working	Issue
Set up	Mazatrol routines + M&H Probe + Mazatrol Program + Master ISO Program	Yes with no problems	Master ISO Program created – calls sub program from Mazatrol to set datum's and then transfers to G59 (or whichever other is available)
Machine	Mazatrol Program	Yes	Programs created in Mazatrol Conversational language for ease of use – Called into Master ISO to do cutting – G65 command
Check	Master ISO Program + M&H Probe + M&H Probing Macros	Partly	Master ISO Program calls M&H Probing cycles (feature used was across a tenon) M&H probe cycle no P9110 – Uses offsets from Mazatrol initially which are fed into G59. Tool radius offset activated for use to re-cut with this program call. Program cycle stopped at 45 mm above job – just before probing across width was about to occur – needs de bugging to check?
Re-Machine	Mazatrol Program + ISO Program	No – Due to component not being checked	Logic held within ISO program to check against tolerance and then re-call the Mazatrol cutting program within ISO – uses tool radius offset compensation to cut to correct size.
Final Inspection	M&H Probe + 3DFI Software + M&H Probing Macros	Yes (as separate entity)	Prints out reports with no issues – Not capable of use for going back to re-machine. Not tried at this stage as it has previously worked and can be relied upon. Will just be called at end of program as G65 P5002 in Mazatrol.

Table 7: Revised Maztrol trial



The flow chart above is representative of the table above. Further explanation of such is listed below in its sequential order:

Mazatrol and ISO Program

The Mazatrol program is used as the base for all programming and cutting of the material. It is used to call both Mazatrol and ISO Sub Programs. The setup of the program datum's is done from within the Mazatrol cutting program using the Mazatrol routines for step measurement and part height using the M&H Probe, which are basic and only used for finding a Z surface height and X and Y step values. This gives the height of the part in its fixture, and the dimensions of the material in the XY plane. Once the datum is established within Mazatrol, a sub routine is called within Mazatrol for an ISO program, which then shifts the Datum to G59 or whichever other is available for use.

Mazatrol and ISO Cutting Program

For this example, a cutting program was created within the ISO program to cut the material with a simple feature. In this case the raw material was rough-cut to create a square block, which could be then measured for width.

ISO Program

Following the cutting program, there is a program call for measurement of the part using program P9110. The program is referenced for the part using the datum that was transferred into G59. The program call was successful and started to move the probe. On each try however, the probe would stop at 45mm above the job and just stop. The controller would not show up any alarm to give an indication of a problem. The probing cycle parameters were set so that the radius of the tool would be changed to re cut the material if necessary with an updated value.

Mazatrol Cutting Program

The re-cutting of material cannot take place, as updates have not been made within the Mazatrol or ISO program for any offsets as the probing did not occur and function correctly.

Operation	System Hardware / software	Working	Issue
Set up	Master ISO Program	Yes	Master ISO Program created – sets datum's within G59 (or whichever other is available)
Machine	Master ISO Program	Yes	Programs created in ISO language – Just cutting a rectangle in our example for speed of testing – Would be long winded to write programs in ISO for all parts
Check	Master ISO Program + M&H Probe + M&H Probing Macros	Yes	Master ISO Program calls M&H Probing cycles (feature used was across a tenon) M&H probe cycle no P9110 – Uses offsets from G59. Tool radius offset activated for use to re- cut with this program call. Program cycle ran through and measured width – tool radius offset updated.
Re-Machine	ISO Program	Yes	Logic held within ISO program to check against tolerance and then re-call the cutting program within ISO – uses tool radius offset compensation to cut to correct size. (Can be seen on machine position page that it is updated to remove more material
Final Inspection	M&H Probe + 3DFI Software + M&H Probing Macros	Yes (as separate entity)	Prints out reports with no issues – Not capable of use for going back to re-machine. Not tried at this stage as it has previously worked and can be relied upon. Will just be called at end of program as G65 P5002 in same way as in Mazatrol.

 Table 8: ISO only programming



The flow chart above is representative of the table above. Further explanation of such is listed below in its sequential order:

ISO Program

The ISO program is used as the base for all programming and cutting of the material. The setup of the program datum's is done from within the ISO program using a centre drill to estimate the parts central location before inserting the values into G59 or whichever other WPC is available.

ISO Cutting Program

For this example, a cutting program was created within the ISO program to cut the material with a simple feature. In this case the raw material was rough-cut to create a square block, which could be then measured for width. This would be representative of us creating a tenon feature on a tool holder. It was cut simply with an end mill.

ISO Program

Following the cutting program, there is a program call for measurement of the part using program P9110. The program is referenced for the part using the datum in G59. The program call was successful and probed the feature as it was wished for. The program next uses some simple logic statements to check the dimensions of the measured feature. The probing cycle parameters were set so that the radius of the tool would be changed to re cut the material if necessary with an updated value.

Logic Statements

The logic statements are used to decide the 'fate' of the part through simple equation. There are three possible outcomes that can occur through the logic which are; that the part is in size and tolerance and that the part can therefore continue on the next part of the program, the part is undersized (in this instance as it was a bore measurement) and can therefore be re-machined to correct the size, or finally, it is too large and therefore the part is scrap.

Part ok – continue program

The part has been measured and is within size and tolerance. The program is therefore told to move to the next operation through the logic statements. There is not a specific logic for this, as the values will fit in between the two logic statements. If this happens then the program will carry on to the next stage of the program.

Part repairable – go back and re cut

The part has been measured and is (in this case) undersized. The program is informed that it should go back to the original cutting program and update to cut the feature to

the correct size. The probe will then be called again following this for a re check. The logic for this states that if the stored measure value is less than the nominal size minus the tolerance then go back to the start of the cutting program for this feature. *Part not good* – *scrap*

If the part is measured and it is above the size and tolerance values then the program will display and alarm, which will tell the operator the issue, such as, bore too large or part too small. The part is then deemed as scrap and will need to be restarted with operator checking for possible causes or issues, such as incorrect tool used and cut too large. The logic for this states that if the stored measure value is greater than the nominal size plus the tolerance then go to the alarm screen to advise the operator that the part is outside the limits and is therefore scrap.

ISO Cutting Program

The re-cutting of material is dependent upon the outcome of the data flowing through the logic statements. If it is decided that the part can be salvaged then the program will go back and re-cut the material. If the part is within tolerance then the program will continue with the next cutting operation.

Final Inspection

Once the part has been finish machined, the final sub program call is used to select the final inspection of the part to produce the inspection report.

Operation	System Hardware /	Working	Issue
	software		
Set up	Mazatrol routines +	Yes	No problems – Datum's set using Mazatrol and use G58 as
	M&H Probe + Mazatrol		WPC
	Program		
Machine	Mazatrol Program	Yes	Machining cycle ran through in Mazatrol – Just one feature
			chosen for tests of 14mm through hole.
Check	ISO Program + M&H	Yes	Program would go through Part check Using G65 call for
	Probe + M&H Probing		Program 9110 for bore measure. Reached Logic tests and
	Macros		then alarmed when reaching G65 / M98 call for Mazatrol
			program.
Re-Machine	Mazatrol Program	No	Program would not re call or go back into Mazatrol from the
			ISO Sub Program. Mazatrol operator book also determines
			this as impossible – even though it lists instructions!
Final Inspection	M&H Probe + 3DFI	No (works as separate	Did not reach this stage of the program.
	Software + M&H	entity though)	
	Probing Macros		

 Table 9: Mazatrol - ISO - Mazatrol



The flow chart above is representative of the table above. Further explanation of such is listed below in its sequential order:

Mazatrol Program

The Mazatrol program is used as the base for all programming and cutting of the material. The setup of the program datum's is done from within the Mazatrol program using the Mazatrol datum setting routines and is then stored into G58 or whichever other WPC is available.

Mazatrol Cutting Program

For this example, a cutting program for a particular part was used, which was already created in Mazatrol. The program was copied and re-numbered to avoid confusion. The program was edited so that it took just one part of the program, which was to drill a 14mm hole. The part was drilled as it should have been and then moved to the next stage of the process.

ISO Program

Following the cutting program, there is a program call for measurement of the part using program P9110 from the Mazatrol program. The program is referenced for the part using the datum in G58 in Mazatrol. The program call was successful and probed the feature as it was wished for. The program next uses some simple logic statements to check the dimensions of the measured feature. The probing cycle parameters were set so that the radius of the tool would be changed to re cut the material if necessary with an updated value. At the end of the ISO program a G65 and M98 call were used to try and get back to the correct Mazatrol program and line number. Each time this occurred it alarmed out and would not go back through to the Mazatrol program. Upon later checks and research using the Mazak operator manuals, the process of calling programs in this way is described fully, but finally describes the process as 'impossible' even though the steps are laid out in detail.
Operation	System Hardware /	Working	Issue
	software		
Set up	Master ISO Program	Yes	Datum set within G58. Program 9110 can be used for
	+ M&H Probe + M&H		updating of centreline of part.
	Probing Macros		
Machine	Mazatrol Program	Yes	Machining cycle ran through in Mazatrol – Just one
			feature chosen for tests of 14mm through hole.
Check	Master ISO Program	Yes	Reversed logic statements to ensure it did not re cut part
	+ M&H Probe + M&H		when tool radius was updated as all holes were only in
	Probing Macros		roughing stage. Logic arguments successful and went
			back to re machining Mazatrol program.
Re-Machine	Mazatrol Program	Yes	Machining cycle ran through again in Mazatrol – Just one
			feature chosen for tests of 14mm through hole. Program
			then went back into ISO to recheck bore now correct size.
			#
Final Inspection	Master ISO Program	Yes	Part was not fully completed but program call worked, so
	M&H Probe + 3DFI		cycle was stopped.
	Software + M&H		
	Probing Macros		

Table 10: ISO - Mazatrol - ISO

For program to function correctly, parts would need to be broken into smaller chunks of Mazatrol and called from the Master ISO with its own ISO Probing checks for logic. This could be done in a fairly simple manner using program or unit copy in Mazatrol.



Figure 33: Flow chart

The flow chart above is representative of the table prior to this. Further explanation of such is listed below in its sequential order:

ISO Master Program

This program is used as the base for all programming and cutting of the material. It is used to call both Mazatrol and ISO Sub Programs. In this instance the first call is made for program number 96920. Assigned next to this is detail of the tool that would be updated for radius given that re machining is required following measurement. The setup of the program datum's is done from within the Mazatrol cutting program.

Mazatrol Cutting Program

The Mazatrol cutting program 96920 was a full program inserted into this for demonstration. There was an end block inserted after the first operation of a drilled hole. Due to the way the program would work, the Mazatrol programs would need to be broken down for this to work and allow updates. Where non-critical features are being machined, these can all be grouped together in one single program; such as milling the raw material to give a square and flat finish. The end of the program in Mazatrol must contain a 1to show that the program must continue. This allows for the program to then revert back into the Master ISO Program. The datum's used within the program are set from the very outset of program creation. The datum estimate is taken from use of a centre drill to take the rough centre point of the work piece. The Mazak Mazatrol routines can be used following this for datum setting and teaching into the machine. This will then be used for following operations with the line of code for transfer of work piece offsets. The initial datum setting is done with the M&H Probe and Mazatrol probing routines, which are basic and only used for finding a Z surface height and X and Y step values. This gives the height of the part in its fixture, and the dimensions of the material in the XY plane.

ISO Master Program

The next lines of command in the ISO Program call for a sub program, which is also written in ISO code. This takes the stored datum from the Mazatrol program and saves it into which ever WPC is chosen. In this instance it was moved to G54. The WPC is called up in the next line of the program, and then is followed by the tool change to bring the probe to the spindle ready for measurement.

Once the tool is loaded and ready the program moves in rapid to X0 and Y0, and then to a Z position above the work piece whilst employing tool length compensation.

The probing call is made next as an ISO sub program 9110. This line also gives the command for the action of that probing to occur such as the expected centre point of the feature, its size, what kind of feature, how it is to be measured and what to do with the information once it is recorded. The probing then is undertaken and once finished, the probe will return to the home position and then the controller will compute the logic statements.

Logic Statements

The logic statements are used to decide the 'fate' of the part through simple equation. There are three possible outcomes that can occur through the logic which are; that the part is in size and tolerance and that the part can therefore continue on the next part of the program, the part is undersized (in this instance as it was a bore measurement) and can therefore be re-machined to correct the size, or finally, it is too large and therefore the part is scrap.

Part ok – continue program

The part has been measured and is within size and tolerance. The program is therefore told to move to the next operation through the logic statements. There is not a specific logic for this, as the values will fit in between the two logic statements. If this happens then the program will carry on to the next stage of the program.

Part repairable – go back and re cut

The part has been measured and is (in this case) undersized. The program is informed that it should go back to the original cutting program and update to cut the feature to the correct size. The probe will then be called again following this for a re check. The logic for this states that if the stored measure value is less than the nominal size minus the tolerance then go back to the start of the cutting program for this feature. *Part not good* – *scrap*

If the part is measured and it is above the size and tolerance values then the program will display and alarm, which will tell the operator the issue, such as, bore too large or part too small. The part is then deemed as scrap and will need to be restarted with operator checking for possible causes or issues, such as incorrect tool used and cut too large. The logic for this states that if the stored measure value is greater than the nominal size plus the tolerance then go to the alarm screen to advise the operator that the part is outside the limits and is therefore scrap.

Mazatrol Cutting Program

This is used as the next stage for the cutting program and is the next operation of the machining process of that particular component. If this is also dimensionally critical, it will also be followed by a probing operation to measure. This program will be similar to the previous

ISO Program

The program length will be dependent upon how many operations are necessary to produce the final part overall. It will include many calls for Mazatrol programs and also for ISO sub routines such as the probing. In between the programs there will be use of logic to allow the operations to seamlessly run together.

The final operation is to call the program end

Program End

If the program has successfully run all the way through, the part should come off the machine fully finished and inspected in a correct manor. The next raw material can be loaded into the machine and the program run again.

Program details for test:

O00000029(DANS DO NOT MOVE OR DELETE)

N10 G65 P96920 H9. D9. (Line ten. Program call for Mazatrol cutting program

96920. Tool updates to take place for tool 9)

N20 G65 P4999 (Line twenty. Program call for ISO program 4999. Shifts WPC co-

ordinates from Mazatrol to G54)

N30 G54 (Line thirty. Calls WPC G54)

T30 M6 (Tool change for tool 30 - Probe)

G0 G90 X0. Y0. (Absolute programming. Rapid Move to X0 Y0)

G43 Z50. H30 (Activate Tool Length Compensation tool 30. Z height 50mm)

G65 P9110 A0. D14. F800. X27. Y-44. Z-15. R10. S11. T09 (Call ISO program 9110.

Start probing at angle 0. Diameter of 14mm. Function 800 - Update tool radius. Goto

X27 Y-44 Z-15. Safety distance of 10mm from job. Bore measure function selected.

Tool to update.)

G91 G28 Z0. (Return to home position)

N100 (Line 100)

IF[#529LT[14.-.013]]GOTO10 (Logic statement - Measured value less than nominal - tolerance go back to cut program)

IF[#529GT[14.+.500]]GOTO40 (Logic statement - Measured value greater than nominal + tolerance go to alarm) GOTO50 (Goto Line 50) N40 #3000=100 (CHECK WIDTH) N50 M30 (Line fifty - Stop Program)

The program above can be modified further so that it calls particular sub programs, possibly that of checks in Capto bores for example. The sizes could easily be selected from a list such that line 500 is C3, line 600 is C4, line 700 C5, line 800 C6 and line 900 C8. Also included in the list could be the important features such as tenons and slots.

M640M WNo.15	o (DANS 1	DO NOT	DELETE	MAIN	PROGRAM)		
UNO. MAT.	INITIAL-	Z ATC	MODE	MULTI	I MODE	MULTI	FLAG	PITCH-X
PITCH-Y								
0 CST IRN	50.	C	1		OFF	ھ		ଜ
D								
UNO, UNIT	ADD. WPC	X	7	7	7	th	7	7
C A	1122 1 112 0		-	-		011	-	
1 WPC- 0		-807	.228	-265	5.922	0.	-495	5.832
0.								
UNO. UNIT	WORK No.	\$ F	REPEAT					
2 SUB PRO	4999	(d						
		v	7	7	7	+ b	-	7
C A	ADD. WPC	Δ	7			LII	2	2
3 WPC-56	G56							
UNO. UNIT	TOOL	NOM-Ø	No.					
4 MANU PRO	D T.SENS.	6. A						
SNo.G1 G2 I	DATA 1	data 2	DA'	ta 3	DATA 4	1 DAT	A 5	DATA 6
S M/B		0						
1 0 X	0. Y	0.						
Z U Z	0.							
UNO, UNIT	WORK No.	ŚF	REPEAT					
5 SUB PRO	5002	Ø						
UNO. UNIT CO	DNTI.NUMBI	ER ATC	Х		Y		Z	С
A								
6 END	0 0	0	-1050	•	0.		0.	
106.411								

Figure 34: Mazatrol program screen capture

7.2.2 Development of Systems – Renishaw

The Renishaw probe is set up as in the implementation guide for calibration using a ring gauge. The Renishaw AE PRO software is used to create the ISO programs for the calibration of the probe. In a slightly different way to the M&H probe, the Renishaw ISO programs do not have to reside on the controller permanently. Each time a measurement program is created in AE PRO, the relevant G-code can be output. Similarly to the M&H having a program 5000, the Renishaw uses program 2000.

A test part was set up and created within AutoDesk Inventor software to match. The model is converted for import in to the Renishaw software and a program made. The program was run several times with parameters changed in the software on a number of occasions so that a bore could be opened up gradually to its required size. Each step still however had to conform within tolerance for cut and re-cut. Some of the results are presented below in a table for size measured using the probe, CMM and manually and are compared for differences in error. The first table is with the bore of the part cut to 63.5mm. The part was measured both manually and with the probe following cutting. The difference in size for the bore between measurements is 4 microns and the measurement for position in X and Y is different by 3 microns and 9 microns respectively. All measurements are within the tolerances permitted.

Following on from this check the part was then re-cut to a new size of 63.75mm. In a similar manner, the measurements were taken and recorded with comparison this time made between the three different methods. All results again fall within the tolerances and differ slightly between the three different methods. The results of the test are shown in **Table 12 - 15** and **Figures 35 - 38**.

The effects of temperature could have a large impact upon the measurements taken and may reduce or increase the differences dependent upon location. This however is beyond the extent for the project.

The measurement results were also added to the SPC software to monitor and track the process for all remaining components of the batch.

Additional benefits were gained through the use of the probing system, which were not accounted for during the initial plans. The software allowed for a rotary axis to be updated for angular error, and as such, a program written to reside in each machine tool controller for set up of jobs. The previous method for setting involved using a dial gauge and operator skills and knowledge. The method using the probing system takes a matter of seconds to complete, whereas the manual method would take up to ten minutes. The financial benefits of this alone are substantial.

Through experimentation it was decided that a tool probe would make for a valuable investment as only tool length was measured previously on a Mazak plunger. The Renishaw tool-setting probe also provides measurement information and can be linked directly with measurement programs created in AE PRO. With accurate tool data, less iteration are required for re-cutting of material. G-code can be placed within the program to ensure that only a certain number of re-cuts are made to stop the probing being stuck in a continuous closed loop. The levels of percentage feedback can be adjusted within the software, and are useful for learning and understanding until confidence is gained. These feedback levels changed significantly over the period of time testing so that there would be more trust placed in the system to go back and re-cut accurately first time.

During the set-up and training period, discovery was made of a conflict in variable numbers used by the probe and an ISO program used for engraving parts on the machine. Both were sharing the numbers 500 to 503 and losing calibration values. This issue flagged a question of whether or not the previous test work conducted with the M&H probe would have been affected significantly or not.

With this corrected there is assurance that the probe will hold its calibrated value. A decision was made that, in the same way as running BallBar tests, the frequency of the probe calibration should be increased to ensure that parts are produced to the best possible accuracies.

7.2.3 Gauge R&R Data

Assessment of the Gauge R&R of the measurement system on the machine tool is a probing system implemented on a machine tool with a numerical controller. The effect of the operator using the system is negligible as they are essentially pressing the green button to start a cycle.

The stated repeatability of the probe unit from the supplier is 1 μ m. However, the influence of the non-repeatability of the machine must also be evaluated since this forms an integral part of the measurement system.

The ring gauge used for this study has a certified, calibrated dimension of 69.995 mm with $\pm 1 \ \mu m$ accuracy.

The company gains confidence in the use of the system through regular testing and calibration such as that demonstrated in the table below:

Test Number	Dimension	Difference
1	69.997	+0.002
2	69.995	0.000
3	69.995	0.000
4	69.996	+0.001
5	69.995	0.000
6	69.994	-0.001
7	69.995	0.000
8	69.997	+0.002
9	69.995	0.000
10	69.994	-0.001
11	69.993	-0.002
12	69.995	0.000
13	69.997	+0.002
14	69.998	+0.003
15	69.996	+0.001

Table 11 - Gauge R&R test results

The resolution of reporting of the probing results is 1 μ m.

It can be seen in the table that the probe is repeating with $\pm 3 \mu m$. Further analysis shows that the mean deviation is 0.4 μm and two standard deviations equates to 3 μm . This is sufficient for the capabilities of the machine and what would be expected for the general working volume. Tolerances of parts produced are generally around the 20 Micron level, however some are tighter still and can be around 10 Microns. The level off accuracy will become more prominent in years to come as the size of cutting tools increases. The test bars used when measuring a part for its centre height will be much longer and therefore any error gets amplified further.

A calibrated, certified ring gauge was used for the testing of the probe. A standard cycle can be created within the Renishaw AE Pro Software for calibration of the probe. This takes 12 measurements within the internal bore diameter to work out the true size. This is compared to the size of the ring gauge that is already known.

A measurement can be taken also using the Mazatrol software which calibrates for X and Y axis and gives a size of the bore. As this is only 4 points however, it is nowhere near as accurate as the measurement taken using the 12 point test due to it being a best fit macro.

The size of the ring gauge used is very similar to that of the measurements shown in the tables representing tests made to compare the difference between the on-machine probe, manual inspection and CMM inspection. With this in mind it is useful to know that the working volumes of the machine tool are taken in to account for calibration, and coincide with that of the BallBar tests.

7.3 Probing of the Part – Test Results

	Bore	Diameter	Difference	In	Х	In	Y	In
	Size			Tolerance?	Centre	Tolerance?	Centre	Tolerance?
Probe	63.5	63.506	0.006	Yes	-0.001	Yes	-0.007	Yes
Manual	63.5	63.509	0.009	Yes	-0.004	Yes	-0.016	Yes
Difference	N/A	0.003	0.003		-0.003		-0.009	
СММ	N/A	N/A	N/A		N/A		N/A	

Table 12: 63.5mm bore comparison

	Bore	Diameter	Difference	In	X	In	Υ	In
	Size			Tolerance?	Centre	Tolerance?	Centre	Tolerance?
Probe	63.75	63.764	0.014	Yes	-0.006	Yes	0.001	Yes
Manual	63.75	63.753	0.003	Yes	-0.005	Yes	-0.004	Yes
Difference	N/A	0.011	0.011		-0.001		-0.005	

Table 13: 63.75mm bore comparisons

	Bore	Diameter	Difference	In	Х	In	Y	In
	Size			Tolerance?	Centre	Tolerance?	Centre	Tolerance?
Probe	63.75	63.764	0.014	Yes	-0.006	Yes	0.001	Yes
СММ	63.75	63.758	0.008	Yes	-0.014	Yes	-0.002	Yes
Difference	N/A	0.006	0.006		-0.008		-0.003	

 Table 14: 63.75mm bore comparisons

	Bore	Diameter	Difference	In	X	In	Y	In
	Size			Tolerance?	Centre	Tolerance?	Centre	Tolerance?
Manual	63.75	63.753	0.003	Yes	-0.005	Yes	-0.004	Yes
СММ	63.75	63.758	0.005	Yes	-0.014	Yes	-0.002	Yes
Difference	N/A	0.005	0.005		-0.009		-0.002	

 Table 15: 63.75mm bore comparisons



Figure 35: Measurement comparisons graph

		ZEISS	Calypso		75155
Measure craftsm	ment Plan an3	Date February 17	7, 2011		ZEISS
Drawing * drawin	No. ngno *	Time 12:36:26 pr	Order n * orde	er *	
Operator Master		CMM C32Bit	Incren 7	nental Part Numb	ər
	Actual	Nominal	Upper Tol. L	ower Tol.	Deviation
-	Bearing Diameter@Z-2	22			-0.0918
	63.7582	64.0000	0.1500	-0.1500	-0.2418
	Roundness Bearing Di	iameter			0.0056
\bigcirc	0.0156	0.0000	0.0100		0.0156
1.0	X Value_Location Pin				-1
	-0.0015	0.0000	0.0500	-0.0500	-0.0015
	Z Value Location Pin				l-
5	-36.9930	-37.0000	0.1500	-0.1500	0.0070
-	Diameter_location pin				-
P	19.9979	20.0000	0.1000	-0.1000	-0.0021
	Roundness Location P	Pin			
\bigcirc	0.0053	0.0000	0.0100		0.0053
	X Value_Circle2				I-
	-56.9942	-57.0000	0.1500	-0.1500	0.0058
	Z Value_Circle2				-
	-36.9950	-37.0000	0.1500	-0.1500	0.0050
~	Diameter_Circle2				-1
	17.9793	18.0000	0.1000	-0.1000	-0.0207
	X Value_Circle3]-
	57.0093	57.0000	0.1500	-0.1500	0.0093

Figure 36: CMM Report

Plan Nam craftsma	ne Operator an3 Master		Time 12:36:26 p	Date om February	Date February 17, 2011		
	Actual	Nominal	Upper Tol.	Lower Tol.	Deviation		
	Z Value_Circle3 -37.0039	-37.0000	0.1500) -0.1500	-l -0.0039		
ø	Diameter_Circle3 17.9763	18.0000	0.1000	0 -0.1000	-l -0.0237		
	Perpendicularity1 0.0020	0.0000	0.0100)	l- 0.0020		
	Y Value_Plane2 -79.9865	-80.0000	0.1500) -0.1500	l- 0.0135		

Figure 37: CMM Report



Figure 38: CMM Report

7.4 Batch Inspection Results

CRAI	FTSMAN LS					Side (Pool) Otley West LS21 +44 (Copse Road Yorkshire 1JE)) 1943 466 788
		www.crafts	mantools.com				
Productivity+ Inspection Report PASSED		Part Number: Machine Type: Machine ID:	TLH6 Mazak N Ne	TLH6067B-01 Mazak Nexus 510 CII Nexus 2		Craftsman Tools Ltd 89397-1 07/11/2011 Metric	
Feature	Nominal	Actual	Deviation	Lower Tolerance	Upper Tolerance	In Tolerance?	Pass/Fail
DATE	20110202.0000						
TIME	144442.0000						
CAPTO BORE 40MM							
CENTRE X	-61.0000	-60.9905	0.0095	-0.0200	0.0200	YES	PASS
CENTRE Y	0.0000	-0.0013	-0.0013	-0.0100	0.0100	YES	PASS
CENTRE Z	0.0000	0.0000	0.0000				
DIAMETER	40.0000	40.0115	0.0115	0.0000	0.0250	YES	PASS
TOOL DIAMETER							
VALUE	0.0052						
TOOLOFFSETID	4.0000						,
TOOLOFFSETREGISTER	3.0000						
CAPTO BORE DIAMETER							
MACHINEVARIABLE	102.0000						
VALUE	40.0115						
COMPONENTEND		-					

Figure 39: Component inspection report

CRAI	CRAFTSMAN TOOLS							
		www.crafts	mantools.com					
Productivity+ Inspection Report PASSED		Part Number: Machine Type: Machine ID:	TLH Mazak N N	TLH6067B-01 Mazak Nexus 510 CII Nexus 2		Craftsman 893 03/03 Me	Craftsman Tools Ltd 89397-2 03/03/2011 Metric	
Feature	Nominal	Actual	Deviation	Lower Tolerance	Upper Tolerance	In Tolerance?	Pass/Fail	
DATE	20110202.0000	-		-				
DATE	20110302.0000	-		-	-			
TIME	155755.0000	-					-	
CAPTO BORE 40MM								
CENTRE X	-61.0000	-60.9872	0.0128	-0.0200	0.0200	YES	PASS	
CENTRE Y	0.0000	-0.0090	-0.0090	-0.0100	0.0100	YES	PASS	
CENTRE Z	0.0000	0.0000	0.0000					
DIAMETER	40.0000	40.0045	0.0045	0.0000	0.0250	YES	PASS	
TOOL DIAMETER	2			-	·			
VALUE	0.0020							
TOOLOFFSETID	4.0000							
TOOLOFFSETREGISTER	3.0000							
CAPTO BORE DIAMETER								
MACHINEVARIABLE	102.0000	-		-				
VALUE	40.0045							
COMPONENTEND					-			

Figure 40: Component inspection report

CRAI TOO	FTSMAN LS					Side C Pool F Otley West LS21 +44 (0	iopse Ioad Yorkshire IJE) 1943 466 788
Productivity+ Inspection Report PASSED		www.crafts Part Number: Machine Type: Machine ID:	mantools.com TLH60678-01 Mazak Nexus 510 CII Nexus 2		Name: Sample ID: Date:	Craftsman 8939 03/03/	Tools Ltd 7-3 2011
Feature	Nominal	Actual	Deviation	Lower Tolerance	Units: Upper Tolerance	In Tolerance?	Pass/Fail
DATE	20110302.0000	-					
TIME	165959.0000						
CAPTO BORE 40MM					-		
CENTRE X	-61.0000	-60.9877	0.0123	-0.0200	0.0200	YES	PASS
CENTRE Y	0.0000	-0.0040	-0.0040	-0.0100	0.0100	YES	PASS
CENTRE Z	0.0000	0.0000	0.0000		9		
DIAMETER	40.0000	40.0210	0.0210	0.0000	0.0250	YES	PASS
TOOL DIAMETER							
VALUE	0.0094						
TOOLOFFSETID	4.0000						
TOOLOFFSETREGISTER	3.0000						
CAPTO BORE DIAMETER							
MACHINEVARIABLE	102.0000						
VALUE	40.0210						
COMPONENTEND					-		

Figure 41: Component inspection report

CRA TOO	Side Pool Otley West LS21 +44 (Side Copse Pool Road Otley West Yorkshire LS21 1JE +44 (0) 1943 466 788					
			007070900000000				_
		www.cratts	mantools.com]
Productivity+		Part Number:	TLH6067B-01		Name:	Craftsman Tools Ltd	
Inspection Report		Machine Type:	Mazak Nexus 510 Cli		Sample ID:	89397-4	
PASSED		Machine ID:	Nexus 2		Units: Metric		tric
Feature	Nominal	Actual	Deviation	Lower Tolerance	Upper Tolerance	In Tolerance?	Pass/Fail
DATE	20110302.0000						
TIME	140746.0000			-			
CAPTO BORE 40MM							7
CENTRE X	-61.0000	-60.9815	0.0185	-0.0200	0.0200	YES	PASS
CENTRE Y	0.0000	-0.0093	-0.0093	-0.0100	0.0100	YES	PASS
CENTRE Z	0.0000	0.0000	0.0000			202	
DIAMETER	40.0000	40.0215	0.0215	0.0000	0.0250	YES	PASS
TOOL DIAMETER							
VALUE	0.0097						
TOOLOFFSETID	4.0000						
TOOLOFFSETREGISTER	3.0000						
CARTO PORE DIAMETER		-		-			
CAPTO BORE DIAMETER	102 0000	-		-			
VALUE	40.0215	-		-			
TALUL .	40.0215						
COMPONENTEND							

Figure 42: Component inspection report





The above Inspection reports and SPC graph **Figures 39 - 43** are representative of a batch of parts going through the factory during testing. It can be seen within the SPC graph that all parts were manufactured within the tolerance band for the size of Capto bore. As this is only represent a batch of four parts, the change in the graph looks dramatic for the difference in sizes produced. Similarly, graphs can be produced for the centre line values and the centre height values for the bore. Using the graph shown above, sampling for manual inspection can be picked out at random, or those parts that do not meet the requirements or suffer considerable deviation from the mean.

7.5 Inspection Reports

A great deal of work went in to getting an inspection report template that would be suitable for use. It was decided that there could be two versions produced; one for the customer and one for the inspections department. The decision for this was due to the fact customers only needed to know a part was good, and would not be interested in the full dimensional report. This information however is important for the inspection department.

As the project progressed, the requirement for an inspection report became less of a priority.

A number of templates were produced in both the Renishaw and M&H software, with the latter being preferred due to its colourful graphical nature and ease of manipulation of design. The Renishaw report template is very rigid with a limited amount of design change available. This was a factor that became apparent when studying the reports to see where improvements could be made, and suggestion of separate reports made due to information being included that was irrelevant, but could not be removed, and would leave a customer confused and thinking they have received a part that is no good.

Examples of the reports are included in the appendix.

7.6 Production Data

The cycle times have been cut down considerably due to the use of probing when setting up a job. The indexing facility can be set so that it is square. This has also been checked in a similar way to the Gauge R&R.

The use of this function takes away the manual intervention of an operator using dial gauges. The time saving brought about however is very impressive. A study of the operators concluded that the manual set-up could take anywhere between five and ten minutes, mainly due to the skill levels. Using the probing cycle took just 5 seconds for measurement and correction.

Cutting times of parts were also reduced using standardisation of the tooling as addressed by the productivity pyramid. All operators were using the machines at the correct speeds and feed rates for the materials and cutting tools being used. This is also shown within the results.

Probing of the parts for measurement of sizes would on average take around one to two minutes. Parts removed from the machines for manual inspection could take around ten to fifteen minutes if the inspector is available straight away. To this you are also inherently adding a level of uncertainty due to removal and re-installation of the part in to the machine.

Using both methods allows for modification of the part following measurement. For a first off part this process could be completed manually two to three times to ensure the program is corrected correctly. This program modification is done manually. For a first off part the assumption could be made that both systems require two checks of the part to update the program sufficiently for the next part to be cut correctly.

Following parts would be sample checked from the batch to ensure they are correct. This again would be around ten to fifteen minutes for the check dependant upon availability of the inspector. All parts could be inspected on machine using the probing system with the cycle time being around one minute for this. The gains in cycle time are vast using the on machine measuring systems. Confidence in the systems improves the more it is used, as the operators begin to understand what is happening during the process and why the process is actually happening.

A table is presented below for part A, B, C etc. Each first off part of specific batches are measured and recorded below:

Part Number	Manual	Variance	Probing	Variance
Part A	15 minutes	1-2 hours	2 minutes	2-3 minutes
Part B	30-60 minutes	2-3 hours	2-3 minutes	4-5 minutes
Part C	14 minutes	1-2 hours	2 minutes	2-3 minutes
Part D	11 minutes	1-2 hours	1.5 minutes	2 minutes
Part E	10 minutes	1-2 hours	1 minute	1-2 minutes
Part F	13 minutes	1-2 hours	2 minutes	2-3 minutes
Part G	11 minutes	1-2 hours	1.5 minutes	2 minutes
Part H	10 minutes	1-2 hours	1 minute	1-2 minutes
Part I	14 minutes	1-2 hours	2 minutes	2-3 minutes
Part J	12 minutes	1-2 hours	1.5 minutes	2 minutes
Part K	30-60 minutes	2-3 hours	3-4 minutes	5 minutes

Table 16: Production data

It can be seen from the table that certain parts can be difficult to measure manually. This could be due to sizes and weights or complexities of geometry. In such instances, these parts would likely be taken to a CMM for measurement. This invariably led to the length of time seen for measurement and the variances involved with queuing.

Graph showing production data results from the table for cycle times of manual and on-machine measurement:



Measurement Times of Parts using On-Machine Probing and Manual Measurement

Figure 44: Production data comparison graph

7.7 BallBar testing and results

During the early stages of the probing tests, large errors were being reported in the Yaxis direction of the parts, however when a manual inspection was completed, the parts would be to size and tolerance. This instigated a requirement for the need to run a BallBar test on the machine. The errors being reported were not accounted for during manual offset updates within the program for cutting the parts, allowing the error to be seen and acted upon. A service engineer was scheduled to re-align the machine following the test.

The history results of one of the machines are shown below. The machine was subjected to a large crash, which saw a probe moved at rapid feed rate in to the work piece as if it were a cutting tool. The whole probe was obliterated and the large piece of material moved in the vice **Figures 45 & 46**.



Figure 45: Smashed Probe following an accident on machine



Figure 46: Smashed Probe following an accident on machine

An initial Ball Bar test was used to check for any damage to the machine, and the subsequently, a machine re-alignment was scheduled and can be seen in the history graphs for improvement **Figures 47 - 49**. The images below show the machine history for a period between July 2010 and February 2011 in the XY plane **Figures 50 - 52**.

It can be seen that following the initial BallBar test, an error was found and acted upon. The machine was re-tested following the re-alignment and can be seen through a great improvement in the circularity. As expected, the machine deteriorates over time with the test in February showing a slight deterioration in the circularity.



Figure 47: Ballbar test results



Figure 48: Ballbar test results



Figure 49: Ballbar test results



Figure 50: Ballbar test results



Figure 51: Ballbar test results



Figure 52: Ballbar test results

7.8 Summary

Testing of the probing systems gave rise to many issues with compatibility of programming languages. The company uses the Mazatrol conversational programming language, which is installed on the machine tool controllers allowing all operators to create programs with ease of use. The ISO programming language and Mazatrol, however, are not fully coherent with each other and will cause conflict if not used in a certain way. The user manuals for the machines give detailed descriptions of how to perform this kind of function, only to be followed by a statement saying that these operations cannot actually be performed, which questions why it is included.

Through implementation of processes and systems, the company has a system in which parts can be manufactured and inspected on the same machine with the confidence that the quality of the part will be correct, and produced in a more cost effective manner. The technology has provided some unexpected benefits such as drastic reduction in set-up time of parts in an indexer fixture. The time saved using this method alone will provide a significant cost saving to the company.

A plan for the use of a BallBar within the company has been suggested and is being considered for purchase. The use of the BallBar through the university proved very beneficial and helped strengthen the case for the requirement of equipment.

The process pyramid is used and updated on a daily basis and must be thought of as a continual development. Each input will affect another outcome and must be directly put back in to refine processes further.

Chapter 8 – Conclusions and Further Work

8.1 Introduction

The previous chapters have shown the research undertaken to achieve the aims and objectives of the project, which were to implement a semi automatic quality control system and evaluate the costs and benefits of doing so. In this chapter, a brief summary of the achievements is made and the savings brought about through the work and realised in the company.

8.2 Conclusions

At the start of the project, a manufacturing cell and range of parts were chosen to use as a case study for manufacturing processes. The weaknesses were identified following process audits. Lead times for delivery of parts required reduction, predominantly caused by idle spindles and machine downtime. The latter adversely affects the quality of the parts produced.

A great deal of responsibility and trust was placed with the operators for getting the parts "right first time" and required a solid knowledge of the machining processes to manually adjust offsets and make corrections in the part programs to ensure each component is manufactured correctly.

The inspection of parts at any stage of manufacture added a significant risk of errors occurring, due to parts being removed from the machine and then re-set. This stage also adds time to the process and can be slowed further if there is no availability or queuing at the quality control department.

A process pyramid approach was adopted to better understand the requirements for consistent manufacture of parts.

A regular BallBar system is used for measurement of the machines fitness for purpose, and is run independently or reactively.

The probing systems on the machines are run both in-cycle and also for final inspection of parts and are validated against manual and CMM inspection.

A great amount of cost saving has been made through use of technology, systems and processes even within an SME producing small batches of components, which are usually between 1 off and 10 off.

Indirect savings, as well as direct, have been made through extra use of the equipment, which was not in the first instance considered.

From the work undertaken it was apparent that the use of technology-based systems in a small batch environment producing a wide variety of different parts could be very difficult to achieve results.

The results however show that successes can be made with technical complex projects.

The change management process is most difficult in a company that has many operators set in their ways after doing the job for so long. Once the benefits are shown and explained, the new systems are warmly received and utilised. The amount of parts produced affects the level of bonus the operators receive, so it was pitched to them in such a manner that it would help them to achieve more production, and ultimately earn them more money.

The machine tool is a complex structure with many forms of error that can be induced amongst the many mechanical components and systems. The capability of these is important, and when benchmarked can be monitored and evaluated sufficiently to ensure the machine is capable of producing parts accurately and repeatedly. There are many tools available for monitoring the health of machines and alerting a user to a potential requirement for further investigation or servicing. This equipment is relatively cheap when compared with the overall downtime of machines and falls within a planned preventative maintenance system instead of the usual reactive maintenance that many are used to.

Study of fundamental elements of the whole machining process allow for determination of every step, with each as important as the last, and fitting into a pyramid of process stages allows for investigation into potential causes of future errors, or alternatively where error has occurred, can be traced back through a root cause analysis.

With the stability of the machine determined and understood, it can be used for the measurement of parts as well as cutting them, safe in the knowledge that they will not be cutting inaccurately and measuring in the same way.

It is only when the machines are producing parts in a semi autonomous way that the realisation of the benefits can be seen against the initial set up costs. Savings can be made not only through part measurement but also for the set up of the machines in the first instance.

The in process inspection provides the operator with less work at the machine and allows for other tasks to be completed during the cycle time. This ultimately improves production outside of the machine also.

Whilst being machined the part is now inspected for size and tolerance and re machined where necessary. The parts come away for the machine right first time and avoid the need for removal and manual inspection, which can bring further error. With the machining cycle completed, parts are removed and a print out of the inspection report can be made. The data is also added to the SPC software for process monitoring.

The accuracy of the probe against measurements made manually and with a CMM are proven to be within +/- 10 microns of each other. A small level of deviation is to be expected due to temperature changes and fixturing. The confidence in parts being produced correctly within tolerance is increasing as the system is used more frequently.

8.3 Cost savings brought about from the system

8.3.1 Direct Savings

A yearly figure of around £27k will be realised through time saved from automation. It will allow for extra machining capacity across the machines with savings being made from the removal of intermediate inspection processes, which are undertaken away from the machine. During the 'lights out' overnight period the expected additional capacity will return an extra £25k. Initially this will be restricted until fixturing can be reviewed to provide extra capacity for manufacture of the components.

Turnover within the cell will increase by 20% for a value of 250k per year and is attributable to the overall perception of improved quality, and most importantly, reduced lead times as customers do not want to wait or be delayed.

8.3.2 Indirect savings

The system also proved useful for set ups of jobs, such that an indexing fixture could be set in around 10 seconds compared to the average 5 - 10 minutes it took operators

to do manually with a dial gauge. The time it took the operator would depend on their experience and level of skill.

From the improved set up the savings to be made are approx 20k per year.

8.3.3 Maintenance costs

Introduction of a BallBar system in the company for just the four Nexus milling machines will save the company between $\pounds 11.5k - \pounds 14.5k$ per year in machine downtime, and excludes any production that would have taken place during this time. If the equipment is utilized across all machines, this saving will be significantly higher. With use on 20 machines, the figure could easily be at around the $\pounds 60k$ mark per year plus lost production.

8.4 Further Work

An understanding of the machine tool was made for its errors and how they affect the production of the finished parts. A system has been implemented for monitoring the health and condition of the machines, however, further future work could be undertaken to study the effects more closely on areas such as the thermal influences within the factory.

With the research proving successful in the first cell of the factory, there are plans for further implementation factory wide. This will also include new machinery being purchased for the initial cell to help cope with increased demand and capacity issues. Due to the Productivity Pyramid, there will always be change, which will affect the practices of the operators in the strife for continual improvement.

Chapter 9 – References

[1] Goodfellow, S., 1999, Introduction of a universal maintenance strategy into Micro Metalsmiths LTD (machine shop), MSc in Engineering and Metrology

[2] Renishaw QC20W BallBar brochure

[3] Poxton, A., Longstaff, A. P., Barrans, S., Myers, A., Fletcher, S., Pislaru, C., 2008, Simulation of the Structural Elements of a Three Axis VMC for Machine Tool Error Compensation, Proceedings of Computing and Engineering Annual Researchers Conference 2008: CEARC'08. University of Huddersfield, p. 23-27

[4] Okafor, A. C., Ertekin, Y. M., 2000, Derivation of machine tool error models and error compensation procedure for three axes vertical machining centre using rigid body kinematics, International journal of machine tools & manufacture 40 (8), p. 1199-1213

[5] Ramesh, R., Mannan, M. A., Poo, A. N., 2000, Error compensation in machine tools - a review Part I: geometric, cutting-force induced and fixture-dependent errors, International journal of machine tools & manufacture 40 (9), p. 1235-1256

[6] Barman, S., Sen, R., 2010, Enhancement of accuracy of multi-axis machine tools through error measurement and compensation of errors using laser interferometry technique, MAPAN: journal of Metrology Society of India 25 (2), p. 79-87

[7] Postlethwaite, S. R., Allen, J. P., Ford, D. G., 1999, Machine Tool Thermal Error Reduction – an appraisal, Proceedings of the Institution of Mechanical Engineers. Part B, Journal of engineering manufacture 213 (1), p. 1-9

[8] Wang, C., 2008, Machine Tool Calibration: Standards and Methods, American Machinist, p. 56-58

[9] Willoughby, P., Verma, M., Longstaff, A. P., Fletcher, S., 2010, A Holistic Approach to Quantifying and Controlling the Accuracy, Performance and Availability of Machine Tools, Proceedings of the 36th International MATADOR Conference, p. 313-316

[10] Munzinger, C., Fleischer, J., Broos, A., Hennrich, H., Wieser, J., Ochs, A.,Schopp, M., 2009, Development and implementation of smart maintenance activities for machine tools, CIRP journal of manufacturing science and technology 1 (4), p.237-246

[11] Bates, C., 2007, the software side of probing, American Machinist 151 (4), p. 34-38

[12] Wang, C., Thomas, B., 1997, Predictive maintenance and machine tool calibration techniques, Modern Machine Shop 69 (11), p. 102-107

[13] Renishaw Axiset literature

[14]Erkan, T., Rene Mayer, J.R., Dupont, Y., 2011, Volumetric distortion assessment of a five-axis machine by probing a 3D reconfigurable uncalibrated master ball artefact, Precision engineering 35 (1), p. 116-125

[15] Renishaw white paper IM 110, Survival of the fittest – the process control imperative

[16] Saunders, M., 2006, Process Development: Building the Pyramid, Metalworking Production, p. 34-35

[17] Wu, Z., Jiao, J., 2008, A control chart for monitoring process mean based on attribute inspection, International journal of production research 46 (15), p. 4331-4347

[18] Weckenmann, A., Estler, T., Peggs, G., McMurty, D., 2004, Probing Systems in Dimensional Metrology, CIRP Annals 53 (2), p. 657-684

[19] Davis, T. A., Carlson, S., Red, W. E., Jenson, C. G., Sipfle, K., 2005, Flexible inprocess inspection through direct control, measurement: journal of the International Measurement Confederation 39 (1), p. 57-72

[20] Kim, K. D., Chung, S. C., 2001, Synthesis of the measurement system on the machine tool, International journal of production research 39 (11), p. 2475-2497
[21] Choi, J. P., Min, B. K., Lee, S. J., 2004, Reduction of machining errors of a three-axis machine tool by on-machine measurement and error compensation system, Journal of materials processing technology 155-156, p. 2056-2064

[22] Annonymous, May 2005, Release the potential of your machine tool, Modern Machine Shop 77 (12), p. 5-8

[23] Arrigo, L., 2005, Q&A: Probing for Machine Accuracy, Product design & development 60 (4), p. 18

[24] Annonymous, 2006, Machine Tool Probing Provides Prescription for Scrap Rates, Quality 45 (1), p. 70-76

[25] Tseng, T., Kwon, Y., Ertekin, Y., Chung, W., Jiang, F., 2005, Modeling and Analysis between In-Process CNC Touch Probe Gauging and Post-Process CMM Inspection, IIE Annual Conference Proceedings, p. 1-6. [26] Choi, J. P., Min, B. K., Lee, S. J., 2004, Reduction of machining errors of a three-axis machine tool by on-machine measurement and error compensation system, Journal of materials processing technology 155-156, p. 2056-2064

[27] Koc, T., Bozdag, E., 2009, The impact of AMT practices on firm performance in manufacturing SMEs, Robotics and computer-integrated manufacturing 25 (2), p. 303-313

[28] Albert, M., Oct 2007, RAMTIC system still ticking, Modern Machine Shop 80(5), p. 84-89

[29] Mazak UK Website (2011) FMS Systems

http://www.mazak.eu/jkcm/default.aspx?pg=84 Last accessed Oct. 2011

[30]Xu, X. W., Newman, S. T., 2005, Making CNC machine tools more open,

interoperable and intelligent-a review of the technologies, Computers in industry 57 (2), p. 141-152

[31] Raffaldi, J., Shakarji, C. M., 2004, Managing CMM Software Uncertainties, Quality 43 (3), p. 48-51

[32] Renishaw Website - Various Pages Last accessed Oct. 2011

[33] Jywe, W., Liu, C. H., Lin, B. J., Hsu, T. H., 2006, The development of a triple ball bar system for calibration of CNC machine tools, Proceedings of the Institution of Mechanical Engineers. Part B, Journal of engineering manufacture 220 (b5), p. 759-766

[34] Kwon, H. D., Burdekin, M., 1998, Measurement and diagnostics of machine tool errors during circular contouring motions, Proceedings of the Institution of Mechanical Engineers. Part B, Journal of engineering manufacture 212 (5), p. 343-356

[35 - 52] See Appendix

Chapter 10 – Appendices

10.1 ISO Programs

(ISO Master Program)

(Set G54 for base in vice)

N10 T30 M6 (Tool change for tool 30 – probe) N20 G0 G90 X0 Y0 (Absolute programming. Rapid Move to X0 Y0) N30 G43 Z50 H30 (Activate Tool Length Compensation tool 30. Z height 50mm)

N5 #114= ***.*** (ENTER BORE DIA/WEB/TENON/SLOT SIZE) N25 #115= ***.*** (ENTER X DIMENSION) N45 #116= ***.*** (ENTER Y DIMENSION) N65 #117= ***.*** (ENTER Z DIMENSION)

N15 IF[#114NE#0]GOTO35 (Check a value has been entered for D) #3000=200 (SIZE/DIA MISSING) N35 IF[#115NE#0]GOTO55 (Check a value has been entered for X) #3000=201 (X DIM MISSING) N55 IF[#116NE#0]GOTO75 (Check a value has been entered for Y) #3000=202 (Y DIM MISSING) N75 IF[#117NE#0]GOTO95 (Check a value has been entered for Z) #3000=203 (Z DIM MISSING) N95

N40 G65 P9110 A0 D#114 F1 X#115 Y#116 Z#117R10 S3
(Call ISO program 9110. Start probing at angle 0. Diameter of ***.**mm.
Function 1 – Update G54. Goto X***.** Y***.** Z***.***. Safety distance of 10mm from job. Slot / web measure function selected).
N50 G65 P9110 A90 D#114 F1 X#115Y#116 Z#117R10 S3
(Call ISO program 9110. Start probing at angle 90. Diameter of ***.**mm.
Function 1 – Update G54. Goto X***.** Y***.** Z***.***. Safety distance of 10mm from job. Slot / web measure function selected).
N60 G65 P9112 F1 X#115 Y#116 Z#117 R10 S4
(Call ISO program 9112. Function 1 – Update G54. Goto X***.*** Y***.***
Z***.***. Safety distance of 10mm from job. Z height measure function selected).
N70 G91 G28 Z0 (Return to home position)

N80 G65 MAZATROL PROGRAM using G54 for WPC Base in Vice

(Set G54 for base in table fixture) N100 T30 M6 (Tool change for tool 30 – probe) N110 G0 G90 X0 Y0 (Absolute programming. Rapid Move to X0 Y0) N120 G43 Z50 H30 (Activate Tool Length Compensation tool 30. Z height 50mm)

```
N5 #114= ***.*** (ENTER BORE DIA/WEB/TENON/SLOT SIZE)
N25 #115= ***.*** (ENTER X DIMENSION)
N45 #116= ***.*** (ENTER Y DIMENSION)
N65 #117= ***.*** (ENTER Z DIMENSION)
```

N15 IF[#114NE#0]GOTO35 (Check a value has been entered for D)
#3000=200 (SIZE/DIA MISSING)
N35 IF[#115NE#0]GOTO55 (Check a value has been entered for X)
#3000=201 (X DIM MISSING)
N55 IF[#116NE#0]GOTO75 (Check a value has been entered for Y)
#3000=202 (Y DIM MISSING)
N75 IF[#117NE#0]GOTO95 (Check a value has been entered for Z)
#3000=203 (Z DIM MISSING)
N95

N130 G65 P9110 A0 D#114 F1 X#115Y#116 Z#117 R10 S3 (Call ISO program 9110. Start probing at angle 0. Diameter of ***.**mm. Function 1 – Update G54. Goto X***.*** Y***.*** Z***.***. Safety distance of 10mm from job. Slot / web measure function selected). N140 G65 P9110 A90 D#114F1 X#115 Y#116 Z#117 R10 S3 (Call ISO program 9110. Start probing at angle 90. Diameter of ***.***mm. Function 1 – Update G54. Goto X***.*** Y***.*** Z***.***. Safety distance of 10mm from job. Slot / web measure function selected). N150 G65 P9112 F1 X#115 Y#116 Z#117R10 S4 (Call ISO program 9112. Function 1 – Update G54. Goto X***.*** Y***.*** Z***.***. Safety distance of 10mm from job. Z height measure function selected). N160 G91 G28 Z0 (Return to home position)

N170 G65 MAZATROL PROGRAM using G54 for WPC Base in table fixture

(Set G54 for base in indexer)

N200 T30 M6 (Tool change for tool 30 – probe) N210 G0 G90 X0 Y0 (Absolute programming. Rapid Move to X0 Y0) N220 G43 Z50 H30 (Activate Tool Length Compensation tool 30. Z height 50mm)

N25 #115= ***.*** (ENTER X DIMENSION) N45 #116= ***.*** (ENTER Y DIMENSION) N65 #117= ***.*** (ENTER Z DIMENSION)

N35 IF[#115NE#0]GOTO55 (Check a value has been entered for X) #3000=201 (X DIM MISSING) N55 IF[#116NE#0]GOTO75 (Check a value has been entered for Y) #3000=202 (Y DIM MISSING) N75 IF[#117NE#0]GOTO95 (Check a value has been entered for Z) #3000=203 (Z DIM MISSING) N95

N230 G65 P9112 A0 D10. F1 X#115 Y#116 Z#117 R10 S1 (Call ISO program 9112. Function 1 – Update G54. Goto X***.*** Y***.*** Z***.***. Safety distance of 10mm from job. X position measure function selected). N5 #114= ***.*** (ENTER BORE DIA/WEB/TENON/SLOT SIZE) N25 #115= ***.*** (ENTER X DIMENSION) N45 #116= ***.*** (ENTER Y DIMENSION) N65 #117= ***.*** (ENTER Z DIMENSION)

N15 IF[#114NE#0]GOTO35 (Check a value has been entered for D)
#3000=200 (SIZE/DIA MISSING)
N35 IF[#115NE#0]GOTO55 (Check a value has been entered for X)
#3000=201 (X DIM MISSING)
N55 IF[#116NE#0]GOTO75 (Check a value has been entered for Y)
#3000=202 (Y DIM MISSING)
N75 IF[#117NE#0]GOTO95 (Check a value has been entered for Z)
#3000=203 (Z DIM MISSING)
N95

N240 G65 P9110 A90 D#114 F1 X#115 Y#116 Z#117 R10 S3 (Call ISO program 9110. Start probing at angle 90. Diameter of ***.***mm. Function 1 – Update G54. Goto X***.*** Y***.*** Z***.***. Safety distance of 10mm from job. Slot / web measure function selected).

N25 #115= ***.*** (ENTER X DIMENSION) N45 #116= ***.*** (ENTER Y DIMENSION) N65 #117= ***.*** (ENTER Z DIMENSION)

N35 IF[#115NE#0]GOTO55 (Check a value has been entered for X) #3000=201 (X DIM MISSING) N55 IF[#116NE#0]GOTO75 (Check a value has been entered for Y) #3000=202 (Y DIM MISSING) N75 IF[#117NE#0]GOTO95 (Check a value has been entered for Z) #3000=203 (Z DIM MISSING) N95

N250 G65 P9112 F1 X#115 Y#116 Z#117 R10 S4 (Call ISO program 9112. Function 1 – Update G54. Goto X***.*** Y***.*** Z***.***. Safety distance of 10mm from job. Z height measure function selected). N260 G91 G28 Z0 (Return to home position)

N270 G65 MAZATROL PROGRAM using G54 for WPC Base in Indexer

(Probing of bore) N5 #114= ***.*** (ENTER BORE DIA/WEB/TENON/SLOT SIZE) N25 #115= ***.*** (ENTER X DIMENSION) N45 #116= ***.*** (ENTER Y DIMENSION) N65 #117= ***.*** (ENTER Z DIMENSION) N85 #118= ** (ENTER TOOL NUMBER FOR UPDATING) N105 #119= ***.*** (ENTER LOWER TOLERANCE VALUE) N125 #120= ***.*** (ENTER UPPER TOLERANCE VALUE)

N15 IF[#114NE#0]GOTO35 (Check a value has been entered for D)
#3000=200 (SIZE/DIA MISSING)

N35 IF[#115NE#0]GOTO55 (Check a value has been entered for X) #3000=201 (X DIM MISSING)

N55 IF[#116NE#0]GOTO75 (Check a value has been entered for Y) #3000=202 (Y DIM MISSING)

N75 IF[#117NE#0]GOTO95 (Check a value has been entered for Z) #3000=203 (Z DIM MISSING)

N95 IF[#118NE#0]GOTO115 (Check a value has been entered for T) #3000=204 (TOOL NUMBER MISSING)

N115 IF[#119NE#0]GOTO135 (Check a value has been entered for lower tolerance) #3000=205 (LOWER TOLERANCE MISSING)

N135 IF[#120NE#0]GOTO145 (Check a value has been entered for upper tolerance) #3000=206 (UPPER TOLERANCE MISSING)

N145

N1000 T30 M6 (Select tool 30 (Probe) / Change tool)

N1010 G0 G90 X0 Y0 (Rapid / Absolute Programming / Position)

N1020 G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30)

N1030 G65P9110 A0. D#114 F800. X#115 Y#116 Z#117 R10. S11. T#118

N1040 G91 G28 Z0 (Incremental Programming / Home position / Z at 0)

N1050 (Line Number for calling Logic sequence)

N1080 #105=1 (Logic sequence count initialise)

N1060 IF[#529GT[#114+2]]GOTO1160 (Check for unexpected error before allowing logic)

N1070 IF[#529LT[#114-2]]GOTO1160 (Check for unexpected error before allowing logic)

N1090 IF[#529LT[#114+#120]]GOTO260 (If found measure result is greater than desired value + tolerance go back to start of program and re-machine)

N1100 IF[#529GT[#114-#119]]GOTO1140 (If found measure result is less than desired value - tolerance call #3000 alarm for width too narrow)

N1110 IF[#105>3]GOTO1150 (Logic sequence count check for less than three iterations)

N1120 #105=#105+1 (Logic sequence count addition)

N1130 GOTO1160

N1140 #3000=100 (CHECK WIDTH)

N1150 #3000=101 (LOOP EXCEEDED)

N1160 #3000=102 (CHECK MACHINE DIMENSIONS)

N1170 M30 (Stop program)

Nomenclature explanations:

A - Touching Angle 0 / 90 / 180 / 270 (0 is First touch on X+ of part)

C - Touch Counter - Default value used if no value set

D - Diameter of Object - Estimated diameter / length / width of feature being measured. Must be exact if using F600, F700 or F800

E - Error amount part feature may be miss-located - Default value used if no value set

F - Touching Function - Set to 0 by default, full listing below:

F0 - Only measuring, works with cycles 9110, 9111 and 9114

F1 Through F6 - Work co-ordinate G54 to G59 will be updated, works with cycles 9110, 9111 and 9114

F7 - The actual work co-ordinate will be shifted by the difference between the input values and the measuring results, works with cycles 9110, 9111 and 9114

F8 - The actual work co-ordinate will be updated by the measuring result, works with cycles 9110, 9111 and 9114

F101 Through F400 - Work co-ordinate G54.1 P1 to G54.1 P300 will be updated, works with cycles 9110, 9111 and 9114

F500 - Tolerance Check / Check position, works with cycles 9110, 9112 and 9114

F600 - Tolerance Check / Check size of diameter or distance, works with cycle 9110

F700 - Tolerance Check / Check position and size of diameter or distance, works with cycle 9110

F800 - Update Tool with T value for tool number, works with cycles 9110 and 9112

F[Value] + 1000 - Printout of measuring results from serial port

H - Probe number - Set to 1 by default

R - Safety Distance in Z - If no R value set, Z is used + 0.01mm

S - Measuring Object Type, full listing below:

- S1 Pocket without obstruction
- S2 Pocket with obstruction
- S3 Web
- S11 Bore
- S12 Bore with obstruction
- S13 Boss
- S21 Bore 3 point
- S22 Bore 3 point with obstruction
- S23 Boss 3 point
- T Tool Number to be updated
- U X Position Tolerance
- V Y Position Tolerance
- W Diameter Tolerance

X - X Centre - Estimated centreline of feature being measured. Default actual X Position. Exact position needed for F600 and F700

Y - Y Centre - Estimated centreline of feature being measured. Default actual X Position. Exact position needed for F600 and F700

Z - Z Position - Position in Z-axis at which measuring will be made. Default actual Z Position

Variable Numbers in controller:

#525 - Error Number

#526 - Measuring Result in X

#527 - Measuring Result in Y#528 - Measuring Result in Z#529 - Found Diameter or angle

Measuring a Tenon

G65P9110 Astart angle. Dsize. Ffunction number. Xcentre point value. Ycentre point value. Zmeasuring depth. R10. S3. Twhich tool to update for recut

Measuring a Slot

G65P9110 Astart angle. Dsize. Ffunction number. Xcentre point value. Ycentre point value. Zmeasuring depth. R10. S1./2. Twhich tool to update for recut

Measuring a Bore

G65P9110 A0. Dsize. Ffunction number. Xcentre point value. Ycentre point value. Zmeasuring depth. R10. S11. Twhich tool to update for recut

Logic Sequences

N111 (Line Number for calling Logic sequence) #125=Diameter part should be (Used just for logic test and user entered into this variable number or straight into calculation below) #529=Found measure result (Used just for logic test - automatically written to variable) IF[#529GT[#125+.1]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529LT[#125-.1]]GOTO2 (If found measure result is less than desired value tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH)

N3 M30 (Stop program)

Capto Bore check program C3

T30 M6 (Select tool 30 (Probe) / Change tool) G0 G90 X0 Y0 (Rapid / Absolute Programming / Position) G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30) G65P9110 A0. D30. F. X. Y. Z. R10. S11. T. G91 G28 Z0 (Incremental Programming / Home position / Z at 0) N111 (Line Number for calling Logic sequence) IF[#529LT[30.+.025]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529GT[30.-.000]]GOTO2 (If found measure result is less than desired value - tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

Capto Bore check program C4

T30 M6 (Select tool 30 (Probe) / Change tool) G0 G90 X0 Y0 (Rapid / Absolute Programming / Position) G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30) G65P9110 A0. D40. F. X. Y. Z. R10. S11. T. G91 G28 Z0 (Incremental Programming / Home position / Z at 0) N111 (Line Number for calling Logic sequence) IF[#529LT[40.+.025]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529GT[40.-.000]]GOTO2 (If found measure result is less than desired value tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

Capto Bore check program C5

T30 M6 (Select tool 30 (Probe) / Change tool) G0 G90 X0 Y0 (Rapid / Absolute Programming / Position) G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30) G65P9110 A0. D50. F. X. Y. Z. R10. S11. T. G91 G28 Z0 (Incremental Programming / Home position / Z at 0) N111 (Line Number for calling Logic sequence) IF[#529LT[50.+.025]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529GT[50.-.000]]GOTO2 (If found measure result is less than desired value tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

Capto Bore check program C6

T30 M6 (Select tool 30 (Probe) / Change tool)
G0 G90 X0 Y0 (Rapid / Absolute Programming / Position)
G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30)
G65P9110 A0. D60. F. X. Y. Z. R10. S11. T.
G91 G28 Z0 (Incremental Programming / Home position / Z at 0)
N111 (Line Number for calling Logic sequence)

IF[#529LT[63.+.025]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529GT[63.-.000]]GOTO2 (If found measure result is less than desired value - tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

Capto Bore check program C8

T30 M6 (Select tool 30 (Probe) / Change tool) G0 G90 X0 Y0 (Rapid / Absolute Programming / Position) G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30) G65P9110 A0. D80. F. X. Y. Z. R10. S11. T. G91 G28 Z0 (Incremental Programming / Home position / Z at 0) N111 (Line Number for calling Logic sequence) IF[#529LT[80.+.025]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529GT[80.-.000]]GOTO2 (If found measure result is less than desired value tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

Tenon check program

T30 M6 (Select tool 30 (Probe) / Change tool) G0 G90 X0 Y0 (Rapid / Absolute Programming / Position) G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30) G65P9110 A. D. F. X. Y. Z. R10. S3. T. G91 G28 Z0 (Incremental Programming / Home position / Z at 0) N111 (Line Number for calling Logic sequence) IF[#529GT[#125+.1]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529LT[#125-.1]]GOTO2 (If found measure result is less than desired value tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

Slot check Program

T30 M6 (Select tool 30 (Probe) / Change tool) G0 G90 X0 Y0 (Rapid / Absolute Programming / Position) G43 Z50. H30 (Activate Tool Length offset + direction / Z height of 50mm / Tool number 30) G65P9110 A. D. F. X. Y. Z. R10. S1. T. G91 G28 Z0 (Incremental Programming / Home position / Z at 0) N111 (Line Number for calling Logic sequence) IF[#529LT[#125+.1]]GOTO1 (If found measure result is greater than desired value + tolerance go back to start of program and re machine) IF[#529GT[#125-.1]]GOTO2 (If found measure result is less than desired value tolerance call #3000 alarm for width too narrow) GOTO3 N2#3000=100 (CHECK WIDTH) N3 M30 (Stop program)

10.2 BS EN ISO Standards

BS3800 - 2: 1991 – General tests for machine tools; statistical methods for determination of accuracy and repeatability of machine tools [35].

BS EN ISO 10360 - 1 : 2001 - Geometrical Product Specifications (GPS) -

acceptance and reverification tests for Coordinate Measuring Machines (CMM) – Vocabulary [36].

BS EN ISO 10360 – 2 : 2009 – Geometrical Product Specifications (GPS) – acceptance and reverification tests for Coordinate Measuring Machines (CMM) – CMM's used for measuring linear dimensions [37].

BS EN ISO 10360 - 3 : 2001 – Geometrical Product Specifications (GPS) – acceptance and reverification tests for Coordinate Measuring Machines (CMM) – CMM's with the axis of a rotary table as the fourth axis [38].

BS EN ISO 10360-4: 2001 - Geometrical Product Specifications (GPS) -

acceptance and reverification tests for Coordinate Measuring Machines (CMM) – CMM's used in scanning measuring mode [39].

BS EN ISO 10360 - 5 : 2001 - Geometrical Product Specifications (GPS) -

acceptance and reverification tests for Coordinate Measuring Machines (CMM) – CMM's using multiple stylus probing systems [40].

BS EN ISO 10360 - 6: 2001 - Geometrical Product Specifications (GPS) -

acceptance and reverification tests for Coordinate Measuring Machines (CMM) -

Estimation of errors in computing Gaussian associated features [41].

BS ISO 26303 – 1 : DRAFT – Machine tools – Reliability, availability and capability – Capability evaluation of machining processes on metal cutting machine tools [42].

BS ISO 230 - 1 : 1996 – Test code for machine tools – Geometric accuracy of

machines operating under no load or finishing conditions [43].

BS ISO 230 - 2 : 2006 – Test code for machine tools – Determination of accuracy and repeatability of positioning numerically controlled axes [44].

BS ISO 230 – 3 : 2007 – Test code for machine tools – Determination of thermal effects [45].

BS ISO 230 - 4 : 2005 – Test code for machine tools – Circular tests for numerically controlled machine tools [46].

BS ISO 230 - 5:2000 – Test code for machine tools – Determination of the noise emission [47].

BS ISO 230 - 6:2002 – Test code for machine tools – Determination of positioning accuracy on body and face diagonals (Diagonal displacement tests) [48].

BS ISO 230 - 7 : 2006 – Test code for machine tools – Geometric accuracy of axes of rotation [49].

PD ISO TR 230 – 8 : 2010 – Test code for machine tools – Vibrations [50].

PD ISO TR 230 - 9: 2005 - Test code for machine tools - Estimation of

measurement uncertainty for machine tool tests according to series ISO 230, basic equations [51].

BS ISO 230 – 10 : DRAFT – Test code for machine tools – Determination of measuring performance of probing systems of numerically controlled machine tools [52].

10.3 BallBar Method

Wired:

- Attach base to table
- Insert magnet leaving free to move initially
- Insert magnet in to spare chuck
- Insert magnet in to machine tool spindle
- Jog to central position of magnets
- Tighten base magnet into holder
- Set work-piece offsets in G54
- Program controller to interpolate in circular motions in XY plane
- Insert BallBar in to machine between magnets
- Ensure cable is placed as to not get tangled
- Use computer software to calibrate settings of BallBar
- Start monitoring within the software
- Press cycle start on machine tool controller
- Wait for cycle to finish and ensure wire does not snag
- Review results in software
- Remove equipment from machine

Wireless:

- Attach base to table
- Insert magnet leaving free to move initially
- Insert magnet in to spare chuck
- Insert magnet in to machine tool spindle
- Jog to central position of magnets
- Use spare magnetic ball for centralising
- Tighten base magnet into holder
- Set work-piece offsets in G54
- Program controller to interpolate in circular motions in XY plane
- Program controller to perform partial arcs in XZ and YZ plane for 220 degrees
- Switch on Wireless BallBar
- Place BallBar between points on calibration equipment
- Use computer software to calibrate settings of BallBar

- Insert BallBar in to machine between magnets
- Ensure door of machine is closed
- Start monitoring within the software
- Press cycle start on machine tool controller
- Wait for cycle to finish
- Review results in software
- Remove equipment from machine
- Turn off BallBar

10.4 BallBar Test Part Programs

%

O100

(WARNING!)

(Renishaw cannot guarantee that the part programs generated are)
(correct. Anyone using the part programs generated by this software)
(must ensure that the programs are suitable for the machine/controller)
(on which they are used. Part programs should only be run by personnel)
(who are fully familiar with the machine, the controller and the)
(operation of all guards, interlocks and emergency stop switches.)
(It is recommended that programs are initially tested at low speed using)
(the feedrate override control.)

N10 G21

N20 G54

N30 G90

N40 G17

N50 G64

N60 M05

N70 M19

N80 G98 F500.000

N90 G01 X-151.5000 Y0.0000 Z0.0000

N100 M00

N110 G01 X-150.0000 Y0.0000

N120 G03 X-150.0000 Y0.0000 I150.0000 J0.0000

N130 G03 X-150.0000 Y0.0000 I150.0000 J0.0000

N140 G01 X-151.5000 Y0.0000

N150 G04 X5.0

N160 G01 X-150.0000 Y0.0000

N170 G02 X-150.0000 Y0.0000 I150.0000 J0.0000

N180 G02 X-150.0000 Y0.0000 I150.0000 J0.0000

N190 G01 X-151.5000 Y0.0000

N200 M30

%

%

O104

(WARNING!)

(Renishaw cannot guarantee that the part programs generated are) (correct. Anyone using the part programs generated by this software) (must ensure that the programs are suitable for the machine/controller) (on which they are used. Part programs should only be run by personnel) (who are fully familiar with the machine, the controller and the) (operation of all guards, interlocks and emergency stop switches.) (It is recommended that programs are initially tested at low speed using) (the feedrate override control.) N10 G21 N20 G54 N30 G90 N40 G19 N50 G64 N60 M05 N70 M19 N80 G98 F500.000 N90 G01 X0.0000 Y140.4684 Z-56.7529 N100 M00 N110 G01 Y139.0776 Z-56.1910 N120 G03 Y-139.0776 Z-56.1910 J-139.0776 K56.1910 N130 G01 Y-140.4684 Z-56.7529 N140 G04 X5.0 N150 G01 Y-139.0776 Z-56.1910 N160 G02 Y139.0776 Z-56.1910 J139.0776 K56.1910 N170 G01 Y140.4684 Z-56.7529 N180 M30 %

%

O107

(WARNING!)

(Renishaw cannot guarantee that the part programs generated are) (correct. Anyone using the part programs generated by this software) (must ensure that the programs are suitable for the machine/controller) (on which they are used. Part programs should only be run by personnel) (who are fully familiar with the machine, the controller and the) (operation of all guards, interlocks and emergency stop switches.) (It is recommended that programs are initially tested at low speed using) (the feedrate override control.) N10 G21 N20 G54 N30 G90 N40 G18 N50 G64 N60 M05 N70 M19 N80 G98 F500.000 N90 G01 X140.4684 Y0.0000 Z-56.7529 N100 M00 N110 G01 X139.0776 Z-56.1910 N120 G02 X-139.0776 Z-56.1910 I-139.0776 K56.1910 N130 G01 X-140.4684 Z-56.7529 N140 G04 X5.0 N150 G01 X-139.0776 Z-56.1910 N160 G03 X139.0776 Z-56.1910 I139.0776 K56.1910 N170 G01 X140.4684 Z-56.7529 N180 M30 %

10.5 Inspection Reports

CUSTOMER PO DESCRIPTION ITEM No. PART No.		
DESCRIPTION ITEM No. PART No.		
ITEM No. PART No.		
PART No.	1 of	
REFERENCE No.		
40		
-	1 1	
	D	01 🖉 📃 🖉 D2
		+ , + , +
	· · · · ·	
c		
-		
DIMENSION	TOLERANCE	ACTUAL
Nominal Bore Size		
Bore Centre Height B1		
Bore Centre Height B1 Bore Centre Height B2		
Bore Centre Height B1 Bore Centre Height B2 Centre Line From Shank D1		
Bore Centre Height B1 Bore Centre Height B2 Centre Line From Shank D1		
Bore Centre Height B1 Bore Centre Height B2 Centre Line From Shank D1 Centre Line From Shank D2		
Bore Centre Height B1 Bore Centre Height B2 Centre Line From Shank D1 Centre Line From Shank D2		
Bore Centre Height B1 Bore Centre Height B2 Centre Line From Shank D1 Centre Line From Shank D2		

157

CTL JOB No.				
CUSTOMER PO				
DESCRIPTION				
ITEM No.		1 of		
PART No.				
REFERENCE No.				
C _		B B B		
DIMENSION	TOLE	RANCE	ACTUAL	
DIMENSION Nominal Bore Size	TOLE	RANCE	ACTUAL	
DIMENSION Nominal Bore Size Bore Centre Height B1	TOLE	RANCE	ACTUAL	
DIMENSION Nominal Bore Size Bore Centre Height B1 Bore Centre Height B2	TOLE	RANCE	ACTUAL	
DIMENSION Nominal Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon	TOLE	RANCE	ACTUAL	
DIMENSION Nominal Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon Centre Line From Tenon	TOLE	RANCE	ACTUAL	
DIMENSION Nominal Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon Centre Line From Tenon Tenon Width	C1 C2	RANCE	ACTUAL	
DIMENSION Nominal Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon Centre Line From Tenon Tenon Width	C1 C2	RANCE	ACTUAL	

CTL JOB No.				
CUSTOMER PO				
DESCRIPTION				
ITEM No.		1 of		
PART No.				
REFERENCE No.				
AØ				
-				
-	4	1		
			D1 2	
	E .	8	+,	
		_	-	
DIMENSION	то	ERANCE	ACTUAL	
DIMENSION Bore Size	то	ERANCE	ACTUAL	_
DIMENSION Bore Size Bore Centre Height B1	тоі 	ERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2		ERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O	тоі 	ERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O	C1 C2	ERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon C Centre Line From Tenon C Tenon Width	C1	ERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	C1 C2		ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	TOI		ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	TOI		ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	C1	LERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	TOI	LERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	TOI	LERANCE	ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width	TOI		ACTUAL	
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon O Centre Line From Tenon O Tenon Width tor Name:	то 		ACTUAL	

CILJUBNO.				
CUSTOMER PO				
DESCRIPTION				
ITEM No.		1 0	of	
PART No.				
REFERENCE No.				
64	Ξ.	B2	D1 / + ,	, b
DIMENSION	T(DLERANCE	ACT	UAL
DIMENSION	т	DLERANCE	ACT	UAL
DIMENSION Bore Size	T(DLERANCE	ACT	UAL
DIMENSION Bore Size Bore Centre Height B1	T(DLERANCE	ACT	UAL
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2		DLERANCE	ACT	UAL
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon	C1	DLERANCE	ACT	UAL
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon Centre Line From Tenon	C1 C2	DLERANCE	ACT	'UAL
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon Centre Line From Tenon Tenon Width	C1 C2	DLERANCE		UAL
DIMENSION Bore Size Bore Centre Height B1 Bore Centre Height B2 Centre Line From Tenon Centre Line From Tenon Tenon Width	Tr	DLERANCE		'UAL

CRAFTSMAN TOOLS Inspector Name:	Uram.+	Iteleon Uram.						
Printed on: 25/11/09 (8:44-19	DIMEN	ISION RE	PORT	X minimum -74.000	Y minimu -57.000	m Z minin -100.00))	
SERIAL NUMBER: ABC123	PA M	RT NUMBER	:	X maximum 8.000 X0,Y0,Z0 relative to Cent of Capte Bore	Y maximu 57.000 Number o	m Z maxi 0.000 f points CNC - C MAZAK	num Control	
	a	REPOR	т					
Point Position	Tolerance	d Err	Error in Position		Dimens Nominal Actus	ion Error		
X Y Z	min max	X Y	z x	Y Z		Distance/Angle/0		
-1000 -1000						40.000		
							_	
			1 i					

Craftsman Tools LTD, Side Copus, Poel Read, Otley, West Yorkshire, LS21 11E, UK

www.craftemantools.com 01943 466 788

Page 1 of 1



mikS Inprocess Messiechnik GmbH * Am Langholz 11 * D-88289 Waldburg

of www.mh-inproces.com mail to initiginh-inproces.com

Selle I von 1

		1					1								
		DI	MEN	ISIO	N R	EPC	DRT	(5		2		Ì		
CRAFT	SMAN											-	/	G	`
TO	OLS													0	,
1			PART NUMBER:							1	SF3	Y S			
I				\$99\$			2		2	-	00				
Inspecto	r sign off:	X minimum \$10085		Y minimum		Z minimum									
				\$1010\$		\$1012\$					~	10			
		X maximu \$1009\$	X maximum \$1009\$ \$1011\$		Z maximum \$1013\$		· ·			° /	1		4	D	
Printed on \$1006\$	•	X0,Y0,Z0 rela of Cap	tive to Centre to Bore	Number of \$1101\$	points	CNC - Cont \$1100\$	rol	(1		8		3	Í.	
							REP	ORT							
Point		Position		Tolerance		Position measured		ured	Error in Position		tion			Dimension	
No.												Vector	Nominal	Actual	Error
\$11025/15	X \$11035/15	\$11045/15	\$1105505	min \$1125\$/15	511268/15	\$11065/15	\$11075/15	\$11095/15	\$1100\$(15)	\$1110\$/15	2 \$1115/15	\$11125/16	S11145/15	Angleto	\$11168/15
\$1102\$/25	\$11035/25	\$11045/25	\$1105\$/25	\$1125\$/25	\$11265/25	\$11065/25	\$11075/25	\$1108\$/25	\$11095/25	\$11105/25	\$11115/25	\$11125/25	\$11145/25	\$1115\$/25	\$11165/25
\$11025/35	\$11035/35	\$11045/35	\$1105\$/35	\$1125\$/35	\$11265/35	\$11065/35	\$11075/35	\$1108\$/35	\$11095/35	\$11105/35	\$11115/35	\$11125/35	\$1114\$/35	\$1115\$/35	\$11165/35
\$1102\$/45	\$11035/45	\$11045/45	\$11055/45	\$1125\$/45	\$1126\$/45	\$11065/45	\$11075/45	\$11085/45	\$11095/451	\$1110\$/4\$	\$1115/45	\$11125/45	\$1114\$/45	\$1115\$/45	\$11165/45
\$1102\$/55	\$11035/55	\$11045/55	\$1105\$/5\$	\$1125\$/55	\$1126\$/55	\$11065/55	\$11075/55	\$1108\$/5\$	\$1109\$/55	\$1110\$/5\$	\$11115/55	\$11125/55	\$1114\$/55	\$1115\$/55	\$1116\$/55
\$11025/65	\$11035/65	\$11045/65	\$1105\$/65	\$1125\$/65	\$1126\$/65	\$11065/65	\$11075/65	\$11085/65	\$11095/65	\$11105/65	\$11115/65	\$11125/65	\$1114\$/65	\$1115\$/65	\$11165/65
\$1102\$/75	\$11035/75	\$11045/75	\$1105\$/7\$	\$1125\$/75	\$1126\$/75	\$11065/75	\$11075/75	\$1108\$/7\$	\$1109\$/75	\$1110\$/7\$	\$11115/75	\$11125/75	\$1114\$/75	\$1115\$/75	\$1116\$/75
\$1102\$/85	\$11035/8\$	\$11045/8\$	\$1105\$/8\$	\$1125\$/85	\$1126\$/85	\$11065/8\$	\$11075/8\$	\$1108\$/8\$	\$1109\$/85	\$1110\$/8\$	\$11115/8\$	\$11125/8\$	\$1114\$/85	\$1115\$/85	\$1116\$/85
\$1102\$/95	\$11035/95	\$11045/95	\$1105\$/9\$	\$1125\$/95	\$1126\$/95	\$11065/95	\$11075/95	\$1108\$/9\$	\$1109\$/95	\$1110\$/9\$	\$11115/9\$	\$11125/95	\$1114\$/95	\$1115\$/95	\$1116\$/95
\$11025/105	\$11035/105	\$1104\$/105	\$1105\$/105	\$1125\$/105	\$11265/105	\$1106\$/10\$	\$1107\$/10\$	\$1108\$/105	\$11095/105	\$11105/105	\$1111\$/10\$	\$1112\$/10\$	\$1114\$/10\$	\$11155/105	\$11165/105
\$11025/115	\$11035/11\$	\$1104\$/11\$	\$1105\$/11\$	\$1125\$/115	\$11265/115	\$1106\$/11\$	\$1107\$/11\$	\$1108\$/11\$	\$11095/115	\$11105/115	\$1111\$/11\$	\$1112\$/11\$	\$1114\$/115	\$1115\$/115	\$11165/115
\$11025/125	\$11035/12\$	\$1104\$/12\$	\$1105\$/12\$	\$1125\$/125	\$11265/125	\$1106\$/12\$	\$1107\$/12\$	\$1108\$/12\$	\$11095/125	\$11105/12\$	\$1111\$/12\$	\$1112\$/12\$	\$1114\$/125	\$1115\$/125	\$11165/125
\$11025/135	\$11035/135	\$1104\$/135	\$1105\$/13\$	\$1125\$/135	\$11265/135	\$1106\$/13\$	\$1107\$/13\$	\$1108\$/135	\$11095/135	\$11105/135	\$1111\$/135	\$1112\$/13\$	\$1114\$/135	\$11155/135	\$11165/135
\$11028/148	\$11035/145	\$1104\$/14\$	\$1105\$/14\$	\$1125\$/145	\$11268/148	\$1106\$/14\$	\$1107\$/14\$	\$11085/145	\$11095/145	\$11105/145	\$11115/145	\$1112\$/14\$	\$1114\$/145	\$11158/148	\$11168/145
\$11025/155	\$11035/155	511045/155	511055/155	\$1125\$/155	\$11265/155	\$11065/155	511075/155	\$11085/155	\$11095/155	\$11105/155	\$11115/155	511125/155	511145/155	\$11155/155	\$11165/155
\$11025/165	\$11035/165	\$11045/165	\$1105\$/165	\$1125\$/165	\$11265/165	\$11065/165	\$1107\$/16\$	\$11085/165	\$11095/165	\$11105/165	\$11115/165	\$1112\$/163	511145/165	\$11155/165	\$11165/165
\$11025/185	\$11035/195	\$11048/178	\$11055/195	\$11255/185	\$11265/185	\$11065/195	\$11075/175	\$11085/195	\$11095/185	\$11105/185	\$11116/195	\$11125/175	\$11145/195	\$11155/195	\$11165/195
\$11025/195	\$11035/195	\$11045/195	\$1105\$/195	\$11256/195	\$11265/195	\$11065/195	\$11075/195	\$11085/195	\$11095/195	\$11105/195	\$11115/195	\$11125/195	\$11145/195	\$11155/195	\$11165/195
\$11025/205	\$11035/205	\$1104\$/205	\$11055/205	\$11255/205	\$11265/205	\$11065/205	\$11075/205	\$11085/205	\$11095/205	\$11105/205	\$11115/205	\$11125/205	\$11145/205	\$11155/205	\$11165/205
\$11025/215	\$11035/215	\$1104\$/215	\$11055/215	\$11255/215	\$11265/215	\$11065/215	\$11075/215	\$11085/215	\$11095/215	\$11105/215	\$11115/215	\$11125/215	\$11145/215	\$11155/215	\$11165/215
\$11025/225	\$11035/225	\$1104\$/22\$	\$1105\$/22\$	\$1125\$/225	\$11265/225	\$11065/225	\$1107\$/22\$	\$1108\$/22\$	\$11095/225	\$11105/225	\$1111\$/22\$	\$1112\$/22\$	\$1114\$/225	\$11155/225	\$11165/225
\$11025/235	\$11035/235	\$1104\$/23\$	\$1105\$/23\$	\$1125\$/235	\$11265/235	\$11065/235	\$1107\$/23\$	\$1108\$/23\$	\$11095/235	\$11105/235	\$1111\$/23\$	\$1112\$/23\$	\$1114\$/235	\$11155/235	\$11165/235
\$11025/245	\$11035/245	\$1104\$/24\$	\$1105\$/24\$	\$11255/245	\$11265/245	\$1106\$/24\$	\$1107\$/24\$	\$11085/245	\$11095/245	\$11105/245	\$11115/245	\$11125/245	\$1114\$/245	\$11155/245	\$11165/245
\$11025/255	\$11035/255	\$1104\$/25\$	\$1105\$/25\$	\$11255/255	\$11265/255	\$1106\$/25\$	\$1107\$/25\$	\$11085/255	\$11095/255	\$11105/255	\$1111\$/255	\$1112\$/25\$	\$1114\$/255	\$11155/255	\$11168/255
\$11025/265	\$11035/265	\$1104\$/26\$	\$1105\$/26\$	\$1125\$/265	\$11265/265	\$1106\$/26\$	\$1107\$/26\$	\$1108\$/26\$	\$11095/265	\$11105/26\$	\$1111\$/26\$	\$1112\$/26\$	\$1114\$/26\$	\$1115\$/265	\$11165/265
\$11025/275	\$11035/275	\$1104\$/27\$	\$1105\$/27\$	\$1125\$/275	\$11265/275	\$1106\$/27\$	\$1107\$/27\$	\$1108\$/27\$	\$11095/275	\$11105/275	\$1111\$/27\$	\$1112\$/27\$	\$1114\$/275	\$1115\$/275	\$11165/275
\$11025/285	\$11035/285	\$1104\$/28\$	\$1105\$/28\$	\$11255/285	\$11265/285	\$1106\$/28\$	\$1107\$/28\$	\$1108\$/28\$	\$11095/285	\$11105/28\$	\$1111\$/285	\$1112\$/28\$	\$1114\$/285	\$11155/285	\$11165/285
\$11025/295	\$11035/295	\$1104\$/29\$	\$1105\$/29\$	\$1125\$/295	\$11265/295	\$1106\$/29\$	\$1107\$/29\$	\$1108\$/29\$	\$11095/295	\$11105/295	\$1111\$/29\$	\$1112\$/29\$	\$1114\$/295	\$11155/295	\$11165/295
\$11025/305	\$11035/305	\$1104\$/30\$	\$1105\$/305	\$1125\$/305	\$11265/305	\$1106\$/30\$	\$1107\$/30\$	\$1108\$/30\$	\$11095/305	\$11105/305	\$1111\$/30\$	\$1112\$/30\$	\$1114\$/305	\$1115\$/305	\$11165/305

Craftsman Tools LTD, Side Copue, Poel Read, Otiey, West Yorkshire, LS21 11E, UK

www.craftenambolic.com 01943 456 788



Confession Tools LTD, Sida Copus, Paul Rand, Otive, West Voltables, 1521 107, UK

www.underarthelic.com 05/40 456 788

Page Loft



Confluence Tools 11TD, Side Copus, Fool Read, Ottyp, West Voltables, 1521 107, UK

www.underarticlic.com 00940-466-288

Page Loft